

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
5. Indicate Type of Lease STATE ☐ FEE ☒
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
S&I Oil Company

3. Address of Operator
5422 U.S. Hwy. 64 Farmington, New Mex.

4. Well Location
Unit Letter I : 1840' Feet From The South Line and 520' Feet From The East Line
Section 11 Township 29N Range 15W NMPM San Juan County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☐
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.
1. Check anchors & prepare location
 2. R.U. Service unit. Kill well if necessary. Nipple down well head. Nipple up BOP & stripper head
 3. Pull & lay down production equipment.
 4. Go in hole with work string to 4523' & spot cement plug up to 4025' to cover perfs & top of Gallup. WOC 4 Hrs. & tag cement. If plug is in place go to step 5, if not fill to 4025'
 5. Roll hole with 8.4 lb. 40 visc mud.
 6. Test Casing.
 7. Set a cement plug from 1233' to 1333' to cover top of Cliffhouse at 1283'.
 8. Set a cement plug from 248' to 348' to cover pipe shoe at 298'.
 9. Set a 10 sx. surface plug.
 10. Set dryhole marker, level & restore location to OCD requirements

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Troy R. Strickland TITLE Managing Director DATE 1-11-95
TYPE OR PRINT NAME Troy R. Strickland TELEPHONE NO. 325-1704

(This space for State Use)

APPROVED BY Johnny Robinson TITLE DEPUTY OIL & GAS INSPECTOR, DIST. #3 DATE JAN 12 1995

CONDITIONS OF APPROVAL, IF ANY:

Notify in time to witness



BRUCE KING
GOVERNOR

STATE OF NEW MEXICO
ENERGY, MINERALS AND NATURAL RESOURCES DEPARTMENT

OIL CONSERVATION DIVISION
AZTEC DISTRICT OFFICE

ANITA LOCKWOOD
CABINET SECRETARY

1000 RIO BRAZOS ROAD
AZTEC, NEW MEXICO 87410
(505) 334-6178



S&I Oil Co.
Dorothy #1
1840' FSL, 520' FEL
I-11-29N-15W, San Juan County, N.M.

Downhole Equipment
Unknown
T.D. 4665

1. Check anchors & prepare location.
2. R.U. Service unit. Kill well if necessary. Nipple down well head. Nipple up BOP & stripper head.
3. Pull & lay down production equipment.
4. Go in hole with work string to 4523' & spot cement plug up to 4025' to cover perms & top of Gallup. WOC 4 Hrs. & tag cement. If plug is in place go to step 5, if not fill to 4025'.
5. Roll hole with 8.4 lb. 40 visc. mud.
6. Test casing.
7. Set a cement plug from 1233' to 1333' to cover top of Cliffhouse at 1283'.
8. Set a cement plug from 248' to 348' to cover surface pipe shoe at 298'.
9. Set a 10 sx. surface plug.
10. Set dryhole marker, level & restore location to OCD requirements.

RECEIVED
DEC - 2 1994
OIL CON. DIV.
DIST. 3