Submit 3 Copies o Appropriate
District Office

State of New Mexico Energy, Minerals and Natural Resources

Form C-103 Revised 1-1-89

OIL CONSERVATION DIVISION DISTRICT I WELL API NO. P.O. Box 1980, Hobbs, NM 88240 P.O.Box 2088 3004524444 Santa Fe, New Mexico 87504-2088 **DISTRICT II** Indicate Type of Lease P.O. Drawer DD, Artesia, NM 83210 FEE X STATE **DISTRICT III** 6. State Oil & Gas Lease No. 1000 Rio Brazos Rd., Aztec, NM 87410 SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) Payne A 1. Type of Well: WELL OTHER 8. Well No. 2. Name of Operator Attention Pat Archuleta #1E AMOCO PRODUCTION COMPANY 9. Pool name or Wildcat 303-830-5217 Otero Chacra/Blanco MV/ Basin DK Colorado 80201 Denver P.O. Box 800 4. Well Location WEST 2080 SOUTH 530 Feet From The 1 ine Line and Feet From The **Unit Letter** SAN JUAN 19 10W NMPM County 29N Range Township Section 10. Elevation (Show whether DF, RKB, RT, GR, etc.) Check Appropriate Box to Indicate Nature of Notice Report or Other Data 11. SUBSEQUENT REPORT OF: NOTICE OF INTENTION TO: ALTERING CASING PLUG AND ABANDON REMEDIAL WORK PERFORM REMEDIAL WORK COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT **TEMPORARILY ABANDON** CHANGE PLANS CASING TEST AND CEMENT JOB **PULL OR ALTER CASING** X DHC OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. Amoco Production Company requests permission to downhole commingle this well per the attached procedures. If you have any questions contact Steve Webb at (303) 830-4206. OIL COM. DIV. Reference NMOCD Administrative Order No. DHC-1288. I hereby certify that the information above is true and complete to the best of my knowledge and belief. 02-13-1997 Staff Assistant DATE _ TITLE _ SIGNATURE TA 303-830-5217 TELEPHONE NO. Pat Archuleta TYPE OR PRINT NAME (This space for State TITLE PUTY ON & GREET COLOR CIST. 53 DATE DRIGINAL SIGNED BY ERNIE BUSCH

APPROVED BY -

Payne A #1E
Orig. Comp. 1/81
TD = 6360' PBTD = 6309'
GL = 5476', KB = 5488'
Page 2 of 2

- 1. Check location for anchors. Install if necessary. Test anchors. Record shut-in casing, tubing, and bradenhead pressures.
- 2. MIRUSU. Blow down well. Kill if necessary with 2% KCL.
- 3. POOH with 2 3/8" short string. TOOH w/ 2 3/8" long string.
- 4. TIH w/ tbg x mill. Mill out Model D packer. Clean out to PBTD. TOOH w/ tbg.
- 5. TIH w/ tbg x packer. Set packer at 6040-50'. Flow/swab test DK. Report DK test to Denver to decide on need for and type of stimulation. DK may be damaged from previous well work. TOOH w/ tbg x packer.
- 6. TIH w/ 2 3/8" tbg (1/2 mule shoe on bottom w/ seating nipple one joint up). Land tubing at 6170-80'. Flow or swab well to clean up. ND BOP. NU wellhead. RDSU x move off.
- 7. Flow well to clean-up. Swab if necessary. Record and report flow test results. Turn well over to production for first delivery of commingled well.

Contact for questions:

Steve Webb (303)830-4206