

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator Greenwood Holdings Inc.		8. Farm or Lease Name Fruitland
3. Address of Operator 5600 S. Quebec St., Ste 150C, Englewood, CO 80111		9. Well No. 2
4. Location of Well UNIT LETTER <u>F</u> <u>2150</u> FEET FROM THE <u>North</u> LINE AND <u>1750</u> FEET FROM THE <u>West</u> LINE, SECTION <u>3</u> TOWNSHIP <u>29N</u> RANGE <u>15W</u> NMPM.		10. Field and Pool, or Wildcat Meadows
15. Elevation (Show whether DF, RT, GR, etc.) 5219 G.L.		12. County San Juan

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

P & A Procedure

1. Set plug TD (4582') to 50' above top perf (4056') with 41 sx cement.
2. Load hole w/9# fresh water gel.
3. Set CIBP @1320' on wireline, perforate Mesa Verde @1270', pump 20sx cement behind casing.
4. Set 100' plug over CIBP with 10 sx cement.
5. Perforate Pictured Cliffs @750', set 100' plug behind casing w/20sx cement.
6. Set 100' plug over base of surface casing (348'KB) w/20sx cement.
7. Set 10sx cement at surface in top of 8 5/8" csg.
8. Cut off 8 5/8" csg below surface flange. Weld plate over casing 3' below ground level. Install dry hole marker. Clean up and level location as per instructions from land owner.
9. New Mexico Oil & Gas Commission must be notified 24 hours prior to commencing P & A operations.

RECEIVED
JUN 15 1988
OIL CON. DIV.
DIST. 3

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED James P. Roper TITLE Operations Manager DATE June 9, 1988
Original Signed by CHARLES GHOLSON DEPUTY OIL & GAS INSPECTOR, DIST. #3

JUN 15 1988

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY: