

3-000
1-JTH
1-F

NO. OF COPIES RECEIVED	✓
DISTRIBUTION	
SANTA FE	1
FILE	1 ✓
U.S.G.S.	
LAND OFFICE	
OPERATOR	2

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State Fee
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Beta Development Co.	8. Farm or Lease Name Vasaly Com.
3. Address of Operator 125 Petroleum Club Plaza, Farmington, New Mexico	9. Well No. 1
4. Location of Well UNIT LETTER A , 970 FEET FROM THE North LINE AND 1090 FEET FROM THE East LINE, SECTION 22 TOWNSHIP 30 N RANGE 11 W NMPM.	10. Field and Pool, or Wildcat Basin Dakota
15. Elevation (Show whether DF, RT, GR, etc.) 5879' G.L.	12. County San Juan

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to repair casing leak as follows:

Rig up workover unit, pull 2-3/8" EUE tbg. GIH w/Howco E-Z Drill cast iron bridge plug on tbg, set @ 6550'. Load hole and test tbg, POH. Pick up HowCo RTTS packer, GIH w/tbg and find csg leak. Squeeze hole in csg w/350 sx cement, WOC. Drill out cement, test csg to 2000#; if any leaks, re-squeeze. Drill out cast iron bridge plug, CO to T.D. POH, go back in hole w/tbg open-ended w/bar collar on bottom. Swab well off & release rig.



18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Original signed By
D. E. BAXTER

SIGNED _____ TITLE **Superintendent** DATE **November 13, 1969**

APPROVED BY *[Signature]* TITLE *[Signature]* DATE **11-13-69**

CONDITIONS OF APPROVAL, IF ANY: