

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir,
Use "APPLICATION FOR PERMIT--" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well
☐ Oil Well ☐ Gas Well ☒ Other WSW

2. Name of Operator
Central Resources, Inc. c/o Playa Minerals & Energy, Inc.

3. Address and Telephone No.
650 N. Sam Houston Pkwy. E. Suite 500 Houston, Tx. 77060

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
1635' FSL, 1446' FEL, Sec. 4, T30N, R16W

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other

☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Central Resources Inc. plans to plug and abandon the referenced well as outlined in Attachment "A".



14. I hereby certify that the foregoing is true and correct

Signed Kenneth W. Jackson
Kenneth W. Jackson

Title Regulatory Compliance

Date 6/22/00

(This space for Federal or State office use)

Approved by _____

Title _____

Date 8/1/00

Conditions of approval, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any manner within its jurisdiction.

*See Instruction on Reverse Side

**Plugging and Abandonment Procedure
Horseshoe Gallup Unit No. 3 WSW
Attachment "A"**

Well Data:

Location: 1635' FSL, 1446' FEL, Section 4 T30, R16W
San Juan County New Mexico

TD: 2716'
PBTD: 2670'

Surface Casing: 10-3/4", 32.75# ppf, H-40 set @ 102' with 120 sacks

Production Casing: 7", 20# set @ 2713' with 260 sacks

Perforations: 1808' -2662'

Procedure:

1. Pick up 2-3/8" tubing work string and run in hole with bit and scraper.
2. Trip in hole with cement retainer and set at 1708.'
3. Mix and pump 108 sacks of cement below retainer. Pull out of retainer and set 30 sack plug on top of retainer. Estimated top of cement @ 1554'.
4. TOH and run in hole with open ended tubing and circulate a balanced plug of 1000 sacks from 1554' to 1039'.
5. Pull out of hole.
6. Perforate squeeze holes at 115'.
7. Establish circulation down casing, through annulus and out bradenhead.
8. Mix and pump 30 sacks of cement down casing through perforations, into annulus and out through bradenhead. Leave casing and annulus full of cement.
9. Cut off casing and install regulation dry hole marker.
10. Reclaim location as per BLM regulations.