

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF - 078212

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

McCord

9. WELL NO.

7

10. FIELD AND POOL, OR WILDCAT

Basin Dakota

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 4, T-30N, R-13W
N.M.P.M.

12. COUNTY OR PARISH

San Juan

13. STATE

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL ☐ GAS ☒ OTHER ☐
WELL WELL

2. NAME OF OPERATOR
Southern Union Production Company

3. ADDRESS OF OPERATOR
P.O. Box 808, Farmington, New Mexico 37401

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
1530 Ft. from the North line and 890 ft. from the East line.

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5720' R.K.B.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- Moved in and rigged up L & M Ventures pulling unit.
- Tag T.D. @ 6485' w/1-1/2" E.U.E. Tubing.
- Pumped 30 sks cmt. plug 6485' to 6184' and pulled tubing.
- Perforated 4-1/2" casing @ 5750'; 1760'; and 750'.
- Ran Baker model "R" packer on 1-1/2" tubing, spotted 15 sks cmt. across squeeze holes @ 5750'. Pull PKR to 5500', set PKR & squeeze 10 sks into perfs, pulled PKR to 1760' & spot 20 sks cmt. across squeeze holes @ 1760', pulled PKR to 1500' & set. Squeezed 15 sks into perfs, pulled PKR to 750' & squeezed 20 sks cmt. across perfs, pulled PKR to 500' and squeezed 15 sks cmt.
- Pumped 5 sks plug @ surface.
- Set dry hole marker.
- Will close roads and reseed location in spring of 1977.

APPROVED

E. T. McGRATH

RECEIVED

DEC 6 1976

18. I hereby certify that the foregoing is true and correct

SIGNED James N. Bonaventura

TITLE Production Superintendent

DATE 12/1/76

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE _____

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.