· · · · · · · · · · · · · · · · · · ·	UNITED STATES TMENT OF THE INTER EAU OF LAND MANAGEMEN		5. LEASE DESIGNATION AND SERIAL NO. AF-080597			
SUNDRY NO	OTICES AND REPORTS	ON WELLS vack to a different reservoir.	6. IF INDIAN, ALLOTTEE OR TRIBE NAME			
1.						
OIL GAS WELL X OTHER			S. PARM OR LEASE NAME			
Tenneco Oil Company						
3. ADDRESS OF OPERATOR	9. WELL NO.					
4. LOCATION OF WELL (Report location	WOOd, CO 80155 n clearly and in accordance with an	y State requirements.*	5A 10. PIBLD AND POOL, OR WILDCAT			
See also space 17 below.) At surface	Blanco Mesaverde					
1515' FNL, 1500' FWL	1515' FNL, 1500' FWL					
14. PERMIT NO.	15. BLEVATIONS (Show whether	DF, RT, GR, etc.)	Sec. 27, T30N R8W 12. COUNTY OR PARISH 18. STATE			
	5881' GL		San Juan NM			
16. Check	Appropriate Box To Indicate	Nature of Notice, Report, or (Other Data			
NOTICE OF IN	TENTION TO:	PERSON	UBNT REPORT OF:			
TEST WATER SHUT-OFF	PULL OR ALTER CASING	WATER SEUT-OFF	REPAIRING WELL			
PRACTURE TREAT	MULTIPLE COMPLETE	FRACTURE TREATMENT	ALTERING CASING			
SHOOT OR ACIDIZE	ABANDON®	SHOOTING OR ACIDIZING (Other)	ABANDONMENT*			
(Other) Dual Fruitlar		(Note: Report result	s of multiple completion on Well pletion Report and Log form.)			
I I A A A A A A A A A A A A A A A A A A	openations (Classic state all pertin	ent details, and give pertinent dates	, including estimated date of starting any cal depths for all markers and sones perti-			
		0C OIL (T 0 7 1985 CON. DIV.			
18. I hereby certify that Ale forefold SIGNED (This space for Federal or State APPROVED BY CONDITIONS OF APPROVAL, I	office use) TITLE	enior Regulatory Analy	APPROVED st DATE 9/26/85 OCT-03 1985 FAMORIAL FAREA MANAGER			
6. 7	*See Instruction	ons on Reverse Side	FARMINGTON RESOURCE AREA			

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

232' 2850' 3002 Mesa Verde 4188'-5232 (25 zones) 52731

4704/2	
LEASE Gartner LS	
WELL NO. 5 A	
CASING:	
9-5/8"OD, 32.3 LB,H-40 CSG.W/224 cf	_sx
TOC @ surf . HOLE SIZEDATE 11-10-77	<u>'</u>
REMARKS	
7 "OD, 20 LB, K-55 CSG.W/ 353 cf	_sx
TOC @ 1000'. HOLE SIZEDATE 11-13-7	7
REMARKS	
4-1/2"OD, 10.5 LB, K-55 CSG.W/ 430 cf	_sx
TOC @ HOLE SIZEDATE 11-17-7	7
REMARKS TOL @ 2850'	
TUBING:	
2-3/8 "OD, 4.7 LB, J-55 GRADE, 8 RD, EUE	CPLG
LANDED @ 5213' SN, PACKER, ETC	
"OD, LB, GRADE, RD,	CPLG
LANDED @ SN, PACKER, ETC	,,,,,,,,,,
PUMP RODSANCHOR	

DETAILED PROCEDURE:

- MIRUSU. Kill well w/2% KCl water. NDWH NUBOP. RIH and tag PBTD. CO w/foam if necessary. Tally out of hole w/tbg.
- Set Model D pkr w/exp plug @ ± 2700' on W.L. Dump 2 sxs sd on pkr. Load hole w/2% KCl water. PT casing to 2500 psi. NDBOP and replace single tubing head w/dual tubinghead. NUBOP.
- Run cased hole GR—CNL—CCL from 2700' to surface. Telecopy results to Denver.
- Perforate Fruitland Coal as per G. E. recommendation w/4" premium charge casing gun and 2 JSPF.
- 5. RIH w/7" fullbore packer, S/N & 2-3/8" tbg.
 Set pkr ± 150' above perfs. PT csg to 500
 psi. Break dn perfs w/2% KCl water. Acidize
 Fruitland Coal perfs down tbg w/40 gal per
 perf'd ft. weighted 15% HCl and 50% excess
 ball sealers. Release pkr & RIH past perfs.
 Blow hole dry w/N2. POOH w/tbg, S/N & pkr.

PROCEDURE - PAGE 2

LEASE	NAME:_	Gartner LS	WELL	NUMBER:	5 A
-------	--------	------------	------	---------	-----

- 6. Frac Frt. Coal dn csg w/70 quality foamed 2% KCl water w/20# gel and 20/40 sd @ 40 BPM & 2500 psi max. Call Denver for frac design. SI for 2 hrs and flow back to pit through 1/2" tapped bull plug.
- 7. Kill well w/2% KCl water. RIH w/2-3/8" tbg w/muleshoe on bottom and F/N 1 jt off btm. Position seal assy & blast jts to land the tbg @ ± 5230' w/blast jts across from Frt Coal intervals. Co to Model D pkr w/foam. Knock out plug and land long string.
- 8. RI w/1-1/4" tbg w/S/N. Pump out plug and perforated, oranged peeled sub on bottom. Land short string @ + btm of Frt Coal perfs.
- 9. NDBOP. NUWH. Pump out exp check from long string. Swab in Dakota if necessary. Pump out plug in short string and kick around w/N_2 . FTCU.
- 10. SI Frt Coal for AOF.