

(Cont'd)

8-28-90 Unload fishing tools and 11 drill collars, strap and caliper.

Pick up 6-1/8" OS with 4-3/4" grapple, bumper sub, jars, string float, one 4-3/4" drill collar, F nipple (1.875" ID), 9 more 4-3/4" drill collars, accelerator, 1 jt of drill pipe, N nipple (2.25" ID); overall length = 376.86'. TIH to 2932'. Transfer 230 bbls mud from NEBU #424.

Condition and mix mud to weight 10.7 ppg, viscosity 56 sec.

Attempt to kill well with mud, pump 135 Bbls, no returns to surface. Had very weak gas flow to surface. Shut in well to mix mud.

8-29-90 7" casing at 2940'; open hole 2940-3278'.

TIH, circulating well with mud every 5 stands; now at 2332'.

Mix mud.

Attempt to circulate well with 10.6 ppg mud; pumped 100 Bbls to get returns. Circulate out gas bubble and gas-cut mud. Lost returns, pumped 65 Bbls with some returns, shut down to mix mud.

Haul 160 Bbls of 11.7 ppg mud from storage and cut weight back to 10.4 ppg.

Pull 14 stands of drill pipe to 2080', well started kicking. Shut well in, casing pressure @ 800 psi in 15 minutes. Circulate out gas bubble and gas-cut mud, lost circulation. Pull 12 stands to 1324', circulate with partial returns for 15 minutes, then lost returns.

Cut mud weight back to 10.0 ppg.

Pull 9 stands drill pipe to 720', circulate 10.0 ppg mud with full returns.

TIH, circulate well every 5 stands.

8-30-90 7" casing at 2940'; open hole 2940-3278'.

POOH with overshot.

Circulate at 2332'. TIH, circulate at 2962' with mud weight 10.1 ppg, viscosity 54 sec.

(Cont'd)

8-30-90 Pick up swivel, circulate down from 2962' to 3073'; 8' bridge at 3050' - pipe torquing, pump pressure increased @ 3073'. Pull up, had 15,000# overpull, lost drag at 3063'. Pump pressure stayed high, set down several times. POOH, recovered 17" piece of drill collar; skirt of overshot had friction bite on drill collar.

Change skirt on overshot. Cut 450' of drilling line.

TIH to 2932'. Circulate hole, condition mud to 10.1 ppv and viscosity 60 sec.

Try to get on fish.

POOH, could not get grapple down to top of fish.

Wait on fishing tools.

Pick up 5-5/8" OD short catch overshot with 4-3/4" grapple. TIH to 2932' and circulate well.

Tag fish at 3063'; pipe torques, pump pressure increases. Jar fish down, pick up, had 15,000# pull over string weight. Work from neutral to 15,000# over, fish appeared to move up hole. Lost drag and pump pressure, attempt to get back on fish, could not.

8-31-90 7" casing at 2940'; open hole 2940-3278'.

Fishing for drill collars.

Finish POOH, recovered 6" piece of drill collar, unable to get drill collar out of overshot.

Wait on new overshot skirt and grapple for short catch overshot. Mix mud to build volume.

Pick up overshot with 4-3/4" grapple, TIH, break circulation at 2940', trip to top of fish at 3104'. Catch fish, pick up 36,000# over string weight, lost drag and pump pressure.

POOH with 5" piece of 4-3/4" drill collar.

TIH with short catch overshot with 4-3/4" grapple, circulate at 2940'. TIH to top of fish at 3104'. Catch fish, pick up 30,000# over string weight, pull fish up hole approximately 20', lost drag.

POOH, had no recovery.