State of New Mexico

Form C-103

to Appropriate District Office	Energy, Minerals and Natural Res	ources Department	Revised 1-1-89
DISTRICT I P.O. Box 1980, Hobbs, NM 88240	OIL CONSERVATION DIVISION P.O.Box 2088		WELL API NO.
DISTRICT II	Santa Fe. New Mexico 8	7504-2088	3004510371
P.O. Drawer DD, Artesia, NM 88210			5. Indicate Type of Lease STATE FEE FEE
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 8	/4 10		6. State Oil & Gas Lease No.
SUNDRY N	OTICES AND REPORTS ON W	ELLS	
(DO NOT USE THIS FORM FOR	PROPOSALS TO DRILL OR TO DEEPE SERVOIR. USE "APPLICATION FOR P	N OR PLUG BACK TO A FRMIT"	7. Lease Name or Unit Agreement Name
(FOR	M C-101) FOR SUCH PROPOSALS.)		Jacquez LS
1. Type of Well:	V		
OIL GAS WELL 2. Name of Operator	Attention:		8. Well No.
Amoco Production Company		ke Curry	1
Address of Operator P.O. Box 800 Denver	Colorado 80201		9. Pool name or Wildcat Blanco Mesaverde
4. Well Location	990 Feet From The North	Line and 9	90 Feet From The East Line
Unit Letter :	Feet From The Worth	Line and	reet Flom The Eme
Section 29	•		NMPM San Juan County
	10. Elevation (Show wheth	ner DF, RKB, RT, GR, etc.) 6345' DF	
11. Check	Appropriate Box to Indicate l		
NOTICE OF	INTENTION TO:	SU	BSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING	OPNS. PLUG AND ABANDONMENT X
PULL OR ALTER CASING]	CASING TEST AND CE	MENT JOB
OTHER:		OTHER:	
12. Describe Proposed or Completed work) SEE RULE 1103.	Operations (Clearly state all pertinent dete	nils, and give pertinent dates,	including estimated date of starting any proposed
Please see attached.			
			A EGE V V
			2 1003
			NOV2 2 1993
			OIL CON. DIM.
			DIST. 3
I hereby certify that the information	above is true and complete to the best of	my knowledge and belief.	
mile	Cim	Business	Analyst
SIGNATURE	Mike Curry		TELEPHONE NO.
TYPE OR PRINT NAME	wike oury		A ALEXAN FRONTAL TOOL
(This space for State Use)			INSPECTOR DIST #3 NOV 2 2 199
APPROVED BY Original Signer	d by Charles Gholson	DEPUTY OIL & GAS	INSPECTOR, DIST. #3 DATE NOV 2 2 197

MIRUSU (11-10-93) & Held safety meeting. SICP 125, SITP 125, & SI Bradenhd 0. BLWDN & KW. NDWH & NUBOP. TOH w/ tbg & RU HLS. TIH w/ GR. TOH. TIH & set cmt ret @ 4707'. Ld hole, run CBL. RD HLS & SDFN.

TIH w/ tbg & sting into ret @ 4707'. RU HES. Circ hole cln & press tst csg to 500 psi. Sting into ret press to 200 psi, would not take cmt. Sting out ret & spot 28 sx CL B Neat cmt on top of ret to 4551'. TOH & LD 5 jts, RO @ 4551'. Spot 73 sx mud to 2750'. TOH & LD 60 jts tbg. RI HES & TOH and perf w/2 SPF @ 2750'. TIH w/ ret set @ 2700'. Pmpd 26 sx CL B Neat cmt below ret, sting out & spot 28 sx CL B Neat cmt on top of ret to 2550'. TOH & LD 5 jts tbg and RO. Spot 43 sx mud to 1700'. TOH & LD 27 jts tbg. TIH w/ HLS and perf w/2 SPF @ 1700'. TOH. Pmp on perfs 1 BBL/min @ 1100 psi, RD HLS. TIH 500'. SDFN.

TIH HLS & set ret @ 1670'. Pmpd 50 sx CL B Neat cmt below ret, sting out & spot 28 sx CL B Neat cmt to 1520'. TOH & LD 5 jts tbg. Spot 34 sx mud to 500'. TOH w/ tbg. TIH HLS & perf w/2 SPF @ 500'. Pmp on perfs to 2000 psi, could not pmp into. TIH HLS perf w/2 SPF @ 260'. Pmp on perfs @ 260'. Pmp on perfs & circ to surf. TIH w/ tbg to 540' & spot 45 sx CL B Neat cmt to 260'. TOH & LD tbg. Pmp 112 sx CL B Neat cmt dn csg out perf & circ to surf out Bradenhd. Circ out good cmt. RD HES.

Cut off WH and inst P&A marker. RDMOSU (11-13-93)

