State of New Mexico Energy, Minerals and Natural Resources Department Oil Conservation Division

	Sundry Notices and Reports on Wells
· · · · · · · · · · · · · · · · · · ·	
	API # (assigned by OCD) 30-045-11177
1. Type of Well	5. Lease Number
GAS	J
	6. State Oil&Gas Lease #
	DISCO TO THE E-3520-1-NM
2. Name of Operator	Lease Name/Unit Name
BURLINGTON	411 FEB 1 2 1000 W
OIL 8	GAS COMPANY 2 1999 San Juan 32-9 Unit
2 Addmon C Phone Vo. of Orange	Offication No.
3. Address & Phone No. of Operat PO Box 4289, Farmington, NM	
10 Box 4209, Farmingcon, NA	87499 (505) 326-9700 Day 9. Pool Name or Wildcat Blanco Mesaverde
4. Location of Well, Footage, Se	
	32-N, R-9-W, NMPM, San Juan County
Type of Submission	Type of Action
X Notice of Intent	Abandonment Change of Plans
Subsequent Report	Recompletion New Construction Plugging Back Non-Routine Fracturing
babbequene Report	Casing Repair Water Shut off
Final Abandonment	Altering Casing Conversion to Injection
	X Other -
It is intended to repair t attached procedure	the tubing on the subject well according to the .
(This space for State Use)	(MEL5) Regulatory Administrator_February 10, 1999
_	_
OFIGINAL SIGNED BY CHARLIE T	Title DEPUTY OIL & GAS INSPECTOR DIST. 43 Date FEB 12 1999
Approved by	TitleDate

San Juan 32-9 Unit #63

Mesaverde 1756'FNL, 1645' FEL

Unit G, Section 36, T-32-N, R-9-W

Latitude / Longitude: 36° 56.6015' / 107° 43.6605'

DPNO: 6937401 **Tubing Repair Procedure**

- 1 Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. Notify BROG Regulatory (Peggy Bradfield 326-9727) and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS/WIMS. Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
- 2. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. ND WH and NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
- 3. Mesaverde, 2-3/8", 4.7# tubing is set at 5894'. Release donut, pick up additional joints of tubing and tag bottom. (Record depth.) PBTD should be at +/-5986'. TOOH with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build up and notify Operations Engineer.
- 4. If fill is encountered, TIH with 4-3/4" bit, bit sub and watermelon mill on 2-3/8" tubing and round trip to below perforations, cleaning out with air/mist. NOTE: When using air/mist, minimum mist rate is 12 bph. If scale is present, contact Operations Engineer to determine methodology for removing scale from casing and perforations.
- 5. TIH with one joint of 2-3/8" tubing with an expendable check on bottom and a seating nipple one joint off bottom then ½ of the 2-3/8" production tubing. Run a broach on sandline to insure that the tubing is clear. TIH with remaining 2-3/8" tubing and then broach this tubing. Replace any bad joints. CO to PBTD with air/mist. PU above the perforations and flow the well naturally, making short trips for clean up when necessary.
- Land tubing at ±5902'. ND BOP and NU WH. Pump off expendable check. Connect to casing 6. and circulate air to assure that expendable check has pumped off. Obtain pitot gauge up the tubing. If well will not flow up the tubing, make swab run to SN. RD and MOL. Return well to production.

Recommended: M. E. Hutuy
Operations Engineer

Approved:

Drilling Superintendent

Operations Engineer: Mary Ellen Lutev

> Office - (599-4052) Home - (325-9387) Pager - (324-2671)