


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 078215-A
Unit Vanderslice #1

SUNDRY NOTICES AND REPORTS ON WELLS

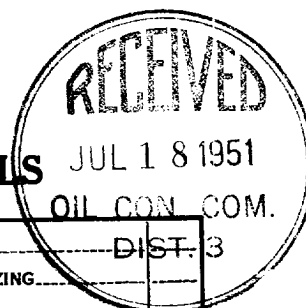

| | | |
|--|--|---|
| NOTICE OF INTENTION TO DRILL | SUBSEQUENT REPORT OF WATER SHUT-OFF | |
| NOTICE OF INTENTION TO CHANGE PLANS | SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING | |
| NOTICE OF INTENTION TO TEST WATER SHUT-OFF | SUBSEQUENT REPORT OF ALTERING CASING | |
| NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL | SUBSEQUENT REPORT OF REDRILLING OR REPAIR | |
| NOTICE OF INTENTION TO SHOOT OR ACIDIZE | SUBSEQUENT REPORT OF ABANDONMENT | |
| NOTICE OF INTENTION TO PULL OR ALTER CASING | SUPPLEMENTARY WELL HISTORY | |
| NOTICE OF INTENTION TO ABANDON WELL | Subsequent Report of Accident | X |

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 17, 1951

Vanderslice
Well No. 1 is located 1600 ft. from (N) line and 930 ft. from (E) line of sec. 19
SW 1/4 NW 1/4 (Lot 2) Sec. 19 T-32N R-10W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
La Plata Field San Juan County New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

At about 2:45 P.M. Sunday, July 1, 1951, the daylight crew reported lost circulation at 4462 ft. The daylight crew apparently had the rams closed when the evening tour crew came on and no doubt, the well was kicking some mud. The evening tour driller picked up the kelly in an effort to move the drill pipe and apparently the tool joint on the first joint below the kelly, struck the blowout preventor with terrific force, causing the rig to collapse, falling on the walk and casing rack.

The old derrick has been removed and new one raised in order to complete the well.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company SOUTHERN UNION GAS COMPANY
1104 Burt Building
Address Dallas 1, Texas

By H. C. Montague (y)
Title Drilling Superintendent

10/10/10

1. The first part of the report discusses the importance of maintaining accurate records of all transactions. This is essential for ensuring the integrity of the financial system and for providing a clear audit trail. The second part of the report focuses on the need for regular communication and collaboration between all stakeholders involved in the process. This includes not only the management team but also the staff and external partners. The third part of the report outlines the specific steps that need to be taken to implement these recommendations. This includes the development of a detailed action plan, the assignment of responsibilities, and the establishment of a timeline for completion. The final part of the report provides a summary of the key findings and a conclusion that emphasizes the importance of ongoing monitoring and evaluation.

2. The second part of the report discusses the importance of maintaining accurate records of all transactions. This is essential for ensuring the integrity of the financial system and for providing a clear audit trail. The third part of the report focuses on the need for regular communication and collaboration between all stakeholders involved in the process. This includes not only the management team but also the staff and external partners. The fourth part of the report outlines the specific steps that need to be taken to implement these recommendations. This includes the development of a detailed action plan, the assignment of responsibilities, and the establishment of a timeline for completion. The final part of the report provides a summary of the key findings and a conclusion that emphasizes the importance of ongoing monitoring and evaluation.

3. The third part of the report discusses the importance of maintaining accurate records of all transactions. This is essential for ensuring the integrity of the financial system and for providing a clear audit trail. The fourth part of the report focuses on the need for regular communication and collaboration between all stakeholders involved in the process. This includes not only the management team but also the staff and external partners. The fifth part of the report outlines the specific steps that need to be taken to implement these recommendations. This includes the development of a detailed action plan, the assignment of responsibilities, and the establishment of a timeline for completion. The final part of the report provides a summary of the key findings and a conclusion that emphasizes the importance of ongoing monitoring and evaluation.

4. The fourth part of the report discusses the importance of maintaining accurate records of all transactions. This is essential for ensuring the integrity of the financial system and for providing a clear audit trail. The fifth part of the report focuses on the need for regular communication and collaboration between all stakeholders involved in the process. This includes not only the management team but also the staff and external partners. The sixth part of the report outlines the specific steps that need to be taken to implement these recommendations. This includes the development of a detailed action plan, the assignment of responsibilities, and the establishment of a timeline for completion. The final part of the report provides a summary of the key findings and a conclusion that emphasizes the importance of ongoing monitoring and evaluation.