Form \$160-5 (June 1990)

representations as to any matter within its jurisdiction.

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT - " for such proposals		5. Lease Designation and Serial No. SF-078096
		6. If Indian, Allottee or Tribe Name
		7. If Unit or CA, Agreement Designation
1. Type of Well Oil Well Gas Well Other		B. Well Name and No.
2. Name of Operator Amoco Production Company	Attention: Dallas Kalahar	Mudge LS #34 9. API Well No.
3. Address and Telephone No. P.O. Box 800, Denver, Colorado 8020	/202\ 930 E129	3004521076
4. Location of Well (Footage, Sec., T., R., M., or Survey De		Blanco PC
1592' FSL 820' FEL	Sec. 9 T 31N R 11W	11. County or Parish, State San Juan New Mexico
12. CHECK APPROPRIATE TYPE OF SUBMISSION	BOX(s) TO INDICATE NATURE OF NOTICE, TYPE OF ACTION	
Notice of Intent Subsequent Report Final Abandonment Notice	Abandonment Recompletion Plugging Back Casing Repair Altering Casing Other (Note: Re	Change of Plans New Construction Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water sport results of multiple completion on Well Completion or etion Report and Log form.
	s to plug and abandon the subject well.	RECE BI 91, FEB -3
	FEB1 01994 ON CON. DIV. BIST. 3	RECEIVED BLM 95 FEB -3 AM II: 49 070 FARMINGTON, NM
14. I hereby certify that the foregoing is true and correct Signed	luha Title Staff Busines	s Analyst Date 1-31-54
(This space for Federal or State office use)		
Approved by Conditions of approval, if any:	Title	APPROVED
Tule 19 U.S.C. Section 1001 makes it a crime for any pare	ton knowingly and willfully to make to any department or agency of the United S	

Mudge LS #34 PXA Procedures

- Move in and rig up 1 " coil tbg unit. Remove 1" coil tbg. Rig down and move out coil tbg unit.
- Check location for anchors. Install if necessary. Test anchors.
- 3. MIRUSU. Blow down well. Kill if necessary with fresh water.
- 4. RIH with tbg and retainer. Set retainer at 2650'. Test casing integrity to 500#. Squeeze perfs at 2716' to 2736' with 15.357 cuft cement. Pull out of retainer and spot cement plug to 1200' with 72.21 cuft cement.
- 5. RIH with perf gun and shoot squeeze holes at 1200' and attempt to circulate to surface thru squeeze holes, displace cement to surface. (est. 488.16 cuft) If unable to circulate, displace cement to 200' (est. 49.80 cuft) and shoot squeeze holes at 200' and circulate to surface and displace cement to surface with 9.96 cuft cement.
- 6. NDBOPE. Cut off casing and wellhead. Install PXA marker according to BLM or state requirements.

 7. Turn over to John Schwartz for reclamation.
- 8. Rehabilitate location according to BLM or State requirements.

MUDGE LS 034 Location - 91-31N-11W SINGLE PC Orig.Completion - 12/72 LAST FILE UPDATE - 1/94 BY CSW

