Submit 3 Copies
to Appropriate

State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

to Appropriate Energy District Office	, Willicials and Natural No.	ources Department		
DISTRICT I P.O. Box 1980, Hobbs, NM 88240 OIL CONSERVATION DIVISION P.O.Box 2088			WELL APPNO. 3004521376	
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	Santa Fe, New Mexico 8	7504-2088	5 Andicate Type of Lease	
DISTRICT III			STATE FEE	×
1000 Rio Brazos Rd., Aztec, NM 87410			6. State Oil & Gas Lease No.	ļ
SUNDRY NOTICE (DO NOT USE THIS FORM FOR PROPOS	S AND REPORTS ON W		7. Lease Name or Unit Agreement Name	
DIFFERENT RESERVOIF (FORM C-101	R. USE "APPLICATION FOR F) FOR SUCH PROPOSALS.)	PERMIT"	Thurston LS	
1. Type of Well:				
OIL GAS WELL X	OTHER Attention:		8. Well No.	
Name of Operator Amoco Production Company		e Acevedo	2	
Address of Operator P.O. Box 800 Denver Co	olorado 80201		9. Pool name or Wildcat Aztec Pict. Cliff ext.	
4. Well Location	North	Time and 11	80 Feet From The East	Line
Unit Letter A: 1180	Feet From The	Line and	Feet From The	Line
Section 31			IMPM San Juan Coun	ty
	10. Elevation (Show when	her DF, RKB, RT, GR, etc.) 5827' GL		
11. Check Approp	priate Box to Indicate	Nature of Notice, Re	eport, or Other Data	
NOTICE OF INTEN	TION TO:	SUI	BSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK PL	UG AND ABANDON X	REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON C	HANGE PLANS	COMMENCE DRILLING	OPNS. PLUG AND ABANDONMEN	т [
PULL OR ALTER CASING		CASING TEST AND CE	MENT JOB	
OTHER:		OTHER:		_ [
Describe Proposed or Completed Operatio work) SEE RULE 1103. Amoco Production Company intends			including estimated date of starting any proposed ed for procedure.	
If you have any questions please call	Julie Acevedo at 303-830	0-6003.		
			APR21/1993	
			OIL CON. DIV	
		`	DIST. 2	
I hereby certify that the information above is	true and complete to the best of			-
SIGNATURE Italia Claus	lv	Sr. Staff A	Assistant 04-19-1993	
f'	lie Acevedo		TELEPHONE NO.	
(This space for State Use)				

TIBEPUTY OIL & GAS INSPECTOR, DIST. #?

Original Signed by CHARLES GHULSON

PXA Procedures Thruston LS #2

- 1. RU cementers and pump trucks.
- 2. Establish injection rate thru perfs at 2314' to 2330.
- 3. Drop 2.875 wiper plug. Spot a cement plug from PBTD to 300'. (estimated volume is 18.19 cuft) WOC 24 hrs.
- 4. MIRU slickline. RIH with 2" gage ring to top of cement.
- 5. TIH with perforating gun. Shoot 2 squeeze holes at 225'.
- 6. Establish circulation thru squeeze holes between casing and bradenhead with dyed water. Circulate till returns are clear and monitor to check volumes.
- 7. Pump cement down casing till clear returns are seen at surface. (estimated volume is 5.21 cuft) Do not displace cement.
- 8. Cut off casing and wellhead. Install PXA marker according to BLM and state requirements.
- 9. Turn over to John Schwartz for reclamation.
- 10. Rehabilitate location according to BLM and State requirements.

THURSTON LS 002 1849
Location — 31A— 31N—11W
SINGLE PC
Orig.Completion — 3/74
Last File Update — 1/89 by DDM
Cathodic Protection Unknown

