

Smyers Com A LS 2
C 02 31N - 11W
30-045-2137700:PC

Bradenhead Procedure
October 27, 1994

1. Record TP, SICP, and SIBHP.
2. MIRUSU
3. RU lubricator and perforate the PC with strip gun..
Perfs
2704-2730'
4. RIH with RBP and set at 1500' (TOC = 1045' Temp Survey, '74).
5. Run CBL and fax to Khanh Vu (Denver, 303-830-4276)
6. Perforate 2 squeeze holes within 200' of TOC.
7. Attempt to circulate to surface, and conduct a cement squeeze with adequate cement. Drill out cement.
8. TOH with RBP
9. Clean out to PBTB (2860')
10. Tie well back into surface equipment and turn over to production.