

11/5/75 POOH. PU 8 3-1/2" DC's & RIH w/tbg. Ran stinger back in easy drl plug. PU, circ hole to fill up, set stinger back in easy drl plug, & pumped IH @ 2600 psi, 1/2 BPM. Pumped 300 gals 15% HCL, 1200 psi @ 1-1/2 BPM, & 1800 psi @ 4 BPM.

Squeezed hole w/5 BW, 50 sxs Class "B", 2% CaCl, & 100 sxs Class "B", 6/10 of 1% Halid 9, 10#sd/sx. Pumped 50 sxs in @ 2-1/2 BPM, 50 sxs @ 2 BPM, & 50 sxs @ 1/2-1/4 BPM. SD 900 psi - held for 5". Pld out of plug, LD 50' tbg, rev out 1 bbl cmt (5 sxs).

POOH - WOC.

Will drill out cmt 11/6/75.

11/6/75 WOC - prep to drl out cmt.

11/7/75 RU to drl cmt w/gas. Ran 8 3-1/2" DC's, 26 jts of 2-3/8" tbg, & tagged up @ 1050' - blw hole dry. PU power swivel, drld out 25' cmt - cmt that was coming out @ end of blw line was green. Stopped drlg. Let hole blw - stopped getting any cmt out for 4-5". Then hole started dusting. Blw hole clean, drld 10 more ft, & cmt came out green. SD because of green cmt.

WOC - prep to drl out 11/8/75 A.M.

11/8/75 WOC - Prep to drl cmt.

11/9/75 Drld on easy drl plug & POOH to chg bits. Drld out 2-1/2' of plug. SDON.

11/10/75 Drld out easy drl plug & cmt. POOH to chg bits, ran re-tip bit back IH, & finished drlg out cmt @ 1141'.

Ran 6 jts 2-3/8" tbg, RU Western & circ hole clean. Press tested csg to 2000 psi - leaked off 500 psi in 7". RU gas line & blew hole dry. Left blwg overnight to dry up cmt.

Prep to test csg.

11/11/75 RU Western, filled hole w/wtr, & press tested csg to 2000 psi - leaked off 600 psi in 5". Pulled tbg, DC's, & bit OOH. Closed blind rams & press tested csg to 2100 psi - leaked off 600 psi in 5", 800 psi in 10", & 900 psi in 15".