

- 11/24-26/75 Well SD. Blwg to clean up & prep to get junk off top of 2-7/8" liner w/magnet.
- 11/27/75 Cleaned junk off 2-7/8" liner, ran tbg to btm to clean out sd, & left well blwg sd & wtr overnight.
- 11/28/75 SI well for Thanksgiving.
- 11/29/75 POOH w/tbg & RU Western to kill well. Ran 2-1/16" tbg & 4-1/2" loc set pkr w/on & off tool; tbg @ 4548' & pkr @ 4050'.
- | | |
|-------------|------------------------------------|
| 33.00 | 1 jt 2-1/16" tbg |
| 0.80 | 1 F Nipple |
| 460.56 | 14 jts 2-1/16" tbg |
| <u>3.75</u> | 4-1/2" loc set pkr w/on & off tool |
| 498.11' | Total |
- RIH w/2-3/8" tbg, got off pkr, & POOH. Ran 4-1/2" BP & tbg, set BP @ 4030', filled hole w/wtr, & POOH.
- RU Dresser Atlas to perf (Chacra):
- | | |
|----------|----------|
| 3929-35' | 6 holes |
| 3942-46' | 4 holes |
| 3952-56' | 4 holes |
| 3980-90' | 10 holes |
- SDON.
- 11/30/75 RD flow-T & blw line. Ran Baker 4-1/2" BP, pkr, & tbg IH to breakdown perfs. RU Western & broke perfs:
- | | | |
|----------|-------|----------|
| 3929-35' | 7 BPM | 3000 psi |
| 3942-46' | 7 BPM | 2800 psi |
| 3952-56' | 6 BPM | 2800 psi |
| 3980-90' | 6 BPM | 2600 psi |
- Pulled tbg, pkr, & BP OOH.
- RU Western to frac w/30,000 gals 30# gel wtr in 2 stages:
- 3750 gal pad
- 3750 gal 100 mesh w/3#/gal
- 7500 gal 20/40 w/2#/gal
- 1st Stage: Avg of 25 BPM & 1100 psi
- Dropped 8 balls
- 2nd Stage: Avg of 25 BPM & 1200 psi
- Flushed w/5334 gals wtr @ 25 BPM & 1200 psi. ISIP - 700 psi, 5" - 400 psi, 10" - 300 psi, 15" - 300 psi, final SIP - 300 psi.
- SDON.
- 12/1/75 Ran tbg IH blwg hole dry going in. Left well blwg overnight to clean up "A" section of Chacra Zone. Prep to perf & frac "D" section of Chacra Zone.