

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT - " for such proposals

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Amoco Production Company

Attention:

Patty Haeefe

3. Address and Telephone No.

P.O. Box 800, Denver, Colorado 80201

(303) 830-4988

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1840' FSL

1175FWL

Sec. 34 T 31N R 9W

Unit L

5. Lease Designation and Serial No.

NM-013686

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Pritchard B

5

9. API Well No.

3004526991

10. Field and Pool, or Exploratory Area

Basin Fruitland Coal

11. County or Parish, State

San Juan

New Mexico

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

TYPE OF ACTION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice

- ☐ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☒ Other Liner

- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Amoco Production Company has completed the following repair per the following:

MIRUSU 6/24/95. SICP 340 psi, SITP 210 psi. Set plug in F-nipple at 2761'. Nipple down wellhead, nipple up bop. Lay blooie lines. TOH 3.5" and 2.875" tubing. Set BP at 410', to test bop. Retrieve BP. TIH with tubing. Tag fill at 2998' - 15' of fill. Clean out to bottom at 3013'. Circulate clean. Pull up into shoe. Check for fill. Clean out 3005-3013'. Pull to shoe. Flow test. Clean out 3005-3013'. Land 2.875" tubing at 2978'. Nipple down BOP. Nipple up wellhead. Pump out plug. Circulate well with air to clear tubing. RDMOSU 6/27/95.

RECEIVED
AUG 10 1995

14. I hereby certify that the foregoing is true and correct

Signed

Patty Haeefe

Title

Staff Assistant

Date

8-2-95

(This space for Federal or State office use)

Approved by

Title

Conditions of approval, if any:

ACCEPTED FOR RECORD

AUG 07 1995

AMOCO

* See Instructions on Reverse Side

FARMINGTON DISTRICT OFFICE
BY *221*