

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.

Use "APPLICATION FOR PERMIT - " for such proposals

5. Lease Designation and Serial No.

NM-013686

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Pritchard C 1

9. API Well No.

3004528622

10. Field and Pool, or Exploratory Area

Basin Fruitland Coal Gas

11. County or Parish, State

San Juan NM

1. Type of Well
☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Amoco Production Company

Attention:

Patty Haeefe

3. Address and Telephone No.

P.O. Box 800, Denver, Colorado 80201

(303) 830-4988

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1430'FNL 1540'FEL Sec. 34 T 31N R 9W Unit G

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

TYPE OF ACTION

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment Notice

☐ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☒ Other

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Amoco Production Company has completed the following repair:

MIRUSU 6/27/95. Set tubing plug in F-nipple. Nipple down wellhead. Nipple up BOP. TOH 2.375" tubing. Run wireline, set drillable BP at 2300'. Test BOP. Drill out BP at 2300'. TIH. Tag ledge at 2520', 2570', 2740' and 15' of fill. Circulate hole clean. Pull into shoe at 2447'. Flow well. Check for fill. Tag ledge at 2520', 2580', 2740', and 2880'. Clean out to TD at 2823'. Circ hole clean. Pull up into shoe at 2447'. Flow well. Check for fill. Clean out to TD. Circulate hole. Clean out to 2823' TD. Run 4.5" tubing string. Land tubing at 2733'. Nipple down BOP. Nipple up wellhead. Pull tubing plug. Circulate well with air. Well would not flow up tubing. Try to circulate with air down casing. Pumped in at 400 psi. No circulation. Try to circulate with air down tubing. No circulation. Run pressure bombs, had no fluid in tubing, set tubing plug. Nipple down well, nipple up bop. Pull 1 joint tubing. Circulate well with 2000 cfm air, 8 gpm foam. Good circulation. Reland tubing at 2690'. Nipple down BOP. Nipple up wellhead. Pull tubing plug. Flow well. RDMOSU 7/5/95.

14. I hereby certify that the foregoing is true and correct

Signed

Patty Haeefe

Title

Staff Assistant

ACCEPTED FOR RECORD

(This space for Federal or State office use)

Approved by

Title

Conditions of approval, if any:

AUG 07 1995

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious, or fraudulent statements or representations as to any matter within its jurisdiction.

AMOCO

FARMINGTON DISTRICT OFFICE
BY