State of New Mexico Energy, Minerals and Natural Resources Department Oil Conservation Division

Sı	undry Notices and R	eports on Wells		
		API	# (assigned by OCD)	
			30-045-28963	
1. Type of Well		5.		
GAS		_	Fee	
		6.	State Oil&Gas Lease #	
2. Name of Operator		7.	Lease Name/Unit Name	
BURLINGTON RESOURCES				
RESOURCES OIL & GAS COMPANY			Allison Unit	
		8.	Well No.	
3. Address & Phone No. of Operator			#9R	
PO Box 4289, Farmington, NM 874	499 (505) 326-9700	9.	Pool Name or Wildcat Basin DK/Blanco MV	
4. Location of Well, Footage, Sec.,	тр м :-	10	Elevation:	
1720'FNL 1655'FEL, Sec.13, T-32-1				
1/20 IRD 1000 FBD, DCC.10, 1-32-1	a, k , a, men, ban	Juan Councy		
Type of Submission	Type of Ac	tion		
	_ Abandonment	Change of Pl	ans	
	Recompletion _	New Construc	tion	
Subsequent Report	Plugging Back _	Non-Routine	Fracturing	
	_ Casing Repair _	Water Shut o	ff	
Final Abandonment	_ Altering Casing _	Conversion t	o Injection	
_X	_ Other -			
It is intended to repair the attached procedure.	tubing on the subje	DECEIV N MAR - 1 199		
SIGNATURE MAY Shad huce	/	O[[], (SO) (F)	沙以。 February 25, 1999	
(This space for State Use)				
ORIGINAL SIGNED BY CHARLIE T. PERES	REPLITY OUL F C	LC INCOCATAN AICE .	MAR 1 100	
Approved by	Title OEPUTY CHL & GA	™ INSECTION, DIST. Ø	Date 1777 1 190	

Allison Unit #9R Dakota/ Mesaverde

1720'FNL, 1655' FEL

Unit G, Section 13, T-32-N, R-7-W Latitude / Longitude: 36° 58.9663' / 107° 30.8450' DPNO: 3691701 DK/3691702 MV

Tubing Repair Procedure

- Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. Notify BROG Regulatory (Peggy Bradfield 326-9727) and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS/WIMS. Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
- 2. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. ND WH and NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
- Mesaverde/Dakota 2-3/8", 4.7# tubing is set at 7854'. Release donut, pick up additional joints of tubing and tag bottom. (Record depth.) PBTD should be at +/-7979'. TOOH with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build up and notify Operations Engineer.
- 4. If fill is encountered, TIH with 3-7/8" bit, bit sub and watermelon mill on 2-3/8" tubing and round trip to below perforations, cleaning out with air/mist. NOTE: When using air/mist, minimum mist rate is 12 bph. If scale is present, contact Operations Engineer to determine methodology for removing scale from casing and perforations.
- 5. TIH with one joint of 2-3/8" tubing with an expendable check on bottom and a seating nipple one joint off bottom then ½ of the 2-3/8" production tubing. Run a broach on sandline to insure that the tubing is clear. TIH with remaining 2-3/8" tubing and then broach this tubing. Replace any bad joints. CO to PBTD with air/mist. PU above the perforations and flow the well naturally, making short trips for clean up when necessary.
- 6. Land tubing at ±7950'. ND BOP and NU WH. Pump off expendable check. Connect to casing and circulate air to assure that expendable check has pumped off. Obtain pitot gauge up the tubing. If well will not flow up the tubing, make swab run to SN. RD and MOL. Return well to production.

Recommended: M. F. Huttey
Operations Engineer

Approved:

Bruce D. Bong 2.1.99
Drilling Superintendent

Operations Engineer:

Mary Ellen Lutey

Office - (599-4052) Home - (325-9387) Pager - (324-2671)