or: 3160-5
Governber 1983)
ormerly 9-331

## UNITED STATES

	/	/
SUBMIT IN	TRIPLICAT	
Other lastr	netions on	70
Terse aidel		

Form approved. Budget Bureau No. 1004-0135

	<u>= xp</u>	ires August	31,	1985	
5.	LEASE	DESIGNATION	AND	BERIAL	NO

The same of the Department of The Interplant Office Control of the		131, 1963
ormerly 9-331) DEPARTMENT OF THE INTERIOR verse aide)	5. LEASE DESIGNATION	AND SERIAL NO.
BUREAU OF LAND MANAGEMENT	SF-078146	
SUNDRY NOTICES AND REPORTS ON WELLS  (Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  Use "APPLICATION FOR PERMIT—" for such proposals.)	6. IF INDIAN, ALLOTTE	EWAN BEIET HO E
OIL GAS XX OTHER	7. UNIT AGREEMENT N	AME
NAME OF OPERATOR	S. FARM OR LEASE NAM	4E
Southland Royalty Company	Hillstrom	
ADDRESS OF OPERATOR	9. WELL NO.	
P.O. Drawer 570, Farmington, New Mexico, 87499	3	
LOCATION OF WELL (Report location clearly and in accordance with an State requirement. V E D See also space 17 below.)  At surface  (D) 930' FNL & 990' FWL JAN 2.8 1985	Glades Frui Blanco Picti 11. SEC., T., E., M., OR I	ured Cliffs
BUREAU OF LAND MANAGEMENT FARMINGTON RESOURCE AREA  4. PERMIT NO. 15. SLEVATIONS (Show whether DF, RT, GR, etc.)	Section 35.	T32N. R12W
6333' GL	San Juan	New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO SUBSEQUENT REPORT OF : TEST WATER SHUT-OFF PULL OR ALTER CASING WATER SHOT-OFF REPAIRING WELL FRACTURE TREAT FRACTURE TREATMENT ALTERING CASING SHOOT OR ACIDIZE ABANDON\* SHOOTING OR ACIDIZING ABANDON MENTS Downhole Commingled CHANGE PLANS (Other) (Other)

- (Nors: Report results of multiple completion on Completion or Recompletion Report and Log form.) 17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and gones pertinent to this work.) \*
  - 1-21-85 MIRU Bedford Rig #1 on 1-21-85. Killed well with 2% KCl water. ND WH and NU Tried to release packer, would not release.
  - Tried to release packer, moved down hole 14'. Dropped standing valve down 1-22-85 1-1/2" tubing. Circulated and worked packer, could not release.
  - RU Service Unit. RIH and cut 1-1/2" tubing off at 2644'; 5' above packer. 1-23-85 TOOH. Tubing stuck. RU and reversed circ, tubing free. TIH with fishing tools latch onto fish with overshot. Circualte and worked pipe, could not release packer. Get off of fish and pulled 10 joints tubing out of hole.
  - TOOH with tubing and fishing tools, had packer in overshot. LD packer and 1-24-85 fishing tools. TIH with 1-1/2" tubing and tagged fill at 2860'. RU to reverse circ, CO to 2930'. Pulled up hole and landed 83 joints (2679') of 1-1/2", 2.9#, V-55, EUE tubing @ 2690'. ND BOP and NU WH. Rel rig at 5:30 PM 1-24-85. Returned well to production.



	0/1117 2 .000
SI NED Cother & Suggest TITLE Secretary	OIL CON. DIV.  DIST. AGGERMENT FOR RECORD
APPROVED BY	DATE JAN STORY
*See Instructions on Reverse Side	FARMINGTUN REGULACE AREA