Submit 3 Copies Form C-103 State of New Mexico to Appropriate Revised 1-1-89 Energy, Minerals and Natural Resources Department District Office DISTRICT I OIL CONSERVATION DIVISION P. O. Box 1980, Hobbs, NM 88240 WELL API NO. 2040 S. Pacheco 30-045-28874 **DISTRICT II** Santa Fe, New Mexico 87505 5. Indicate Type of Lease P. O. Drawer DD, Artesia, NM 88210-2834 Fee DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410 6. State Oil & Gas Lease No. SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" 7. Lease Name or Unit Agreement Name (FORM C-101) FOR SUCH PROPOSALS.) Robinson 34 1. Type of Well: OIL GAS WELL [ WELL 🗵 OTHER 2. Name of Operator 8. Well No. Hallwood Petroleum, Inc. 2 3. Address of Operator 9. Pool name or Wildcar P. O. Box 378111, Denver, CO 80237 **Basin Fruitland Coal** 4. Well Location Line and 1910 790 Unit Letter N South Feet From The West Feet From The Line Range 13W Township 32N Section 34  $_{\mathrm{NMPM}}$  San Juan County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 5875' KB, 5858' GL 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK REMEDIAL WORK PLUG AND ABANDON ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING CASING TEST AND CEMENT JOB OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work.) SEE RULE 1103. This well has been T&A'd for several years and never sold gas commercially. It was being held for a possible disposal well application but is not needed any longer. In conjunction with some pipeline ROW's and work the landowner has requested that we P&A this well and restore the location. Please see attached for procedures. Hallwood plans to P&A this well during October, 1998.

NOTIFY AZTEC OCD IN TIME TO WITNESS				
I hereby certify that the information above is true and complete to the best of my knowledge and belief.  SIGNATURE	TITLE	Production Reporting Supervisor	DATE	Sept. 21, 1998
TYPE OR PRINT NAME Nonya K. Durham		TI	TELEPHONE NO.	(303) 850-6257
(This space for State Use)  ORIGINAL SIGNED BY CHARLIE T. PEPERIN  APPROVED BY  CONDITIONS OF APPROVAL, IF ANY:	TITLI	DEPUTY OIL & GAS INSPECTOR,	DATE	BEP 2 5 1998

## **ROBINSON #34-2**

## Plug and Abandon Procedure

## AFE #81401062

- 1. MIRUSU, blow down well.
- 2. RIH with work string of tubing to PBTD of 1915'. Contact OCD representative to witness plugging.
- 3. Pump a 60-sx cement plug that will provide about 300' of fillup in casing to 1600'.
- 4. Pull up hole laying down tubing to 900'. Pump another 60-sx (300') cement plug.
- 5. Pull up hole laying down tubing to 435' and pump an 80-sx cement plug to surface.
- 6. Pull out w/tubing, make sure cement is near surface. Discuss with OCD and landowners to see if well can be marked below ground level with a weld-on cap instead of an "above ground" dry hole marker.
- 7. Cut off casinghead 3-4' below ground level.
- 8. Weld on plate.
- 9. Pull up gravel, anchors and all equipment.
- 10. Level and remove rocks from adjacent pipeline ROW for Jewell family.

