

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

C" CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-77

5a. Indicate Type of Lease
State ☐ Fee ☒
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-121) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-	7. Unit Agreement Name
2. Name of Operator Southland Royalty Company	8. Farm or Lease Name Faverino
3. Address of Operator P.O. Drawer 570, Farmington, New Mexico 87401	9. Well No. #1
4. Location of well UNIT LETTER <u>P</u> <u>330</u> FEET FROM THE <u>South</u> LINE AND <u>990</u> FEET FROM THE <u>East</u> LINE, SECTION <u>20</u> TOWNSHIP <u>29N</u> RANGE <u>11W</u> NMPM.	10. Field and Pool, or Wildcat Fulcher Kutz Pictured Cli
11. Elevation (Show whether DF, RT, GR, etc.) 5406' GR	12. County San Juan

16. Check Appropriate Box To Indicate Nature of Notice, or Other Data
NOTICE OF INTENTION TO:

RECEIVED
DEC 15 1987
OIL CON. DIV
DIST. 3

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Southland Royalty Company has plugged and abandoned this well as follows:

- 1) POOH with 1" tubing. TIH with 1-1/2" work string to 1560', spotted 20 sacks cement plug across the Pictured Cliffs perms 1540'-1560', left TOC inside casing @ 1481'.
- 2) Shot squeeze hole at 500'. Spotted 36 sacks cement plug across Ojo Alamo. Squeezed 1 barrel into Ojo; left top of cement inside casing at 135'.
- 3) Shot squeeze hole at 90'. Circulated cement to 5" from surface inside and outside casing with 15 sacks cement.
- 4) Cut off wellhead 4' below ground level, spotted 10 sacks cement plug at surface, installed dry hole marker.
- 5) Cleaned up location, rigged down.

Well plugged and abandoned May 18, 1982. Verbal approval for this procedure given by Frank Chavez on May 11, 1982.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>John W. Caldwel</u>	TITLE <u>Engineer</u>	DATE <u>May 20, 1982</u>
APPROVED BY <u>Charles J. Shaker</u>	TITLE <u>DEPUTY OIL & GAS INSPECTOR, DIST. #3</u>	DATE <u>DEC 15 1987</u>