	ate of New Mexico	Form C-103
	nerals and Natural Resources	Revised July 18, 2013
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283		WELL API NO. 30-025-35013
811 S. First St., Artesia, NM 88210 OIL CON	SERVATION DIVISION	5. Indicate Type of Lease
	South St. Francis Dr.	STATE FEE
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460	NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM 87505	MAR 1 4 2018	
SUNDRY NOTICES AND REPORT	RTS ON WELLS	7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT	TO DEEPEN OR PLUC BACK TO A T" (FORME: 101) FOR SUCH	F.C. H:11 3
PROPOSALS.) 1. Type of Well: Oil Well Gas Well Ot	her	8. Well Number 7
2. Name of Operator		9. OGRID Number
OXY USA Inc.		16696
3. Address of Operator P.O. Box 50250 Midland, T2	X 79710	10. Pool name or Wildcat
4. Well Location	. 17/10	Teaque Devonian
Unit Letter N: 990 feet from the South line and 2290 feet from the west line		
Section 27 Township 23S Range 37E NMPM County Lea		
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		
3275'		
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data		
CUBSEQUENT REPORT OF:		
Approved for Plugging of Wellbore only. Liability		
under bond is retained pending restoration and	INT TO PA	.LING OPNS. P AND A
completion of the C-103, Specific for Subsequent	P&A NR	JOB
Report of Well Plugging, which may be found on	P&A R	
the OCD web page under forms. Restoration Due By 02-16-2019	FOAR	
13. Describe proposed or completed operations. (Clearly state all pertinent details, and	d give pertinent dates, including estimated date
of starting any proposed work). SEE RULE 1	9.15.7.14 NMAC. For Multiple Cor	
proposed completion or recompletion.	-	mpletions: Attach wellbore diagram of
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow	vlines. RUPU, unseat pump, start to	mpletions: Attach wellbore diagram of POOH w/ rods and pump.
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg	vlines. RUPU, unseat pump, start to	mpletions: Attach wellbore diagram of POOH w/ rods and pump.
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH.	vlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC,	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg.
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of the s	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIF	vlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of LF, test csg to 500#, tested good. MH & tag cmt @ 6047', PUH to 5078', NET 100 NET 10	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC.
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIF 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact	vlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of LF, test csg to 500#, tested good. Not also a set addition Mark Whitaker-NMOCD, set addition	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'.
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIF	vlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of LF, test csg to 500#, tested good. Not also a set addition Mark Whitaker-NMOCD, set addition	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'.
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx CI C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of LF, test csg to 500#, tested good. MH & tag cmt @ 6047', PUH to 5078', MM Whitaker-NMOCD, set additionately, PUH, WOC. RIH & tag cmt @ 6042', PUH, WOC. RIH & tag cmt @ 6042', PUH, WOC.	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt,
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx CI C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx CI C cmt, POOH, WOC.	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of MLF, test csg to 500#, tested good. Medical Mark Whitaker-NMOCD, set additional CI2, PUH, WOC. RIH & tag cmt @ 340sx CI C cmt w/ 2% CaCI2, PUH, W	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189',
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx CI C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx CI C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of MLF, test csg to 500#, tested good. Medical Mark Whitaker-NMOCD, set additional CI2, PUH, WOC. RIH & tag cmt @ 340sx CI C cmt w/ 2% CaCI2, PUH, W	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189',
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx CI C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx CI C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @ circ cmt to surface. RD PU.	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of the s	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189',
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx CI C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx CI C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of MLF, test csg to 500#, tested good. Medical Mark Whitaker-NMOCD, set additional CI2, PUH, WOC. RIH & tag cmt @ 340sx CI C cmt w/ 2% CaCI2, PUH, W	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189',
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx CI C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx CI C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @ circ cmt to surface. RD PU.	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of the s	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189',
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx Cl C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx Cl C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx Cl C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @ circ cmt to surface. RD PU. Spud Date:	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of the s	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189', ND BOP, NU B-1 adapter, M&P 70sx CI C cmt,
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx CI C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx CI C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @ circ cmt to surface. RD PU.	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of the s	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189', ND BOP, NU B-1 adapter, M&P 70sx CI C cmt,
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx Cl C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx Cl C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx Cl C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @ circ cmt to surface. RD PU. Spud Date:	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of the s	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189', ND BOP, NU B-1 adapter, M&P 70sx CI C cmt, ge and belief.
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx Cl C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx Cl C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx Cl C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @ circ cmt to surface. RD PU. Spud Date:	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of the s	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189', ND BOP, NU B-1 adapter, M&P 70sx CI C cmt, ge and belief.
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx Cl C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx Cl C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx Cl C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @ circ cmt to surface. RD PU. Spud Date:	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of ILF, test csg to 500#, tested good. Medical Mark Whitaker-NMOCD, set addition a CI2, PUH, WOC. RIH & tag cmt @ 340sx CI C cmt w/ 2% CaCI2, PUH, V 140', EIR @ 1.5bpm w/ full returns, Rig Release Date: Complete to the best of my knowledged	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189', ND BOP, NU B-1 adapter, M&P 70sx CI C cmt, ge and belief.
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx CI C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx CI C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @ circ cmt to surface. RD PU. Spud Date:	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of ILF, test csg to 500#, tested good. Medical Mark Whitaker-NMOCD, set addition a CI2, PUH, WOC. RIH & tag cmt @ 340sx CI C cmt w/ 2% CaCI2, PUH, V 140', EIR @ 1.5bpm w/ full returns, Rig Release Date: Complete to the best of my knowledged	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189', ND BOP, NU B-1 adapter, M&P 70sx CI C cmt, ge and belief.
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx Cl C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx Cl C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx Cl C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @ circ cmt to surface. RD PU. Spud Date: I hereby certify that the information above is true and of SIGNATURE David Stewart Type or print name David Stewart	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of ILF, test csg to 500#, tested good. Medical Mark Whitaker-NMOCD, set addition a CI2, PUH, WOC. RIH & tag cmt @ 340sx CI C cmt w/ 2% CaCI2, PUH, V 140', EIR @ 1.5bpm w/ full returns, Rig Release Date: Complete to the best of my knowledged	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189', ND BOP, NU B-1 adapter, M&P 70sx CI C cmt, ge and belief.
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx CI C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx CI C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @ circ cmt to surface. RD PU. Spud Date: I hereby certify that the information above is true and of SIGNATURE Type or print name David Stewart For State Use Only	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of ILF, test csg to 500#, tested good. Medical test of the set	POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189', ND BOP, NU B-1 adapter, M&P 70sx CI C cmt, ge and belief. DATE Z 20 LS @oxy.com PHONE:432-685-5717
proposed completion or recompletion. 2/6/2018 Dig out cellar to surface head, break out flow 2/7/2018 Continue to POOH w/ rods & pump. ND tbg 2/8/2018 RIH w/ tbg & tag cmt/CIBP @ 9127', PUH. 2/12/2018 Circ hole w/ 10# MLF, M&P 25sx CL H cmt, 2/13/2018 RIH & tag CIBP @ 7231'. Circ hole w/ 10# M 6460', M&P 40sx CI C cmt, PUH, WOC. RIH 2/14/2018 RIH & tag cmt @ 4997', tagged low, contact PUH to 3921', M&P 40sx CI C cmt w/ 2% Ca POOH, WOC. 2/15/2018 RIH & tag cmt @ 2709', PUH to 2571', M&P M&P 30sx CI C cmt, POOH, WOC. 2/16/2018 RIH & tag cmt @ 954'. RIH w/ WL & perf @ circ cmt to surface. RD PU. Spud Date: I hereby certify that the information above is true and of SIGNATURE Type or print name David Stewart For State Use Only	wlines. RUPU, unseat pump, start to B-1 adapter, NU BOP, release TAC, calc TOC 8902'. POOH. RIH & set of ILF, test csg to 500#, tested good. Medical Mark Whitaker-NMOCD, set addition a CI2, PUH, WOC. RIH & tag cmt @ 340sx CI C cmt w/ 2% CaCI2, PUH, V 140', EIR @ 1.5bpm w/ full returns, Rig Release Date: Complete to the best of my knowledged	mpletions: Attach wellbore diagram of POOH w/ rods and pump. , POOH w/ tbg. CIBP @ 7231', PUH. M&P 25sx CI H cmt, calc TOC-7006'. PUH to M&P 30sx CI C cmt, PUH, WOC. nal plug, M&P 25sx CI C cmt, calc TOC 4772'. 3584', PUH to 3021', M&P 30sx CI C cmt, VOC. RIH & tag cmt @ 2185', PUH to 1189', ND BOP, NU B-1 adapter, M&P 70sx CI C cmt, ge and belief.