

	UNITED STATES DEPARTMENT OF THE INTER BUREAU OF LAND MANAGEMI		s OMB N	APPROVED NO. 1004-0137 January 31, 2018
	5. Lease Serial No. NMNM56749	5. Lease Serial No.		
Do not use ti	(NOTICES AND REPORTS his form for proposals to drill ell. Use form 3160-3 (APD) for	or to re-enter an r such proposals.	6. If Indian, Allottee	or Tribe Name
SUBMIT IN	I TRIPLICATE - Other instructi	ons on page 2	5-OCD 7. If Unit or CA/Agree	eement, Name and/or
I. Type of Well Soli Well 🗂 Gas Well 🔲 C)ther	JAN 1	6 2019 8. Well Name and No FEDERAL USA I	
2. Name of Operator COG OPERATING LLC	Contact: ABIG E-Mail: abbym@bcmanc		9. API Well No. 30-025-32092-	00-S1
3a. Address ONE CONCHO CENTER 6 MIDLAND, TX 79701-4287	3b. Ph:	Phone No. (include area code) 432-580-7161	10. Field and Pool or UNDESIGNAT	Exploratory Area ED
4. Location of Well (Footage, Sec.,	T., R., M., or Survey Description)		11. County or Parish,	, State
Sec 14 T19S R33E SWSE 6	60FSL 2100FEL		LEA COUNTY,	, NM
12. CHECK THE A	APPROPRIATE BOX(ES) TO I	NDICATE NATURE O	F NOTICE, REPORT, OR OT	HER DATA
TYPE OF SUBMISSION		TYPE OF	FACTION	
Notice of Intent		Deepen	□ Production (Start/Resume)	U Water Shut-
Notice of Intent	Alter Casing	Hydraulic Fracturing	Reclamation	🗖 Well Integrit
Subsequent Report		New Construction	Recomplete	Other
Final Abandonment Notice	Change Plans JX	Plug and Abandon Plug Back	Temporarily Abandon Water Disposal	
1. Tag existing 5 1/2" CIBP v 2. Set 5 1/2" CIBP @ 3640'.	w/ 25' cmt cap @ 7,125' Add; Pressure test csg. Circulate hole	Spot place from e w/MLF. Spot 25 sx cm	m 5980 - 5820.(2S t@3640-3440'.	sxmin); T/De
 Spot 25 sx cmt @ 3150-20 Spot 30 sx cmt @ 1700-10 Spot 15 cx on t @ 60' to s 	w/ 25' cmt cap @ 7,125' Add; Pressure test csg. Circulate hole 850'. WOC & Tag (B/Salt) 479. WOC & Tag (T/Salt & 8 5/8 urface. Per F @ (40', nt to surface, weld on Below Gro	Shoe) Perf @ 170	m 5980-5820. (25 t@ 3640-3440'. e 502 Cmt +0 14 5 Sur F.	
 Spot 25 sx cmt @ 3150-20 Spot 30 sx cmt @ 1700-10 Spot 15 cx on t @ 60' to s 	479. WOC & Tag (B/Sall) 479. WOC & Tag (T/Salt & 8 5/8 urface.	Shoe) Perf @ 170	e soz Cont to 14 Surt.	79
 Spot 25 sx cmt @ 3150-20 Spot 30 sx cmt @ 1700-10 Spot 15 cx on t @ 60' to s 	479. WOC & Tag (B/Sall) 479. WOC & Tag (T/Salt & 8 5/8 urface.	Shoe) Perf @ 170	SEE ATTACHED	P9 FOR
 Spot 25 sx cmt @ 3150-20 Spot 30 sx cmt @ 1700-10 Spot 15 cx on t @ 60' to s 	479. WOC & Tag (B/Sall) 479. WOC & Tag (T/Salt & 8 5/8 urface.	Shoe) Perf @ 170	e soz Cont to 14 Surt.	P9 FOR
3. Spot 25 sx cmt @ 3130-21 4. Spot 30 sx cmt @ 1700-14 5. Spot 15 ex om t @ 60' to s 6. Cut off wellhead, verify cm <u>Below ground</u>	Level dry hole	Shoe) Perf @ 170	SEE ATTACHED	P9 FOR
 Spot 25 sx cmt @ 3130-24 Spot-30 sx cmt @ 1700-14 Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm 	evel dry hole is true and correct. Electronic Submission #44820	" Shoe) Perf @ 17" SOZ Cont Je ound Dry Hole Marker. <u>Mar Ker</u>	SEE ATTACHED CONDITIONS O	P9 FOR
3. Spot 25 sx cmt @ 3130-24 4. Spot 30 sx cmt @ 1700-14 5. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm <u>3. Jow ground</u> 14. I hereby certify that the foregoing Co	is true and correct. Electronic Submission #44820 For COG OPER Sommitted to AFMSS for processing	"Shoe) Perf @ 17" SOZ Cont Je ound Dry Hole Marker. <u>mar Kec</u> N verified by the BLM Wel RATING LLC, sent to the F g by PRISCILLA PEREZ of	SEE ATTACHED CONDITIONS O CONDITIONS O	P9 FOR
3. Spot 25 sx cmt @ 3130-24 4. Spot 30 sx cmt @ 1700-14 5. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm <u>3. Jow ground</u> 14. I hereby certify that the foregoing Co	Level dry hole is true and correct. Electronic Submission #44820 For COG OPER	Marker. Soz cmt te Sound Dry Hole Marker. Morker Kac Morker Ka	SEE ATTACHED CONDITIONS O CONDITIONS O	P9 FOR
3. Spot 25 sx cmt @ 3130-24 4. Spot 30 sx cmt @ 1700-14 5. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm 3. Spot 25 sx cmt @ 1700-14 5. Spot 26 sx omt @ 60' to s 6. Cut off wellhead, verify cm 3. Spot 25 sx cmt @ 1700-14 60' to s 6. Cut off wellhead, verify cm 3. Spot 25 sx cmt @ 1700-14 60' to s 6. Cut off wellhead, verify cm 3. Spot 25 sx cmt @ 1700-14 60' to s 6. Cut off wellhead, verify cm 3. Spot 25 sx cmt @ 1700-14 60' to s 6. Cut off wellhead, verify cm 4. Spot 25 sx cmt @ 1700-14 60' to s 6. Cut off wellhead, verify cm 4. Spot 25 sx cmt @ 100 st 6. Cut off wellhead, verify cm 4. I hereby certify that the foregoing Co Name (Printed/Typed) ABIGAIL	ATS: WOC & Tag (B/Sait) 479. WOC & Tag (T/Sait & 8 5/8 urface. Perf @ (20') in to surface, weld on Below Gro is true and correct. Electronic Submission #44820 For COG OPER pommitted to AFMSS for processing ANDERSON c Submission)	"Shoe) Perf @ 17" SQ Z Cont for SQ	SEE ATTACHED CONDITIONS O CONDITIONS O CONDINTIONS O CONDITIONS O CONDITIONS O CONDITIONS O CONDITIONS O COND	P9 FOR
3. Spot 25 sx cmt @ 3130-24 4. Spot 30 sx cmt @ 1700-14 5. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm <u>3. Jow ground</u> 14. I hereby certify that the foregoing Co Name (Printed/Typed) ABIGAIL	ATS: WOC & Tag (B/Sait) 479. WOC & Tag (T/Sait & 8 5/8 urface. Perf @ (20') in to surface, weld on Below Gro is true and correct. Electronic Submission #44820 For COG OPER pommitted to AFMSS for processing ANDERSON c Submission)	"Shoe) Perf @ 17" SOZ Cont Je bund Dry Hole Marker. M verified by the BLM Wel RATING LLC, sent to the F g by PRISCILLA PEREZ of Title AGENT	SEE ATTACHED CONDITIONS O CONDITIONS O CONDINTIONS O CONDITIONS O CONDITIONS O CONDITIONS O CONDITIONS O COND	P9 FOR
3. Spot 20 sx cmt @ 3130-24 4. Spot 30 sx cmt @ 1700-14 5. Spot 15 ex omt @ 60' to s 6. Cut off wellhead, verify cm <u>3. Spot 20 sx cmt @</u> 1700-14 5. Spot 15 ex omt @ 60' to s 6. Cut off wellhead, verify cm <u>3. Spot 20 sx cmt @</u> 1700-14 60' to s 6. Cut off wellhead, verify cm <u>3. Spot 30 sx cmt @</u> 1700-14 60' to s 6. Cut off wellhead, verify cm <u>3. Spot 30 sx cmt @</u> 1700-14 60' to s 6. Cut off wellhead, verify cm <u>3. Spot 30 sx cmt @</u> 1700-14 60' to s 6. Cut off wellhead, verify cm <u>4. Spot 30 sx cmt @</u> 1700-14 <u>5. Spot 35 sx cmt @</u> 1700-14 <u>5. Spot 35 sx cmt @</u> 1700-14 <u>5. Spot 35 sx cmt @</u> 60' to s <u>6. Cut off wellhead, verify cm</u> <u>6. Cut off wellhead, verify cm <u>6. Cut off wellhead, </u></u>	ATS: WOC & Tag (B/Sait) 479. WOC & Tag (T/Sait & 8 5/8 urface. Perf @ (20') in to surface, weld on Below Gro is true and correct. Electronic Submission #44820 For COG OPER pommitted to AFMSS for processing ANDERSON c Submission)	"Shoe) Perf @ 17" SQ Z Cont for SQ	SEE ATTACHED CONDITIONS O CONDITIONS O CONDINTIONS O CONDITIONS O CONDITIONS O CONDITIONS O CONDITIONS O COND	P9 FOR
3. Spot 25 sx cmt @ 3130-24 4. Spot 30 sx cmt @ 1700-14 5. Spot 15 ex omt @ 60' to s 6. Cut off wellhead, verify cm <u>3. Spot 20 sx cmt @</u> 1700-14 5. Spot 15 ex omt @ 60' to s 6. Cut off wellhead, verify cm <u>3. Spot 20 sx cmt @</u> 1700-14 <u>5. Spot 35 sx cmt @} 1700-14 <u>5. Spot 35 sx cmt @} 1700-14 <u>5. Spot 35 sx cmt @} 1700-14 <u>5. Spot 35 sx cmt @} 1700-14 <u>5. Spot 35 sx cmt &} 1700-14 <u>5. Spot 35 sx cmt &} 1700-14 <u>5. </u></u></u></u></u></u></u></u></u></u></u></u></u></u></u></u></u></u></u></u></u></u></u>	ATS: WOC & Tag (B/Sall) 479. WOC & Tag (T/Sall & 8 5/8 urface. Perf @ (40°) in to surface, weld on Below Gro is true and correct. Electronic Submission #44820 For COG OPEF ommitted to AFMSS for processing ANDERSON Submission) THIS SPACE FOR F Approval of this notice does not we	Title SM2	SEE ATTACHED CONDITIONS O CONDITIONS O CONDINTIONS O CONDITIONS O CONDITIONS O CONDITIONS O CONDITIONS O COND	79 FOR F APPROVA
Approved By	Arg. WOC & Tag (B/Sall) 479. WOC & Tag (T/Sall & 8 5/8 urface. Perf @ (40) is true and correct. Electronic Submission #44820 For COG OPER mmitted to AFMSS for processing ANDERSON E Submission) THIS SPACE FOR F MARCE APPROVAL OF this notice does not w quitable title to those rights in the subje duct operations thereon.	"Shoe) Perf @ 170 SOZ Cont 100 SOZ CONT SOZ CONT	SEE ATTACHED CONDITIONS O CONDITIONS O CONDI	79 FOR FAPPROVA
3. Spot 20 sx cmt @ 3130-24 4. Spot 30 sx cmt @ 1700-14 5. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm 3. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm 3. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm 3. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm 3. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm 3. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm 3. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm 3. Spot 16 sx omt @ 60' to s 6. Cut off wellhead, verify cm 3. Spot 20 sx omt @ 60' to s 6. Cut off wellhead, verify cm 4. I hereby certify that the foregoing Co Name (Printed/Typed) ABIGAIL Signature (Electronic Approved By Marce Onditions of approval, if any, are attact rtify that the applicant holds legal or e nich yould entitle the applicant to com the 18 U.S.C. Section 1001 and Title 4	ATS: WOC & Tag (B/Sall) 479. WOC & Tag (T/Sall & 8 5/8 urface. Perf @ (40°) in to surface, weld on Below Gro is true and correct. Electronic Submission #44820 For COG OPEF ommitted to AFMSS for processing ANDERSON THIS SPACE FOR F THIS SPACE FOR F Approval of this notice does not w. quitable title to those rights in the subje	shoe) Perf @ 1701 So Z Conf for Sound Dry Hole Marker. My verified by the BLM Well ATING LLC, sent to the H g by PRISCILLA PEREZ of Title AGENT Date 12/18/20 EDERAL OR STATE Title SMA arrant or ct lease Office CFA	SEE ATTACHED CONDITIONS O CONDITIONS O CONDI	79 FOR FAPPROVA
3. Spot 20 sx cmt @ 3130-24 4. Spot 30 sx cmt @ 1700-14 5. Spot 15 sx omt @ 60' to s 6. Cut off wellhead, verify cm <u>All I hereby certify that the foregoing</u> Co Name (Printed/Typed) ABIGAIL Signature (Electronic Approved By ponditions of approval, if any, are attack rtify that the applicant holds legal or e nich yould entitle the applicant to com- the 18 U.S.C. Section 1001 and Title 4 States any false fictitious or fraudulen approved sy	ATS: WOC & Tag (B/Sall) 479. WOC & Tag (T/Sall & 8 5/8 urface. Perf @ (40°) in to surface, weld on Below Gro is true and correct. Electronic Submission #44820 For COG OPEF mmitted to AFMSS for processing ANDERSON E Submission) THIS SPACE FOR F M. Approval of this notice does not w quitable title to those rights in the subje duct operations thereon. 3 U.S.C. Section 1212, make it a crime	Title SMC Title SMC	SEE ATTACHED CONDITIONS O CONDITIONS O CONDI	79 FOR FAPPROVA /2-24 Date

Author:	JCH (8/2018)		
Well Name	Federal USA L #8		
Field	Tonto Seven Rivers	API #:	30-025-32092
County	Lea	Prop #:	
State	New Mexico	Zone:	Seven Rivers
Spud Date	9/5/1993		660' FSL & 2100' FEL
GL	3,665'		Sec 14 T19S R33E

Description	O.D.	Grade	Weight	Depth	Cmt Sx	тос
Surface Csg	8.625"	J-55	24	1529'	775	surface
Inter Csg						
Prod Csg	5.5"	J-55	17.0	7556'	350	3090'
Liner						

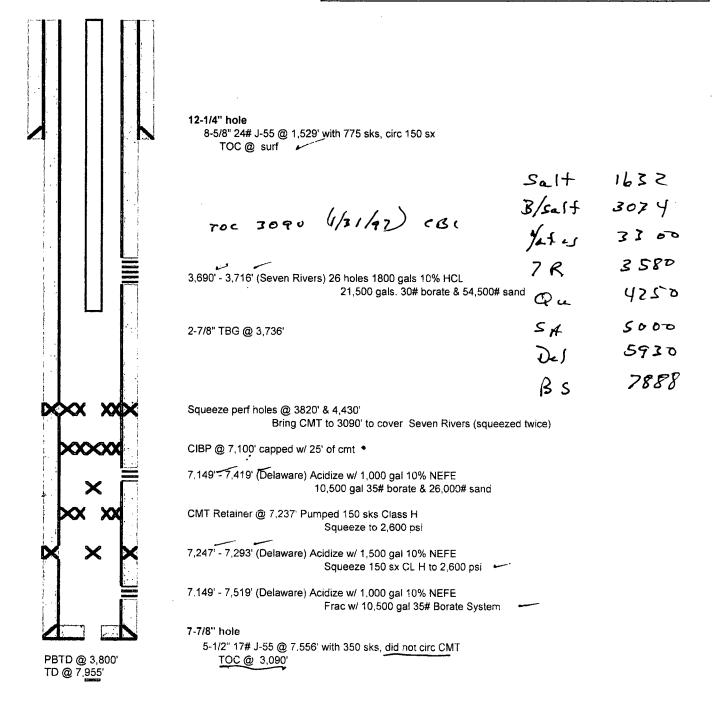

32.6547546

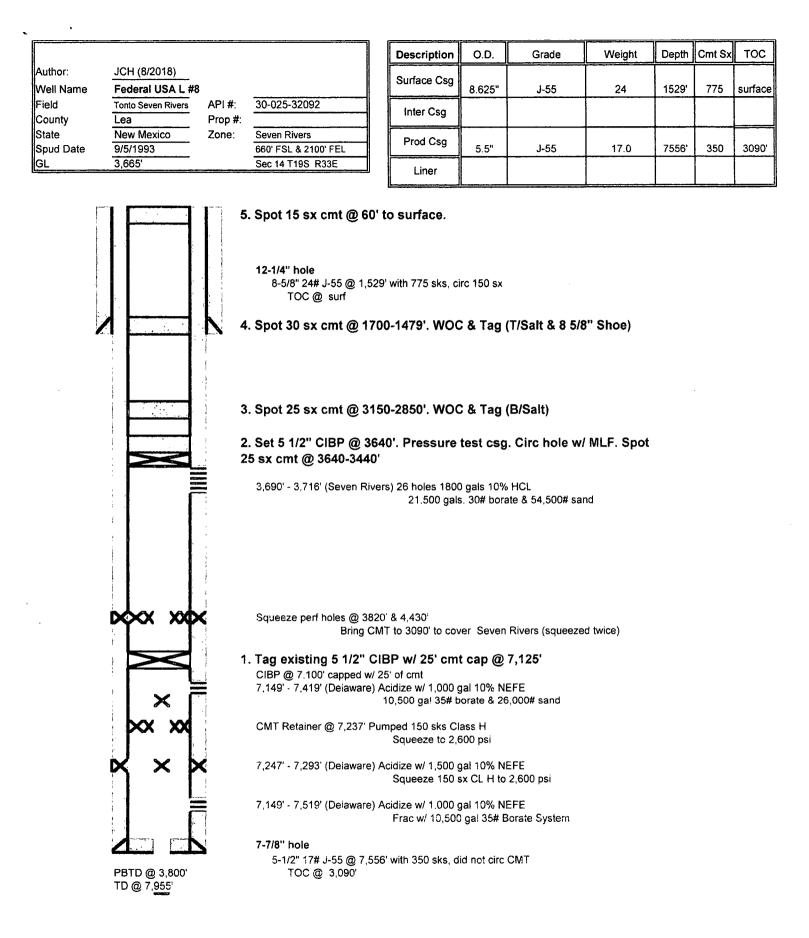

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted