Submit 1 Copy To Appropriate District Office	State of New Me	exico		n C-103	
District I – (575) 393-6161	Energy, Minerals and Natu	ral Resources	Revised Augu	ust 1, 2011	
1625 N. French Dr., Hobbs, NM 88240			WELL API NO.	į	
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION		30-025-06978		
<u>District III</u> - (505) 334-6178	1220 South St. Fran	ncis Dr.	5. Indicate Type of Lease STATE ☑ FEE □		
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460	Santa Fe, NM 87	7505	6. State Oil & Gas Lease No.	* .	
1220 S. St. Francis Dr., Santa Fe, NM	•		0, 5, 5, 5, 6, 6, 6, 6, 6, 6, 6, 6, 6, 6, 6, 6, 6,	·	
87505	CES AND DEDORTS ON WELLS		7. Lease Name or Unit Agreemen	t Name	
(DO NOT USE THIS FORM FOR PROPOS	SALS TO DRILL OR TO DEEPEN OR PLU	JG BACK TO A	7. Lease Name of Onit Agreement	it Name	
DIFFERENT RESERVOIR. USE "APPLIC	CATION FOR PERMIT" (FORM 4 10) FO	R SUCH	Central Drinkard Unit		
SUNDRY NOTI (DO NOT USE THIS FORM FOR PROPOSITION OF PROPOSALS.) 1. Type of Well: Oil Well	Gas Well 🕅 Other Injection	BS Ove	8. Well Number: 141		
2. Name of Operator	Sco.	UCD	9. OGRID Number		
Chevron U.S.A. Inc.	oep 1	1 2020	4323		
3. Address of Operator	SEP 1 1 2020 HIDLAND, TX 79706 RECEIVED		10. Pool name or Wildcat		
6301 DEAUVILLE BLVD., M	IDLAND, TX 79706	Vr-	Drinkard		
4. Well Location	~•	'ED			
Unit Letter <u>E</u> : <u>19</u>	feet from the <u>North</u>	line and <u>6</u>	60feet from theWestI	ine	
Section 33		Range 37E		Lea	
	11. Elevation (Show whether DR,	RKB, RT, GR, etc.,	·		
	3579 GL, 3589' KB		l		
12 Choole A	nnuanuista Day ta Indiasta N	otuma of Notice	Damant on Othan Data		
12. Check A	appropriate Box to Indicate N	ature of Notice,	Report of Other Data		
NOTICE OF IN	TENTION TO:	SUB	SEQUENT REPORT OF:		
PERFORM REMEDIAL WORK	PLUG AND ABANDON 🛛	REMEDIAL WOR	K ☐ ALTERING CAS	SING 🗌	
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRI	LLING OPNS.□ P AND A		
PULL OR ALTER CASING	MULTIPLE COMPL	CASING/CEMENT	「JOB □		
DOWNHOLE COMMINGLE					
DOWN TOLL COMMUNICATION					
_	П	OTHER.	TEMPORARII Y ARANDON		
OTHER:	leted operations. (Clearly state all I	OTHER:	TEMPORARILY ABANDON	 mated date	
OTHER: 13. Describe proposed or comp		pertinent details, and	TEMPORARILY ABANDON d give pertinent dates, including estinpletions: Attach wellbore diagram		
OTHER: 13. Describe proposed or comp	rk). SEE RULE 19.15.7.14 NMAC	pertinent details, and	d give pertinent dates, including esti-		
OTHER: 13. Describe proposed or comp of starting any proposed wo proposed completion or rec	rk). SEE RULE 19.15.7.14 NMAC	pertinent details, and C. For Multiple Cor	d give pertinent dates, including estin npletions: Attach wellbore diagram		
OTHER: 13. Describe proposed or comp of starting any proposed wo proposed completion or rec Chevron Us	rk). SEE RULE 19.15.7.14 NMAC ompletion. SA INC respectfully requ	bertinent details, and C. For Multiple Corests to abando	d give pertinent dates, including estin npletions: Attach wellbore diagram	of	
OTHER: 13. Describe proposed or comp of starting any proposed we proposed completion or rec Chevron Us All Cement sack volumes	rk). SEE RULE 19.15.7.14 NMAC ompletion. SA INC respectfully requ	ests to abando for Class C and 1.	d give pertinent dates, including estinpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust volu	of	
OTHER: 13. Describe proposed or comp of starting any proposed wo proposed completion or rec Chevron US All Cement sack volumes mater	rk). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requ are calculated using 1.32 yield to	ests to abando for Class C and 1. the yield used at	d give pertinent dates, including estinpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust volu	of	
OTHER: 13. Describe proposed or comp of starting any proposed we proposed completion or rec Chevron US All Cement sack volumes mate 1. Call and notify NMOCD	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield the footage as necessary based or 24 hrs before operations begin.	ests to abando for Class C and 1. the yield used at	d give pertinent dates, including estinpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust volu	of	
OTHER: 13. Describe proposed or comp of starting any proposed wo proposed completion or rec Chevron US All Cement sack volumes mate 1. Call and notify NMOCD 2. MIRU wireline unit, tank	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield to the footage as necessary based or 24 hrs before operations begin. The specific control of the	ests to abando for Class C and 1. the yield used at	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution.	of	
OTHER: 13. Describe proposed or comp of starting any proposed wo proposed completion or rec Chevron US All Cement sack volumes mate 1. Call and notify NMOCD 2. MIRU wireline unit, tank 3. R/U wireline, test lubrica	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield the footage as necessary based or 24 hrs before operations begin. The property of the pro	ests to abando for Class C and 1. the yield used at	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution.	of	
OTHER: 13. Describe proposed or comp of starting any proposed wo proposed completion or rec Chevron US All Cement sack volumes mate 1. Call and notify NMOCD 2. MIRU wireline unit, tank 3. R/U wireline, test lubrica a. Contact engineer	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield the footage as necessary based or 24 hrs before operations begin. It, and kill truck. tor to 500 psi for 10 minutes (or if pressures are larger than 500 psi for 500 psi fo	ests to abando for Class C and 1. the yield used at	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution.	of	
OTHER: 13. Describe proposed or comp of starting any proposed wo proposed completion or rec Chevron US All Cement sack volumes mate 1. Call and notify NMOCD 2. MIRU wireline unit, tank 3. R/U wireline, test lubrica a. Contact engineer 4. Run gauge to packer dept	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield the footage as necessary based or 24 hrs before operations begin. It, and kill truck. Itor to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'.	ests to abando for Class C and 1. the yield used at	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution.	of	
OTHER: 13. Describe proposed or comp of starting any proposed wo proposed completion or rec Chevron US All Cement sack volumes mate 1. Call and notify NMOCD 2. MIRU wireline unit, tank 3. R/U wireline, test lubrica a. Contact engineer 4. Run gauge to packer dept 5. Run and set CITP at 6,34	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield the footage as necessary based or 24 hrs before operations begin. It, and kill truck. It to to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'.	pertinent details, and c. For Multiple Corests to abando for Class C and 1. a the yield used at 1000 psi dependingsi, may need to use to the psi, may need to the control of the psi, may need to the psi, may need to the control of the psi, may need to the psi, m	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution.	of	
OTHER: 13. Describe proposed or comp of starting any proposed we proposed completion or receptors. Chevron USAII Cement sack volumes mate. 1. Call and notify NMOCDAIN MIRU wireline unit, tank. 3. R/U wireline, test lubrication a. Contact engineer. 4. Run gauge to packer dept. 5. Run and set CITP at 6,34. 6. Pressure test casing and total mire.	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield the footage as necessary based or 24 hrs before operations begin. It, and kill truck. Itor to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'.	pertinent details, and c. For Multiple Corests to abando for Class C and 1. a the yield used at 1000 psi dependingsi, may need to use to the psi, may need to the control of the psi, may need to the psi, may need to the control of the psi, may need to the psi, m	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution.	of	
OTHER: 13. Describe proposed or comp of starting any proposed wo proposed completion or rec Chevron US All Cement sack volumes mate 1. Call and notify NMOCD 2. MIRU wireline unit, tank 3. R/U wireline, test lubrica a. Contact engineer 4. Run gauge to packer dept 5. Run and set CITP at 6,34 6. Pressure test casing and to 7. Jet cut tubing at 6,335'.	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield the footage as necessary based or 24 hrs before operations begin. It, and kill truck. It to to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'.	pertinent details, and c. For Multiple Corests to abando for Class C and 1. a the yield used at 1000 psi dependingsi, may need to use to the psi, may need to the control of the psi, may need to the psi, may need to the control of the psi, may need to the psi, m	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution.	of	
OTHER: 13. Describe proposed or comp of starting any proposed wo proposed completion or rec. Chevron US All Cement sack volumes mate 1. Call and notify NMOCD 2. MIRU wireline unit, tank 3. R/U wireline, test lubrica a. Contact engineer 4. Run gauge to packer dept 5. Run and set CITP at 6,34 6. Pressure test casing and t 7. Jet cut tubing at 6,335'. 8. RDMO wireline unit.	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield the footage as necessary based or 24 hrs before operations begin. It, and kill truck. It to to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'. O'. ubing to 1,000 psi for 15 minutes.	pertinent details, and c. For Multiple Corests to abando for Class C and 1. In the yield used at 1000 psi dependingsi, may need to use each.	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution. In many on MASP). It is grease injection.	of ames to	
OTHER: 13. Describe proposed or comp of starting any proposed wo proposed completion or rec Chevron US All Cement sack volumes mate 1. Call and notify NMOCD 2. MIRU wireline unit, tank 3. R/U wireline, test lubrica a. Contact engineer 4. Run gauge to packer dept 5. Run and set CITP at 6,34 6. Pressure test casing and t 7. Jet cut tubing at 6,335'. 8. RDMO wireline unit. a. **NOTE: if well	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield to the footage as necessary based or 24 hrs before operations begin. It, and kill truck. It to to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'. O'. ubing to 1,000 psi for 15 minute will not bleed off or a plug cannot be seen to the control of the control	ests to abando for Class C and 1. The yield used at 1000 psi depending psi, may need to use each.	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution. In an ing on MASP). In a grease injection.	emes to	
OTHER: 13. Describe proposed or comp of starting any proposed we proposed completion or rec Chevron US All Cement sack volumes mate 1. Call and notify NMOCD 2. MIRU wireline unit, tank 3. R/U wireline, test lubrica a. Contact engineer 4. Run gauge to packer dept 5. Run and set CITP at 6,34 6. Pressure test casing and to 7. Jet cut tubing at 6,335'. 8. RDMO wireline unit. a. **NOTE: if well engineer. Need to	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield at the footage as necessary based or 24 hrs before operations begin. and kill truck. tor to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'. O'. ubing to 1,000 psi for 15 minutes will not bleed off or a plug can be attempt injection into the performance attempt injection into the performance.	ests to abando for Class C and 1. the yield used at 1000 psi depending psi, may need to use each.	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution. In many on MASP). It is grease injection.	emes to	
OTHER: 13. Describe proposed or comp of starting any proposed we proposed completion or recent Chevron USAII Cement sack volumes mate. 1. Call and notify NMOCDAI MIRU wireline unit, tank. 3. R/U wireline, test lubricate. a. Contact engineer. 4. Run gauge to packer dept. 5. Run and set CITP at 6,34. 6. Pressure test casing and the proposed complete. Need to change the plant.	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield to the footage as necessary based or 24 hrs before operations begin. It, and kill truck. It to to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'. O'. ubing to 1,000 psi for 15 minute will not bleed off or a plug cannot be seen to the control of the control	ests to abando for Class C and 1. the yield used at 1000 psi depending psi, may need to use each.	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution. In an ing on MASP). In a grease injection.	emes to	
OTHER: 13. Describe proposed or comp of starting any proposed we proposed completion or recent Chevron USAII Cement sack volumes mate. 1. Call and notify NMOCD 2. MIRU wireline unit, tank 3. R/U wireline, test lubrica a. Contact engineer 4. Run gauge to packer dept 5. Run and set CITP at 6,34 6. Pressure test casing and to 7. Jet cut tubing at 6,335'. 8. RDMO wireline unit. a. **NOTE: if well engineer. Need to change the plant to 9. Rig up lay down rig.	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield to the footage as necessary based or 24 hrs before operations begin. It, and kill truck. It to to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'. O'. ubing to 1,000 psi for 15 minutes will not bleed off or a plug can be attempt injection into the performance allow the double rig to plug the	ests to abando for Class C and 1. the yield used at 1000 psi depending psi, may need to use each.	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution. In an ing on MASP). In a grease injection.	emes to	
OTHER: 13. Describe proposed or comp of starting any proposed we proposed completion or recent Chevron USAII Cement sack volumes mate. 1. Call and notify NMOCDAI MIRU wireline unit, tank. 3. R/U wireline, test lubricate. a. Contact engineer. 4. Run gauge to packer dept. 5. Run and set CITP at 6,34. 6. Pressure test casing and the proposed complete. Need to change the plant.	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield to the footage as necessary based or 24 hrs before operations begin. It, and kill truck. It to to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'. O'. ubing to 1,000 psi for 15 minutes will not bleed off or a plug can be attempt injection into the performance allow the double rig to plug the	ests to abando for Class C and 1. the yield used at 1000 psi depending psi, may need to use each.	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution. In an ing on MASP). In a grease injection.	emes to	
OTHER: 13. Describe proposed or comp of starting any proposed we proposed completion or recent Chevron USAII Cement sack volumes mate. 1. Call and notify NMOCD 2. MIRU wireline unit, tank 3. R/U wireline, test lubrica a. Contact engineer 4. Run gauge to packer dept 5. Run and set CITP at 6,34 6. Pressure test casing and to 7. Jet cut tubing at 6,335'. 8. RDMO wireline unit. a. **NOTE: if well engineer. Need to change the plant to 9. Rig up lay down rig.	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requere calculated using 1.32 yield and the footage as necessary based or 24 hrs before operations begin. It, and kill truck. It to to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'. O'. ubing to 1,000 psi for 15 minutes will not bleed off or a plug cannot attempt injection into the perform allow the double rig to plug the test as per SOP.	ests to abando for Class C and 1. the yield used at 1000 psi depending psi, may need to use each.	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution. In an ing on MASP). In a grease injection.	emes to	
OTHER: 13. Describe proposed or comp of starting any proposed we proposed completion or recent Chevron US All Cement sack volumes mate. 1. Call and notify NMOCD 2. MIRU wireline unit, tank. 3. R/U wireline, test lubricate. a. Contact engineer. 4. Run gauge to packer dept. 5. Run and set CITP at 6,34. 6. Pressure test casing and test to the contact to the contact engineer. Need to change the plant. 9. Rig up lay down rig. 10. N/U BOPE and pressure.	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requere calculated using 1.32 yield and the footage as necessary based or 24 hrs before operations begin. It, and kill truck. It to to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'. O'. ubing to 1,000 psi for 15 minutes will not bleed off or a plug cannot attempt injection into the perform allow the double rig to plug the test as per SOP.	ests to abando for Class C and 1. the yield used at 1000 psi depending psi, may need to use each.	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution. In an ing on MASP). In a grease injection.	emes to	
OTHER: 13. Describe proposed or comp of starting any proposed we proposed completion or receptors. Chevron USAII Cement sack volumes mate. 1. Call and notify NMOCDA. 2. MIRU wireline unit, tank. 3. R/U wireline, test lubricate. a. Contact engineer. 4. Run gauge to packer dept. 5. Run and set CITP at 6,34. 6. Pressure test casing and the complete test casing and the complete test. 7. Jet cut tubing at 6,335'. 8. RDMO wireline unit. a. **NOTE: if well engineer. Need to change the plant. 9. Rig up lay down rig. 10.N/U BOPE and pressure. 11. Pull and laydown tubing. 12. RDMO.	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requere calculated using 1.32 yield and the footage as necessary based or 24 hrs before operations begin. It, and kill truck. It to to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'. O'. ubing to 1,000 psi for 15 minutes will not bleed off or a plug cannot attempt injection into the perform allow the double rig to plug the test as per SOP.	ests to abando for Class C and 1. the yield used at 1000 psi depending psi, may need to use each.	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution. In an ing on MASP). In a grease injection.	emes to	
OTHER: 13. Describe proposed or comp of starting any proposed we proposed completion or recent Chevron USAII Cement sack volumes mate. 1. Call and notify NMOCD 2. MIRU wireline unit, tank. 3. R/U wireline, test lubricate. a. Contact engineer. 4. Run gauge to packer dept. 5. Run and set CITP at 6,34. 6. Pressure test casing and test. The cut tubing at 6,335. 8. RDMO wireline unit. a. **NOTE: if well engineer. Need to change the plant test. 9. Rig up lay down rig. 10.N/U BOPE and pressure. 11. Pull and laydown tubing. 12. RDMO. 13. MIRU CTU.	ork). SEE RULE 19.15.7.14 NMAC completion. SA INC respectfully requare calculated using 1.32 yield to the footage as necessary based or 24 hrs before operations begin. It and kill truck. It or to 500 psi for 10 minutes (or if pressures are larger than 500 th, 6,345'. O'. The will not bleed off or a plug can be attempt injection into the performance of allow the double rig to plug the test as per SOP.	pertinent details, and c. For Multiple Corests to abando for Class C and 1. In the yield used at 1000 psi dependingsi, may need to use each.	d give pertinent dates, including estimpletions: Attach wellbore diagram on this well as follows: 18 yield for Class H. Adjust voluthe time of execution. In an ing on MASP). In a grease injection.	mes to	

certain point agreed upon by the NMOCD and Chevron.

- a. Bubble test should be at least 30 minutes and follow the bubble test SOP.
- b. Bubble tests should occur each morning, critical times are prior to pumping upper hydrocarbon plug or pumping cement to surface.
- c. Perform final bubble test after cement has hardened.
- 15. N/U BOP and pressure test as per SOP.
 - a. 250 psi low for 5 minutes, and MASP or 1,000 psi, or highest expected pressure (whichever is greater) for the job for 10 minutes each.
- 16. TIH and tag tubing stub at 6,335'.
- 17. Spot MLF, subtracting cement volumes. Do not place MLF until casing pressure tests or above the first P&S job.
- 18. Spot 30 sx CL "C" cement f/ 6,335' t/ 5,898' (perfs).
 - a. TOC must be at 5,954' or shallower.
 - b. Discuss with NMOCD on waiving WOC and tag if casing passed a pressure test.
- 19. Perforate at 3,860' and squeeze 50 sx CL "C" cement f/3,497' t/3,860' (San Andres, Grayburg).
 - a. TOC must be at 3,534' or shallower.
 - b. Wait 1-2 hours to allow cement to gel before moving to next plug.
- 20. Perforate at 2,590' and squeeze 75 sx CL "C" cement f/ 2,065' t/ 2,590' (Yates).
 - a. TOC must be at 2,090' or shallower.
 - b. WOC and pressure test cement to 1,000 psi for 15 minutes for Chevron barrier standard.
 - c. If no circulate to surface is noted during squeeze, WOC and tag the plug.
- 21. Perforate (deep penetrators) at 1,397' and squeeze 380 sx CL "C" cement f/ Surface t/ 1,397' (T.Salt, Shoe, FW).
 - a. Deepest freshwater zone in the area is ~108'.
 - b. Attempt to circulate cement inside and out of production and intermediate casing strings.
- 22. Cut all casings & anchors & remove 3' below grade. <u>Verify</u> cement to surface & weld on dry hole marker (4" diameter, 4' tall). Clean location.

Note: All cement plugs class "C" (<7,500') or "H" (>7,500') with closed loop system used, and MLF spotted between plugs.

I hereby certify that the information SIGNATURE		omplete to the bes		nowledge and belief. DA	TF 09/0	03/2020
SIGNATURE 19	IIIEE_ICAE	ngmeet, Attorney	mract	DA	1.L00//0	372020
Type or print name Howie Lucas	E-mail a	ddress: <u>howie.lı</u>	ucas@che	vron.com PHONE	E: <u>(832)-5</u>	88-4044
	Fet .	TITLE C	0	A	DATE_	9-11-20
Conditions of Approval (if any):	. –					

WELL DATA SHEET

FIELD: Drinkard

LOC: 1980' FNL & 660' FWL TOWNSHIP: 21S

RANGE: 37E Unit Letter: E N 32° 26' 13.632",

W -103° 10' 25.752" (NAD27)

9-5/8" OD, 36# Csg Csg set @ 1224' w/ 300 sx Circ cmt to surface 12-1/4" HOLE

7" OD, 24# Gr Set @ 3650' w/ 275 sx Cmt TOC: Unknown 8-3/4" HOLE

5" OD, 15#, J-55 Gr. Csg @ 6630' w/ 250 sks cmt TOC @ 4100' by Calc

> CIBP pushed to 6610' 13' perf gun @ 6614-27'

WELL NAME: Central Drinkard Unit # 141

SEC: 33

STATE: NM

COUNTY: Lea

Current Well Data

GL: 3579' KB: 3589

H: 10.5'

FORMATION: Drinkard

CURRENT STATUS: Shut-in Wtr Ini

API NO: 30-025-06978

Chevno: FA8075

Spud date: 7-5-39

Initial: Production

NA

initial completion date: 7-29-39 Initial Formation: Grayburg

FROM: 3650'

Completion data:

7/5/39 Spud date

7/29/39 Initial Completion date: Grayburg, TD @ 3780' -

Treated w/ 250 gts nitro

11/7/47 Deepen well to Drinkard - Acdz Drk 6550-6590' w/500 gals mud acid & 70% low tension acid, 3000 G 20%

LT acid

11/17/47 Re-completion date: Drinkard, TD @ 6630'

Subsequent Workover or Reconditioning:

12/4/72 Convert to water injection - Perfd 6534-38' & 6510-

14'. Trt'd w/5000 gals 15% HCL.

12/14/1972 Began injection

6/4/74 Acdz Drk 6510-6590' w/1000 gals 15% HCL.

2/1/77 Tracer Survey

4/26/77 Sqzd perfs 6510-14' w/150 sx cmt.

9/1/79 Acdz w/3000 gals 20% NeFe, dropped 60 7/8"

RCNB'S & 750# RS - RTI

2/1/80 Tracer Survey found thief zone open.

8/1/80 Sqz thief zone, 6510-14'. 12/1/95 Tag TD 6595', Acdz w/2500 gals 15% HCL

2/17/1998 - Tbg failure - replace pkr, circ pkr fluid and test csg to 500# 15 mins

5/12/2005 - TA well - Set CIBP @ 6345', cap w/ 35' cmt and test csg to 500 PSI 30 mins, PBTD 6310'

1/17/07 RTI - tag CIBP, drill to 6614', push CIBP down, drill to 6610', pmp 4000 G 15% HCl acid in 4 stgs, SIOW - RIH W/5" Model R inj pkr, 207 jts 2-3/8" J-55 Solta (PVC) & 1 jt 2-3/8" J-55 top sub - Set pkr @ 6345', circ hole w/ pkr fluid -

Injecting 200 BWPD @ 0 PSI

TUBING DETAIL: 1 jt 2-3/8" J55 Tbg Sub 207 jts 2-3/8" J55 SOLTA (PVC) 5" Model R Pkr @ 6345'

Drinkard Perfs

6510'-14' 7/77 -Sqz'd w/150 sx cmt (RESQZ'D 8/80)

6534'-38' 4 JHPF

6550'-90' 4 JHPF

PBTD: 6610' TD @ 6630'

WELL DATA SHEET

FIELD: Drinkard LOC: 1980' FNL & 660' FWL

TOWNSHIP: 21S RANGE: 37E Unit Letter: E N 32° 26' 13.632", W -103° 10' 25.752" (NAD27) WELL NAME: Central Drinkard Unit # 141


SEC: 33 COUNTY: Lea STATE: NM

GL: 3579' KB: 3589 H: 10.5'

FORMATION: Drinkard CURRENT STATUS: Shut-in Wtr Inj

API NO: 30-025-06978 Chevno: FA8075

Proposed Well Data

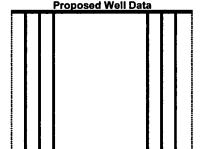

Spud date: 7-5-39 initial completion date: 7-29-39 Initial Formation: Grayburg FROM: 3650' TO: 3780'

Initial: Production NΑ

9-5/8" OD, 36# Csg Csg set @ 1224' w/ 300 sx Circ cmt to surface 12-1/4" HOLE

7" OD, 24# Gr Set @ 3650' w/ 275 sx Cmt TOC: Unknown 8-3/4" HOLE

5" OD, 15#, J-55 Gr. Csg @ 6630' w/ 250 sks cmt TOC @ 4100' by Calc

	TD, ft		
Formation Name	Тор		1
Rustler	1,189	i i	
Salt Top	1,347		
Salt Bottom	2,394		
Yates	2,590		
Seven Rivers	2,846		
Queen	3,327		ı
Grayburg	3,634		
San Andres	3,860		
Glorieta	5,067		
Paddock	5,164		
Blinebry	5,558		
Tubb	6,054		
Drinkard	6,318)	
Abo	6,584		
TD	6,630		
	•		
			r
			=
			=
CIBP pushed	to 6610' —	↓	
13' perf gun @ 6			
13 pen gun @ 0	0014-27		

4 Perf at 1397' and squeeze 380 sx Class C Cement 1397'-0'

3 Perf at 2590' and squeeze 75 sx Class C Cement: 2590'-2065'

Min: 2344'

2 Perf at 3860' and squeeze 50 sx Class C Cement:

3860'-3497' Min: 3534'

Set CITP at 6340', cut tubing at 6335' Spot 35 sx Class C Cement: 6335'-5898' Min: 5954'

> TUBING DETAIL: 1 jt 2-3/8" J55 Tbg Sub 207 jts 2-3/8" J55 SOLTA (PVC) 5" Model R Pkr @ 6345'

Drinkard Perfs

6510'-14'

7/77 -Sqz'd w/150 sx cmt (RESQZ'D 8/80)

6534'-38'

4 JHPF

6550'-90'

PBTD: 6610' TD @ 6630'

4 JHPF