

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- DEPLETED	7. Unit Agreement Name
2. Name of Operator PAN AMERICAN PETROLEUM CORPORATION	8. Farm or Lease Name STATE 19
3. Address of Operator BOX 68, HOBBS, N. M. 88240	9. Well No. 1
4. Location of Well UNIT LETTER G , FEET FROM THE _____ LINE AND _____ FEET FROM THE _____ LINE, SECTION 19 TOWNSHIP 12-S RANGE 38-E NMPM.	10. Field and Pool, or Wildcat GLADIOLA
15. Elevation (Show whether DF, RT, GR, etc.) 3878' D. F.	12. County LEA

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

In accordance w/ form C-102 submitted 11-9-62. well was plugged and abandoned as follows:

2 pt 15 cu cement plug (11945-59) across perforations
cut + pull 5 1/2" casing from 5006 (shot @ 3899, 7014, 5996, 5489, 5006) 20 cu pt
20 cu plug- 7140- 7200, 20 cu 5880-5940, 20 cu in + out of 5 1/2" stub @ 5006.

cut + pull 8 7/8" cog from 1003' (shot @ 2145, 1930, 1775, 1600, 1326)
20 cu in + out of stub @ 1003. 25 cu in + out of surface casing set @ 328'. 10 cu @ surface + erect PTA marker.

Made final cleanup and restored ground to contour.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED _____ TITLE **AREA SUPERINTENDENT** DATE **4-23-68**

002-NMOCC-11
F.N.S.W.
APPROVED BY *John W. Runyan*
1- W.F. Spencer
CONDITIONS OF APPROVAL, IF ANY:
1- SUSPENSE
* we are unable to locate
persons report in our file

TITLE _____ DATE _____