

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease  
State  Fee   
5. State Oil & Gas Lease No.  
K-6231

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL  GAS WELL  OTHER- SWD

2. Name of Operator  
Marks-Garner Production Company

3. Address of Operator  
P O Box 70, Lovington, NM 88260

4. Location of Well  
UNIT LETTER A, 660 FEET FROM THE North LINE AND 990 FEET FROM THE East LINE, SECTION 2 TOWNSHIP 14-S RANGE 33-E NMPM.

7. Unit Agreement Name  
---

8. Farm or Lease Name  
Huber State

9. Well No.  
2-a (SWD)

10. Field and Pool, or Wildcat  
Lazy J - Penn

15. Elevation (Show whether DF, RT, GR, etc.)  
GL 4194

12. County  
Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Tubing parted, fell in open hole 2303' 2 7/8 with baker 4 1/2 AD1. Went in with overshot and bumper sub, got stuck 3500', backed off tubing one joint above overshot, go in with washpipe, go back in with overshot, could not get overshot on fish. Tried wash pipe and overshot three times without success. Prepared to plug spot 100 foot. Plug at top of junk. Load hole with salt gel, 100 foot plug top of salt 1700', 100 foot plug 368', 13 3/8 shoe cut off head. Run 1 in. pipe between 13 3/8 - 8 5/8 circulate cement to surface.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Jerry A. Sexton TITLE PARTNER DATE 3-3-87

ORIGINAL SIGNED BY JERRY SEXTON  
DISTRICT I SUPERVISOR

MAR 5 1987

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED  
MAR 4 1987  
OCD  
HOBB'S OFFICE