

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. K1955
7. Lease Name or Unit Agreement Name New Mexico JJ State
8. Well No. 2
9. Pool name or Wildcat Baum (Upper Penn)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL ☒ GAS WELL ☐ OTHER ☐	
2. Name of Operator Ginger Petroleum Company, Inc.	
3. Address of Operator P.O. Box 827, La Grange, Texas 78945	
4. Well Location Unit Letter <u>G</u> : <u>1980</u> Feet From The <u>North</u> Line and <u>1980</u> Feet From The <u>East</u> Line Section <u>23</u> Township <u>13S</u> Range <u>32E</u> NMPM <u>Lea</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4309.5'GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK ☐	REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐	ALTERING CASING ☐
PULL OR ALTER CASING ☐	COMMENCE DRILLING OPNS. ☐
OTHER: ☐	PLUG AND ABANDONMENT ☒
	CASING TEST AND CEMENT JOB ☐
	OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. (2-14-89)

1. RIH w/5½" CIBP set @ 9700'. Spot 5 sxs. on top via dump bailer.
2. Load hole w/10#/gal mud-laden fluid.
3. Cut csg @ 4038' (2-27-89). Pull 16 jts, shutdown due to high winds.
4. Pull remaining csg. Run tbgt to 5330'. Spot 100' plug (25 sxs); pull to 4088', spot 100' plug (45 sxs) (2-28-89)
5. Tag plug @ 3905' (3-1-89) Pull tbgt to 2500', spot 100' (26 sxs). Pull to 505', spot 100' (45 sxs). POH.
6. Spot 10 sxs in surface (3-1-89)
7. Weld plate on 8-5/8", install dry hole marker, cut dead men off, cover pits & cellar.
8. Released rig (3-1-89)

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Steve Hillhouse TITLE Vice President DATE 3-7-89

TYPE OR PRINT NAME Steve Hillhouse

TELEPHONE NO 409/242-5528

(This space for State Use)

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE APR 3 1989

CONDITIONS OF APPROVAL, IF ANY:

3