

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION  
P. O. BOX 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease  
State ☐ Fee ☒

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-	7. Unit Agreement Name
2. Name of Operator Amerind Oil Co.	8. Farm or Lease Name Sanders - State Com
3. Address of Operator 500 Wilco Bldg., Midland, TX 79701	9. Well No. 1
4. Location of Well UNIT LETTER G, 1650 FEET FROM THE North LINE AND 1350 FEET FROM THE East LINE, SECTION 35 TOWNSHIP 14S RANGE 34E NMPM.	10. Field and Pool, or Wildcat High Plains Permo Penn
15. Elevation (Show whether DF, RT, GR, etc.) 4079' GL, 4093' KB	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Proposed Operations:

1. Set CIBP @ 10,450'. (Top of perfs @ 10,519'). Dump 35' cmt on top of plug.
2. Pull casing. (Top of cmt @ 9740'). Load hole w/9.5 ppg brine w/25 #/bbl salt gel.
3. Set 100' cmt plug 1/2 in and 1/2 out of 5-1/2" csg stub. Tag plug.
4. Set 100' cmt plug across Glorietta. Top of Glorietta @ 6056'.
5. Set 100' cmt plug 1/2 in and 1/2 out of 8-5/8" csg, set @ 4500'.
6. Set 100' cmt plug inside of 8-5/8" csg from 1750' to 1850'. Top of Anhydrite @ 1856'.
7. Set 10 sx cmt in top of 8-5/8" w/marker installed.

Will call w/proposed date of plugging operations.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Robert C. Leibrock TITLE Vice President DATE March 18, 1986

ORIGINAL SIGNED BY JERRY SEXTON

MAR 21 1986

APPROVED BY DISTRICT SUPERVISOR TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED  
MAR 21 1986  
C.C.D.  
HOBBS OFFICE