

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department.

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-07422
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name	N. HOBBS (G/SA) UNIT SECTION 28
8. Well No.	111
9. Pool name or Wildcat	HOBBS (G/SA)

1. Type of Well:
 OIL WELL GAS WELL OTHER INJECTOR

2. Name of Operator
SHELL WESTERN E&P INC.

3. Address of Operator
P. O. BOX 576, HOUSTON, TX 77001 (WCK 4435)

4. Well Location
 Unit Letter D : 990 Feet From The NORTH Line and 330 Feet From The WEST Line
 Section 28 Township 18S Range 38E NMPM LEA County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3646' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <u>Profile Modification</u> <input checked="" type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-13 to 12-29-89:
 PDH w/inj equip. Plugged back from 4274' to 4254' w/20/40 mesh & 100 mesh sd + 6 gals hydromite. CO w/scraper to 4220'. Set CIBP @ 4195' & pkr @ 4129'. Pres tstd sqzd perfs 4041' - 4120' to 500#, held. PDH w/pkr. Set CICKR @ 4129'. Sqzd perfs 4147' - 4182' w/29 SX Cls "C" cmt. DO CICKR & cmt to 4195'. Pres tstd sqz to 500#, held 30 min. Drld up CIBP, pushed remnants to btm. Tagged P3TD @ 4253'. Acd SA perfs 4214' - 4226' & OH perfs 4244' - 50' w/1600 gals 15% HCl + 600# rock salt. Inst inj equip, setting Guib Uni-PKr VI @ 4186'. Pres tstd csg to 500# for 30 min, held. Retd to inj.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE J. H. Smitherman TITLE REGULATORY SUPV. DATE 1-22-90

TYPE OR PRINT NAME J. H. SMITHERMAN (713) 870-3797 TELEPHONE NO.

(This space for State Use)

APPROVED BY ORIGINAL SIGNED BY JERRY SEXTON TITLE _____ DATE _____
DISTRICT I SUPERVISOR

CONDITIONS OF APPROVAL, IF ANY:

JAN 25 1990

RECEIVED

JAN 24 1990

OCD
HOBBS OFFICE