State of New Mexico Minerals and Natural Resources Department Ene

Form C-103 Revised 1-1-89

DISTRICT 1 P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

OIL CONSERVATION DIVISION 310 Old Santa Fe Trail, Room 206 Santa Fe, New Mexico 87503

WELL API NO 07939

TELEPHONE NC 915/570-5382

P.O. Drawer DD, Arlesia, NM 88210 DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410 SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS) 1. Type of Well:			5. Indicate Type of Lease STATE X FIE 6. State Oil & Gas Lease No 7. Lease Name or Unit Agreement Name Davis							
					OB ASTIT	ОТНЕЯ		. • • • • • • • • • • • • • • • • • • •		- :-
					2. Name of Operator David H. Arrington Oil & Gas, Inc.			5 Well No 1		
3. Address of Operator 214 West Texas Ave., Ste. 400, Midland, Texas 79701			9 Pool name or Wildcat Hobbs East (San Andres)							
4. Well Location 990 Unit Letter 390	Feet From The South	Line and 330	Feet	Irrom The East						
Section 29	Township 18S	Range 39E	NMPM	Lea	County					
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3594' GL										
11. Check A NOTICE OF INT	• • •	licate Nature of Notice, I	_	ther Data T REPORT OF						
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	_	ALTERING CASING						
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLIN	NG OPNS PLUG AND ABANDONMENT							
PULL OR ALTER CASING		CASING TEST AND C	EMENTJOB _							
OTHER		OTHER.								
12. Describe Proposed or Completed Operativork, SEE RULE 1103. 10-3/4" casing @ 362'- TOC @ 5-1/2" casing @ 4449'. Cemente CIBP set @ 4401' on 1/28/02. 1. Tally in hole w/ tubing and 2. PUH to 3183' and spot a 2 3. Tag top of plug at 3133'. 4. POOH w/ tubing. 5. Cut casing at free point (20 6. Spot a 40 sx. plug 50' in ar 7. Tag top of plug 50' above 8. PUH to 412' and spot a 55 9. Tag plug at 312'. Spot a 1	surface. 7-5/8" casing @ 3 ed w/ 175 sx. cement. To tag CIBP @ 4401. Circle 5 sx. plug. PUH and W 000' +/-) ad out of casing stub. P 5-1/2" casing stub. sx. plug. POOH and W 0 sx. surface plug.	3133'- TOC @ surface. C @ 2000' culate hole w/ 10# mud. C OC. UH and WOC.Ton Conce	Cap CIBP w/ 2	5 sx. cement.						
10. Cut off wellhead. Install dr		day and balled								
I hereby certify that the information above linear in	no complete to the best of my knowled	age and beak: TITLE Agent		DATE 2-17-03						

(Thus space for State Use)

ORIGINAL SIGNED BY GARY W. WHIK-CONDITIONS OF AFFROVAL, IF ANY COLETE SEED SERVICES AND A CER


TYPE OR PRINT NAME H. Boatright

WELL NAME AND NUMBER

Davis #1

David H. Arrington Oil and Gas Inc. Lea County, New Mexico

WELLBORE CONFIGURATION

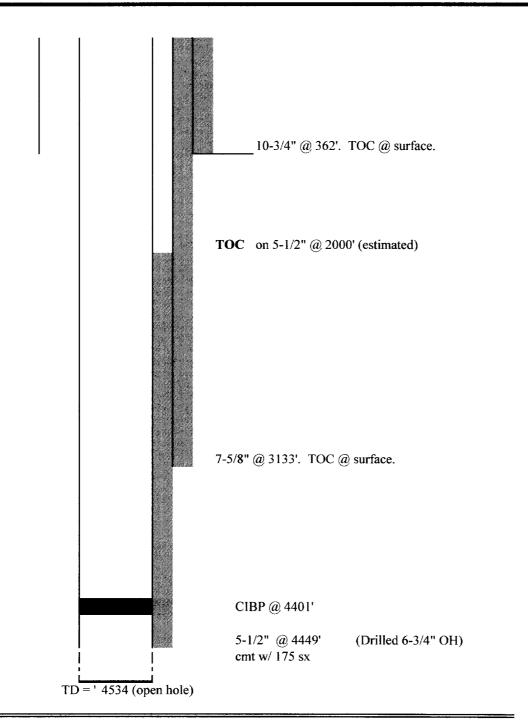


Print Date: 2/13/2003

WELL NAME AND NUMBER

Davis #1
David H. Arrington Oil and Gas Inc.

Lea County, New Mexico
After Plugging

WELLBORE CONFIGURATION

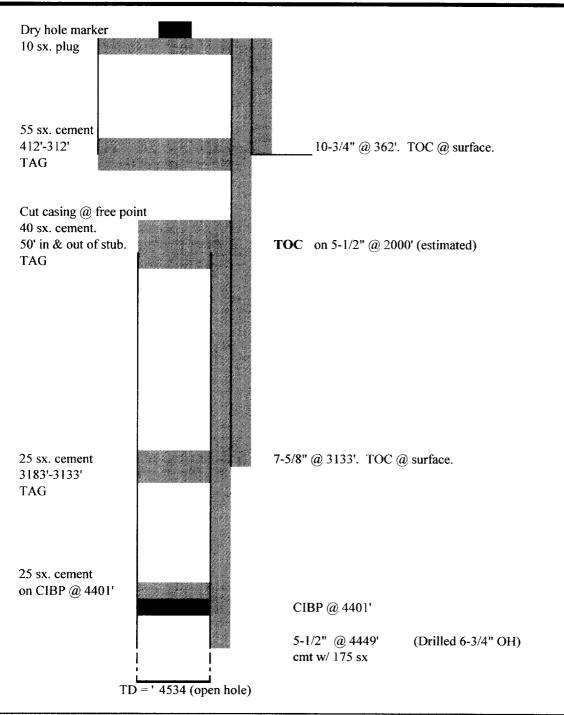

Print Date: 2/13/2003