

SEP 21 11 01 AM '64

- *9/2/64: Spotted #1 cement plug, 25 sx 8632'-8732'.
- 9/3/64: Shot 4½" casing @ 7600', pipe stuck in cement; shot #2 @ 7500', pipe stuck in cement; shot #3 @ 7100', out of cement but pipe would not free; shot #4 @ 6500', pulled 130,000# on csg. but pipe would not move.
- 9/4/64: Shot #5 @ 5881', pipe not free; shot #6 @ 5500', pipe stuck; shot #7 @ 5265', pulled 130,000#, but pipe would not move; shot #8 @ 4975', pulled and recovered 4975' 4½" csg.
- 9/5/64: Spotted #2 cement plug, 25 sx @ cut off, 4975'-5075'. Spotted #3 cement plug, bottom of salt string, 25 sx 4125'-4200'.
- 9/7/64: Shot #1 8-5/8" csg. @ 2600', pipe stuck. Shot #2 @ 2000', pulled 260,000#, pipe would not move. Shot #3 @ 1510', pulled and recovered 1510' of 8-5/8" csg.
- 9/8/64: Spotted #4 cement plug, 25 sx @ 8-5/8" cut off 1458'-1533'. Spotted #5 cement plug @ base of surface 340'-415'. Spotted #6 cement plug, 10 sx in top of surface pipe. Heavy mud spotted between all plugs.

Installed customary 4½" X 4' dry hole marker inscribed as follows:

Charles B. Read #1 Gulf State
SW¼SE¼ 12 - 17S - 36E

