

27. Cut off 13 3/8" casing 3' below ground level.

Weld 1/4" steel plate on same. Install 4" x 10' (4' above ground) abandoned well marker with well name, number and location inscribed on same. RD MO plugging unit. Backfill pits and cellar. Haul off all equipment and junk.

- NOTE:
1. Cement mix should be at 14.8 ppg and 1.32 cu.ft./sx minimum requirement using common cement.
 2. Upon UTP and BLM approval, Contractor may substitute perforating and squeezing for cutting and pulling casing if economics so justify.

038/AA