State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

DISTRICT

5

OH CONCEDUATION DIVISION -

P.O. Box 1980, Hobbs, MM. 88240 P.O. Box 2088 Santa Fe, New Mexico 87504-2088 Santa Fe, New Mexico 87	DISTRICT	OIL CONSER	VATION DIVISION	WELL API NO.
Santa Fe, New Mexico 87504-2088 5. Indicate Type of Lease FEE DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410 6. State Oil / Gas Lease No. 5. Indicate Type of Lease STATE FEE DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410 6. State Oil / Gas Lease No. 6. State Oil / Gas Lease No. 7. Lease Name or Unit Agreement Name PHILLIPS, J. R. 7. Lease Name or Unit A	P.O. Box 1980, Hobbs, NM 88	8240		
STATE FEE		Santa Fe Me		
1000 Rio Brazos Rd., Aztec, NM 87410 5. State Uir Cast Lease No.		NM 88210 Ganta 7 5, 113	W W CX 100 07 00 4 2000	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS. TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE 'APPLICATION FOR PERMIT 1. Type of Well: OIL GAS WELL OTHER 2. Name of Operator 1. Type of Operator 1. Type of Well: OIL GAS WELL OTHER 2. Name of Operator 1. Type of Operator 1. Type of Operator 2. Name of Operator 3. Address of Operator 4. Well Location Unit Letter F: 2269 Feet From The NORTH Line and 2266 Feet From The WEST Line Section 6 Township 20S Range 37E NMPM LEA COUNTY 10. Elevation (Show whether DF, RKB, RT,GR, etc.) 3565' GL 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON ALTER CASING COMMENCE DRILLING OPERATION PLUG AND ABANDON CASING TEST AND CEMENT JOB THERE OTHERS COUNTY 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12. OPERFORM REMEDIAL WORK THE REMEDIAL WORK SEE RULE 1103. 12. OPERFORM REMEDIAL WORK SEE RULE 1103. 12. OPERFORM SEE RULE 1103. 13. ACT SEED ON SEE RULE 1103. 14. OPERFORM SEE RULE 1103. 15. OPERFORM SEE RULE 1103. 16. OPERFORM SEE RULE 1103. 17. Lease Name of Unit Agreement Name PHILLIPS, J. R. 18. Well No. 12. OPERFORM SEVEN SEVEN RIVERS QUEEN 7. Lease Name of Unit Agreement Name PHILLIPS, J. R. 12. OPERFORM SEEN SEED SEED SEED SEED SEED SEED SEED		M 97410		6. State Oil / Gas Lease No.
2. Name of Operator TEXACO EXPLORATION & PRODUCTION INC. 3. Address of Operator 1. Well Location Unit Letter F : 2269 Feet From The NORTH Line and 2266 Feet From The WEST Line Section 6 Township 20S Range 37E NMPM LEA COUNTY 10. Elevation (Show whether DF, RKB, RT,GR, etc.) 3565' GL 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLLING OPERATION PLUG AND ABANDONNENT CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLLING OPERATION PLUG AND ABANDONMENT CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB TOTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12. 30-99: MIRU BLED DN CSG, NDWH, NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG, TAG @ 3308: START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TH W/BIT TO 3450', NO FILL. TIH W/CSG GIN, PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG, SET RBP @ 3200'. TEST TO 1500-OK, PULL PKR TO 2850'. 1-06-00: ACDIZE 3025-3145 W/3250 GALS 15% NEFE HCL. RU SWAB, FL @ 2200'. 1-07-00: FL @ SN. REL PKR, TIH W/RET TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-10-00: RD SWAB, LOWER RET TOOL ON TBG TO RBP @ 3200'. REL RRP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED, NDBOP, NUWH.	SUN (DO NOT USE THIS FORM	IDRY NOTICES AND REPORTS I FOR PROPOSALS TO DRILL OR T ENT RESERVOIR. USE "APPLICAT	TO DEEPEN OR PLUG BACK TO	· •
TEXACO EXPLORATION & PRODUCTION INC. 12 3. Address of Operator 205 E. Bender, HOBBS, NM 88240 4. Well Location Unit Letter F: 2269 Feet From The NORTH Line and 2266 Feet From The WEST Line Section 6 Township 20S Range 37E NMPM LEA COUNTY 10. Elevation (Show whether DF, RKB, RT,GR, etc.) 3565' GL 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPERATION PLUG AND ABANDON CHANGE PLANS OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-30-99: MIRU. BLED DN CSG, NDWH, NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG. TAG @ 3308'. START FOAM UNIT. CO FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450'. NO FILL. TIH W/CSG GUN. PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W//RBP & PKR, & TBG. SET RBP @ 3200'. TEST TO 1500-OK. PULL PKR TO 2850'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-11-00: RD SWABL LOWER RET TOOL ON TBG TO RBP @ 3200'. REL RBP. TIH W//SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-100: TIH W//PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 5004-OK. CHECK PUMP ACTION-OK. RIG DOWN.	II. IVDE OI VVEIL.			-
4. Well Location Unit Letter F: 2269 Feet From The NORTH Line and 2266 Feet From The WEST Line Section 6 Township 20S Range 37E NMPM LEA COUNTY 10. Elevation (Show whether DF, RKB, RT,GR, etc.) 3565' GL 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB COHER: PERF, STIMULATE UPPER ZONE 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-30-99: MIRU. BLED DN CSG, NDWH, NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG. TAG@ 3308', START FOAM UNIT. C/O FRAC SAND TO CIBP@ 3450. 1-05-00: TIH W/BIT TO 3450', NO FILL. TIH W/CSG GUN, PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG. SET RBP@ 3200'. TEST TO 1500-0K, PULL PKR TO 2850'. 1-06-00: ACIDIZE 3025-3145 W/3250 GALS 15% NEFE HCL. RU SWAB, FL @ 2200'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-1-10-00: RD SWAB. LOWER RET TOOL ON TBG TO RBP@ 3200'. REL RRP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-10: TIH W/PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 5000-0K. CHECK PUMP ACTION-OK, RIG DOWN.		EXACO EXPLORATION & PRODUC	TION INC.	8. Well No. 12
4. Well Location Unit Letter F: 2269 Feet From The NORTH Line and 2266 Feet From The WEST Line Section 6 Township 20S Range 37E NMPM LEA COUNTY 10. Elevation (Show whether DF, RKB, RT,GR, etc.) 3565' GL 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT PULL OR ALTER CASING OTHER: PERF, STIMULATE UPPER ZONE 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-30-99: MIRU. BLED DN CSG, NDWH, NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG, TAG @ 3308' START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450', NO FILL. TIH W/CSG GUN, PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG, SET RBP @ 3200'. TEST TO 1500-OK. PULL PKR TO 2850'. 1-07-00: FL @ SN, REL PKR, TIH W/RETR TOOL, SN, TBG TO 3177', FL @ 2600', END FL @ 3000'. 1-10-00: RD SWAB, LOWER RET TOOL ON TBG TO RBP @ 3200'. REL RBP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED, NDBOP, NUWH. 1-11-100: TIH W/PBIMP, SNKR BARS, RDS, LOAD & TEST TBG TO 5004-OK. CHECK PUMP ACTION-OK, RIG DOWN.	3. Address of Operator 20	05 E. Bender, HOBBS, NM 88240		1
Section 6 Township 20S Range 37E NMPM LEA COUNTY 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3565' GL 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-30-99: MIRU. BLED DN CSG. NDWH. NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG. TAG @ 3308'. START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450'. NO FILL. TIH W/CSG GUN. PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG. SET RBP @ 3200'. TEST TO 1500-OK. PULL PKR TO 2850'. 1-06-00: ACIDIZE 3025-3145 W3250 GALS 159'N NEFE HCL. RU SWAB. FL @ 2200'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-10-00: RD SWAB. LOWER RET TOOL ON TBG TO RBP @ 300'. REL REP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-00: TIH W/PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 500#-OK. CHECK PUMP ACTION-OK, RIG DOWN.	4. Well Location			
10. Elevation (Show whether DF, RKB, RT,GR, etc.) 3565' GL 11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12.30-99: MIRU. BLED DN CSG, NDWH, NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG. TAG @ 3308'. START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450'. NO FILL. TIH W/CSG GUN. PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG. SET RBP @ 3200'. TEST TO 1500-0K, PULL PKR TO 2850'. 1-06-00: ACIDIZE 3025-3145 W/3250 GALS 15% NEFE HCL. RU SWAB. FL @ 2200'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-10-00: RD SWAB. LOWER RET TOOL ON TBG TO RBP @ 3200'. REPP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-00: TIH W/PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 500#-OK. CHECK PUMP ACTION-OK. RIG DOWN.	Unit Letter F	F : 2269 Feet From T	he NORTH Line and 2266	Feet From The WEST Line
11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPERATION PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-30-99: MIRU, BLED DN CSG, NDWH, NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG, TAG @ 3308', START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450'. NO FILL. TIH W/CSG GUN, PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG. SET RBP @ 3200'. TEST TO 1500-OK, PULL PKR TO 2850'. 1-06-00: ACIDIZE 3025-3145 W/3250 GALS 15% NEFE HCL. RU SWAB. FL @ 2200'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-10-00: RD SWAB. LOWER RET TOOL ON TBG TO RBP @ 3200' REL RBP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-00: TIH W/PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 500#-OK. CHECK PUMP ACTION-OK, RIG DOWN.	Section 6	Township 20S	Range 37E NM	MPM LEA COUNTY
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT CASING TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT CASING TEST AND CEMENT JOB OTHER: PULL OR ALTER CASING THERE CASING THERE PERF, STIMULATE UPPER ZONE 12- Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-30-99: MIRU. BLED DN CSG. NDWH. NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG. TAG @ 3308'. START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450'. NO FILL. TIH W/CSG GUN. PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG. SET RBP @ 3200'. TEST TO 1500-OK. PULL PKR TO 2850'. 1-06-00: ACIDIZE 3025-3145 W/3250 GALS 15% NEFE HCL. RU SWAB. FL @ 2200'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-10-00: RD SWAB. LOWER RET TOOL ON TBG TO RBP @ 3200'. REL RBP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-00: TIH W/PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 500'+OK. CHECK PUMP ACTION-OK. RIG DOWN.		10. Elevation (Show wheth	ner DF, RKB, RT,GR, etc.) 3565' GL	
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT DULL OR ALTER CASING OTHER: PERF, STIMULATE UPPER ZONE OTHER: PERF, STIMULATE UPPER ZONE OTHER: PERF, STIMULATE UPPER ZONE Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-30-99: MIRU. BLED DN CSG. NDWH. NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG. TAG @ 3308'. START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450'. NO FILL. TIH W/CSG GUN. PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG. SET RBP @ 3200'. TEST TO 1500-OK. PULL PKR TO 2850'. 1-06-00: ACIDIZE 3025-3145 W/3250 GALS 15% NEFE HCL. RU SWAB. FL @ 2200'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-100: RD SWAB. LOWER RET TOOL ON TBG TO RBP @ 3200'. REL RBP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-00: TIH W/PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 500#-OK. CHECK PUMP ACTION-OK, RIG DOWN.	11.	Check Appropriate Box to Ind	icate Nature of Notice, Report	, or Other Data
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT DULL OR ALTER CASING OTHER: PERF, STIMULATE UPPER ZONE OTHER: PERF, STIMULATE UPPER ZONE OTHER: PERF, STIMULATE UPPER ZONE Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-30-99: MIRU. BLED DN CSG. NDWH. NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG. TAG @ 3308'. START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450'. NO FILL. TIH W/CSG GUN. PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG. SET RBP @ 3200'. TEST TO 1500-OK. PULL PKR TO 2850'. 1-06-00: ACIDIZE 3025-3145 W/3250 GALS 15% NEFE HCL. RU SWAB. FL @ 2200'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-100: RD SWAB. LOWER RET TOOL ON TBG TO RBP @ 3200'. REL RBP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-00: TIH W/PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 500#-OK. CHECK PUMP ACTION-OK, RIG DOWN.	NOTICE OF IN	TENTION TO	SI	IBSEQUENT REPORT OF:
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPERATION PLUG AND ABANDONMENT PULL OR ALTER CASING OTHER: PERF, STIMULATE UPPER ZONE OTHER: PERF, STIMULATE UPPER ZONE OTHER: PERF, STIMULATE UPPER ZONE PERF,				
PULL OR ALTER CASING OTHER: CASING TEST AND CEMENT JOB OTHER: PERF, STIMULATE UPPER ZONE 12-30-99: MIRU. BLED DN CSG. NDWH. NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG. TAG @ 3308'. START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450'. NO FILL. TIH W/CSG GUN. PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG. SET RBP @ 3200'. TEST TO 1500-OK. PULL PKR TO 2850'. 1-06-00: ACIDIZE 3025-3145 W/3250 GALS 15% NEFE HCL. RU SWAB. FL @ 2200'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-10-00: RD SWAB. LOWER RET TOOL ON TBG TO RBP @ 3200'. REL RBP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-00: TIH W/PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 500#-OK. CHECK PUMP ACTION-OK, RIG DOWN.				
OTHER: Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-30-99: MIRU. BLED DN CSG. NDWH. NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG. TAG @ 3308'. START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450'. NO FILL. TIH W/CSG GUN. PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG. SET RBP @ 3200'. TEST TO 1500-OK. PULL PKR TO 2850'. 1-06-00: ACIDIZE 3025-3145 W/3250 GALS 15% NEFE HCL. RU SWAB. FL @ 2200'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-10-00: RD SWAB. LOWER RET TOOL ON TBG TO RBP @ 3200'. REL RBP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-00: TIH W/PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 500#-OK. CHECK PUMP ACTION-OK. RIG DOWN.				
 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. 12-30-99: MIRU. BLED DN CSG. NDWH. NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG. TAG @ 3308'. START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450'. NO FILL. TIH W/CSG GUN. PERF CSG IN YATES FORM 3025-30, 305/5-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG. SET RBP @ 3200'. TEST TO 1500-OK. PULL PKR TO 2850'. 1-06-00: ACIDIZE 3025-3145 W/3250 GALS 15% NEFE HCL. RU SWAB. FL @ 2200'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-10-00: RD SWAB. LOWER RET TOOL ON TBG TO RBP @ 3200'. REL RBP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-00: TIH W/PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 500#-OK. CHECK PUMP ACTION-OK. RIG DOWN. 				
proposed work) SEE RULE 1103. 12-30-99: MIRU. BLED DN CSG. NDWH. NUBOP. 1-03-00: UNLOAD, RACK, TALLY 2 7/8" WS. TIH W/BIT, DC'S & TBG. 1-04-00: PU TBG. TAG @ 3308'. START FOAM UNIT. C/O FRAC SAND TO CIBP @ 3450. 1-05-00: TIH W/BIT TO 3450'. NO FILL. TIH W/CSG GUN. PERF CSG IN YATES FORM 3025-30, 3055-65, 3110-15, 3135-45. TIH W/RBP & PKR, & TBG. SET RBP @ 3200'. TEST TO 1500-OK. PULL PKR TO 2850'. 1-06-00: ACIDIZE 3025-3145 W/3250 GALS 15% NEFE HCL. RU SWAB. FL @ 2200'. 1-07-00: FL @ SN. REL PKR. TIH W/RETR TOOL, SN, TBG TO 3177'. FL @ 2600', END FL @ 3000'. 1-10-00: RD SWAB. LOWER RET TOOL ON TBG TO RBP @ 3200'. REL RBP. TIH W/SN, TBG, SETN SN @ 3339'-OPEN ENDED. NDBOP. NUWH. 1-11-00: TIH W/PUMP, SNKR BARS, RDS. LOAD & TEST TBG TO 500#-OK. CHECK PUMP ACTION-OK. RIG DOWN.	OTHER:		COTHER:	TENT, STINIOLATE OF TENZONE
	proposed work) SEE RULE 12-30-99: MIRU. BLED DN C: 1-03-00: UNLOAD, RACK, TA 1-04-00: PU TBG. TAG @ 33: 1-05-00: TIH W/BIT TO 3450'. TBG. SET RBP @ 3200'. TES' 1-06-00: ACIDIZE 3025-3145 1-07-00: FL @ SN. REL PKR. 1-10-00: RD SWAB. LOWER 1-11-00: TIH W/PUMP, SNKR	E 1103. SG. NDWH. NUBOP. ALLY 2 7/8" WS. TIH W/BIT, DC'S & 108'. START FOAM UNIT. C/O FRACE. NO FILL. TIH W/CSG GUN. PERFET TO 1500-OK. PULL PKR TO 2850. W/3250 GALS 15% NEFE HCL. RU. TIH W/RETR TOOL, SN, TBG TO RET TOOL ON TBG TO RBP @ 320. RET TOOL ON TBG TO RBP @ 320.	TBG. C SAND TO CIBP @ 3450. CSG IN YATES FORM 3025-30, 305 '. SWAB. FL @ 2200'. 3177'. FL @ 2600', END FL @ 3000'. 00'. REL RBP. TIH W/SN, TBG, SETI	55-65, 3110-15, 3135-45. TIH W/RBP & PKR, & N SN @ 3339'-OPEN ENDED. NDBOP. NUWF

I hereby certify that the information above is true and SIGNATURE	DATE 4/12/00	
TYPE OR PRINT NAME	J. Denise Leake	Telephone No. 397-0405
(This space for State Use)		
APPROVED	and the second s	. n . 9 1 2000
BUNDITIONS OF APPROVAL, IE AN	CTITLE	DeSoto/Nichols 12-93 ver 1.0