

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

OIL CONSERVATION DIVISION
 P. O. BOX 2088
 SANTA FE, NEW MEXICO 87501

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL GAS WELL OTHER: water injection

Name of Operator
 AMOCO PRODUCTION COMPANY

Address of Operator
 P. O. Box 68, Hobbs, NM 88240

Location of Well
 UNIT LETTER G 2310 FEET FROM THE North 1650 FEET FROM
 THE East 4 LINE, SECTION 19-S TOWNSHIP 38-E RANGE 4 NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)
 3623 KB

5a. Indicate Type of Lease
 State Fee
 5. State Oil & Gas Lease No.

7. Unit Agreement Name

8. Farm or Lease Name
 South Hobbs (GSA) Uni

9. Well No.
 33

10. Field and Pool, or Wildcat
 Hobbs GSA

12. County
 Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
 NOTICE OF INTENTION TO:

- FORM REMEDIAL WORK
- PERMANENTLY ABANDON
- OR ALTER CASING
- OTHER _____
- PLUG AND ABANDON
- CHANGE PLANS

SUBSEQUENT REPORT OF:

- REMEDIAL WORK
- COMMENCE DRILLING OPNS.
- CASING TEST AND CEMENT JOB
- OTHER _____
- ALTERING CASING
- PLUG AND ABANDONMENT

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed) SEC RULE 1503.

MIRU-SU 10-17-86. Remove tree and install BOP. Release packer and POH w/tubing. Run wireline and tag at 4222 ft. Run bailer and dump 1 sack sand, tag at 4219 ft. Run bailer and dump 1 sack sand, tag at 4211 ft. Run bailer and dump Calseal and wait 1 hr. Tag at 4211 ft. Run bailer and dump calseal and wait 1 hr and tag at 4207 ft. Run bailer dump calseal. Run wireline and tag at 4197 ft. POH 4071-4178 4 SPF. Run Howco 4-1/2" PPI packer and standing valve in place. 2-3/8 seating nipple, 2-3/8 workstring to 3943 ft. Test packer, held ok. Release and lower packer to 4178 ft and pump 500 gallons 15% NE HCl and flush w/16 bbl water. Drop RFC valve and acidize perfs 4178-4071 ft 100 cal 15% NE HCl per 1 ft. Fish RFC valve and flush tubing and casing and 115 bbl water. POH w/workstring and packer. RIH w/4-1/2" Lok-set and 2-3/8 seating nipple and 2-3/8 tubing to 3947'. Remove BOP and install tree. Displace casing and 50 bbl packer fluid and set packer. Pressure test 500 psi 15 min, and ok. RDMO-SU 10-22-86.

PPWO: 1700 BWIPD x 125 PSI
 PAWO: 1870 BWIPD x 130 PSI

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

ORIGINAL SIGNED BY JERRY SEXTON
 DISTRICT SUPERVISOR

TITLE Admin Analyst

DATE 10-31-86

ONE OF APPROVAL, IF ANY

TITLE

DATE