

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-70

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease
State Fee

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT..." (FORM C-101) FOR SUCH PROPOSALS.)

6. Name of Operator
AMOCO PRODUCTION COMPANY
Address of Operator
P. O. Box 68, Hobbs, NM 88240

7. Unit Agreement Name

8. Farm or Lease Name
South Hobbs (GSA) Unit

9. Well No.
32

10. Field and Pool, or wildcat
Hobbs (GSA)

UNIT LETTER F 1980 FEET FROM THE North 1980 FEET FROM
THE West 4 LINE, SECTION 19-S TOWNSHIP 38-E RANGE 4 NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)
3614' KB

12. County
Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input checked="" type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
WELL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

MISU 1-7-87. Install BOP. Release packer. Run 3-1/2" bailer and tag at 4098. POH. RIH with 4-1/2" bit to 4237. POH. Run Bailer and tag at 4232. Dump 2 sx sand and pull up. Tag at 4220. POH and RIH bailer to 4220. Dump 2 sx sand. Tag 4211 and POH. R bailer to 4211 and dump 1 sx Calseal. Tag at 4211. Run bailer to 4211 and dump 1 sx Calseal. POH and RIH bailer and tag at 4190. POH and Run 4-1/8" bit and CO bridge at 4190. Fell through and tag at 4211. Run bailer and tag at 4204 and dump 1 sx Calseal. Tag at 4188. POH 4-1/8" bit and co Calseal from 4193-4201 and fell through and tag at 4210. Run bailer to 4204 and dump 1 sx Calseal. PU and tag at 4195. Run Howco 5" PPI to 4000. Test packer to 4000# and OK. Drop RFC valve. Run tubing to 4185. Acid perfs 4185-4078 with 140 gals per 2 ft spacing and flush with 25 BW. Fish RFC valve and RIH with 5" Lok-set packer and 2-3/8" seating nipple and 2-3/8" plastic coated tubing to 3992. Pump 109 bbls packer fluid. Set packer. Pump 10 bbls packer fluid. Pressure test 500#. MOSU 1-13-87.

IPWO: 1294 BWPD and TP 130#.
IAWO: 2303 BWPD and TP 130#.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

by S. Brownlee TITLE Administrative Analyst DATE 1-26-87

APPROVED BY ORIGINAL SIGNED BY JERRY SEXTON TITLE DISTRICT I SUPERVISOR DATE JAN 27 1987

CONDITIONS OF APPROVAL, IF ANY: