

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs NM 88241-1980

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-10230
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	THOMAS LONG
8. Well No.	5
9. Pool name or Wildcat	BLINEBRY (PRO GAS) (CONSOLIDATED)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	
2. Name of Operator Shell Western E&P, Inc.	
3. Address of Operator P.O. BOX 576, HOUSTON, TX 77001 S.A. GALIK - 5239 WCK	
4. Well Location Unit Letter <u>N</u> : <u>919</u> Feet From The <u>SOUTH</u> Line and <u>1721</u> Feet From The <u>WEST</u> Line Section <u>11</u> Township <u>22S</u> Range <u>37E</u> NMPM <u>WIBAU</u> County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3361' DF	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOB ☐
OTHER: OAP, AT ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2-22 To 3-7-95

POOH w/prod equip. Mld thru PKR @ 5696. PKR fell free. Chase PKR to 6080. Did not rec PKR. Ran CNL/GR from 6100 (TD) to Surf. RIH w/spear, rec only 8" of PKR. Set RBP at @ 5890. Perf Blinebry 5610-5730 (1 JSPF). Reset RBP @ 5760 and PKR @ 5696. AT 5704-30 w/1800 gal 20% HCL. Reset RBP @ 5696 and PKR @ 5640. AT 5644-90 w/3150 gal 20% HCL. Reset RBP @ 5640 and PKR @ 5600. AT 5610-36 w/1800 gal 20% HCL. Reset RBP @ 5600 and PKR @ 5500. AT 5510-90 w/2700 gal 20% HCL. Reset RBP @ 5500 and PKR @ 5380. AT 5405-90 w/1500 gal 20% HCL. Reset RBP @ 5855 and PKR @ 5600. SWAB Tubb zone. RTP.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Shirley Galik TITLE Mgr. Reg. & Permitting DATE 5-3-95
TYPE OR PRINT NAME for: G. S. Nady TELEPHONE NO. 713/544-4219

(This space for State Use)

ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: _____

MAY 11 1995