

Form 3160-5  
(July 1989)  
(Formerly 9-331)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

CONTACT RECEIVING  
OFFICE FOR NUMBER  
OF COPIES REQUIRED  
(Other instructions on reverse  
side)

BLM Roswell District  
Modified Form No.  
NM060-3160-4

5. LEASE DESIGNATION AND SERIAL NO.  
**LC-060825-A**

**SUNDRY NOTICES AND REPORTS ON WELLS**

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT-" for such proposals.)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

1. OIL WELL  GAS WELL  OTHER

7. UNIT AGREEMENT NAME

2. NAME OF OPERATOR  
**Meridian Oil Inc.**

8. FARM OR LEASE NAME  
**Olsen-Blinebry**

3. ADDRESS OF OPERATOR  
**P.O. Box 51810, Midland, TX 79710-1810**

3a. AREA CODE & PHONE NO.  
**915-686-5600**

9. WELL NO.  
**1**

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\*  
See also space 17 below.)  
At surface  
**1650' FSL & 990' FWL**

10. FIELD AND POOL, OR WILDCAT  
**Jalmat (T, Y, SR)**

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA  
**Sec. 29, T23S, R37E**

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)  
**3323' DF**

12. COUNTY OR PARISH  
**Lea**

13. STATE  
**NM**

**Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data**

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF   
FRACTURE TREAT   
SHOOT OR ACIDIZE   
REPAIR WELL   
(Other)

PULL OR ALTER CASING   
MULTIPLE COMPLETE   
ABANDON\*   
CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF   
FRACTURE TREATMENT   
SHOOTING OR ACIDIZING   
(Other)

REPAIRING WELL   
ALTERING CASING   
ABANDONMENT\*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

**Meridian Oil Inc. proposes to plug and abandon this well following the attached procedure.**

18. I hereby certify that the foregoing is true and correct

SIGNED *Cornie Malik*

TITLE Regulatory Analyst

DATE 16 May 1991

(This space for Federal or State office use)

APPROVED BY *[Signature]*

TITLE *[Signature]*

DATE 6-14-91

CONDITIONS OF APPROVAL, IF ANY:

**\*See Instructions on Reverse Side**

Olson Blinebry No. 1  
Jalmat Field  
Lea County, New Mexico

Plug and Abandonment Procedure

1. Notify BLM prior to starting work:  
Hobbs: Jack Johnson - 393-3612
2. RIH and sting into cement retainer. Pump 200 sxs class C cement through retainer. Sting out of retainer and cap retainer with 5 sxs cement. POOH with tubing. *at 2450'* *5' / sack*  
*50' (10 sxs)*
3. RIH with perforating gun and shoot 4 squeeze holes at top of salt (2060'). RIH with cement retainer and set at  $\pm 2010'$ . Squeeze top of salt with 30 sxs of Class C cement with 2% CaCl<sub>2</sub> (100' plug plus 100% excess). Sting out to retainer and spot 5 sxs cement on retainer. *50' (10 sxs)*
4. Pull up to 375' and set 100' plug across surface casing shoe depth. Use 20 sxs Class C with 2% CaCl<sub>2</sub>. Pull up to *30'* and set surface plug (*5* sxs). *TAG PLUG*  
*10*
5. Cut off casing and install P&A marker. Clear location.
6. MUD OF AT LEAST 9.0 PPg SHALL BE PLACED BETWEEN PLUGS.

Approved \_\_\_\_\_  
T. J. Harrington


Date \_\_\_\_\_

Authority Given To Plug Well \_\_\_\_\_  
J. S. Buchanan

MERIDIAN OIL  
 OLSON BLINEBRY NO. 1  
 JALMAT FIELD  
 LEA COUNTY, NEW MEXICO

KLM 6/10/91

CURRENT CONDITION (AFTER P&A)

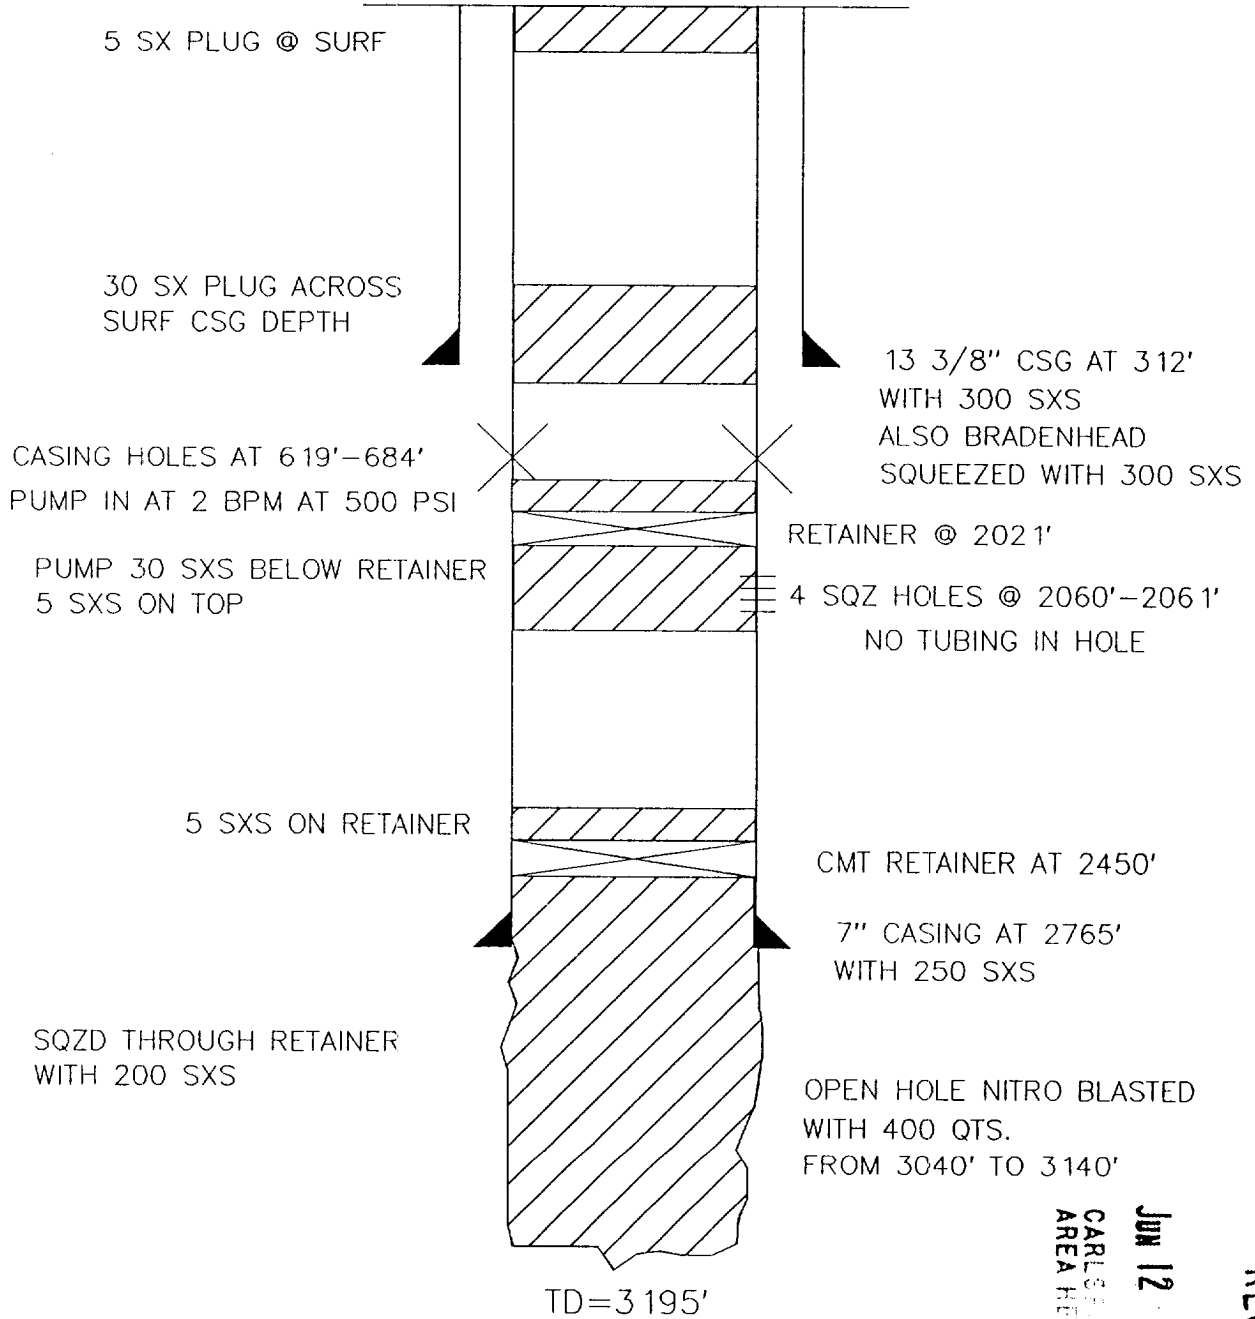

JUN 12 11 22 AM '91  
 CARLOS... SOURCE  
 AREA HEADQUARTERS

RECEIVED