

LEWIS BURLESON, INC
WELLBORE DIAGRAM

WELL NAME Stevens A-34 #3

8 5/8 SURFACE @ 419
SACKS & TYPE 250 sz Circ

Top Soil 1450

Plugging Procedure

DATE NOTES

- 1) Install Bop
- 2) Set CIBPE, 2950 Perfor 2900
SQUEEZE 100' Plug in and out 2850-2950
- 3) Circ Hole with Mud
- 4) Place Plug 1400-1500
in casing
- 5) Perfor 430 Circulate Cement
in and out to surface
- 6) Install Marker, Clean and
restore location

TOC @
2900
by survey

Base of
soil 2070

Top
of
3'05

Perfor
3393-
3678

5 1/2 PRODUCTION @ 3700
SACKS & TYPE 300 sz