

10. Pull 475,000#. ND movement. RU WL. Reshoot @ 5254'. Pipe free. Retacked 9 5/8" slips. Jacked WH. Slips out of WH. Pipe pulled free @ 249,000#. SD.
11. RU csg tongs. Jts would not break out. Had to use a cutting torch due to galled threads. LD 11 jts. Torched 6. Backed out 5. Galled threads on 3 of the 5.
12. Pulled & LD 71 jts 9 5/8" csg. BAdked out 50%. Cut out 50%.
13. Fnsh'd POH w/csg. RD csg tools. RIH w/tbg to 5355'. Pmpd 250 bbls brine gel. Did not load. Spot 100' cmt plug w/2% CaCl. POH w/tbg. SD.
14. RIH w/tbg. Tag cmt plug @ 5300'. Too low. Est circ. Set 150 sx cmt plug @ 5300'. WOC 6 hrs. RIH w/tbg. Tag cmt plug @ 5105'. Pull tbg to 1350'. Spot 150 sx Cl "C" cmt plug. Pull tbg to 638'. Spot 100 sx Cl "C". POH w/tbg. SD.
15. Set 50' cmt plug @ surf. Cut off WH. Weld on plate & dry hole marker. RD csg unit. Well plugged & abandoned 8-10-86 per NMOCD & BLM instructions.