DA&S OIL WELL SERVICING

INCORPORATED

Lewis B. Burleson, Inc. Nancy Federal No. 1

- Move in, rig up, pull and lay down rods, put on 9/7/94 BOP, pull and tally tubing, run bit and scraper, shut down.
- Pull bit and scraper, run cement retainer, set 9/8/94 at 2,300', circulate mud, pump 50 sacks under retainer, 10 sacks on top, pull tubing out, shut down.
- Perforate well at 970', spot 25 sacks outside 9/12/94 casing, 25 sacks inside, wait on cement, try to tag cement, no plug, pump 40 sacks outside, 40 sacks inside, shut down.
- Tag cement at 184' from surface, perforate well 9/13/94 at 180', circulate cement to surface inside and outside $5\frac{1}{2}$ casing, cut off wellhead, put in marker, rig down, move off.

Class "C" Cement Mud - 25 lb. Salt Gel per bbl.

OK by Andy Cortez B.L.M.

P.O. BOX 2545 • HOBBS, NEW MEXICO 88241 505-392-6591