Submit 1 Copy To Appropriate Di	strict Office	State of No	ew Mexic	co			т	Form C	1 102
								ed July 18	
1625 N. French Dr., Hobbs, NM 88	N. French Dr., Hobbs, NM 88240				WELL API NO.				
<u>District II</u> - (575) 748-1283 811 S. First St., Artesia, NM 8821	OIL	CONSERVA	TION D	IVISION	5 Indicate	e Type of Le	5.39067 ease		
<u>Disrtict III - (505) 334-6178</u>		1220 South S	t Francis	Dr		ATE 🔽		FEE	
1000 Rio Brazos Rd. Aztec, NM 8	37410							FEE	
<u>District IV -</u> (505) 476-3460 1220 S. St. Francis Dr., Santa Fe,	NM 97505	Santa Fe, I	NM 8750	5	6. State O	oil & Gas Lea			
	DRY NOTICES AND REPO	DTC ON WEL	IC		7 Lagge N	Name or Uni	·2287	ant Mana	
	PROPOSALS TO DRILL OR DEE			DIFFERENT			Ū		
*	ON FOR PERMIT" (FORM C-101)			TERES (1		Monument	G/SA Ut	i. (3027	08)
1. Type of Well: Oil Well	Gas Well Other				8. Well N		374		
2. Name of Operator	Gus Weil Guier				9. OGRIE		J1 4		
Apache Corporation						873			
3. Address of Operator					10. Pool Name or Wildcat Eunice Monument; G/SA (23000)				
	ns Airpark Lane, Ste. 300	00, Midland, 1	TX 79705		Eunio	ce Monume	ent; G/S/	A (2300	0)
4. Well Location Unit Letter	Н : 1330	feet from the	N	line and	1185	feet from t	E	line	
Section	25 Township		Range	36E	NMPM		County		EA
50000	11. Elevation (1 (1/11 1/1		County		
	· ·	36	658' GL						
	12. Check Appropriate E	ox To Indicat	te Nature	of Notice, Re	eport, or O	ther Data			
NOTIC	E OF INTENTION TO:		l	CIID	SECHENI	Γ REPORT	OE.		
PERFORM REMEDIAL WC		ANDON \	REMEDIA		JEQUEIN	_	IG CASIN	G [٦
TEMPORARILY ABANDON	_			ICE DRILLING	OPNS.	PANDA		Ŭ	าี
PULL OR ALTER CASING	MULTIPLE CO	MPL		CEMENT JOB					
DOWNHOLE COMMINGLE									
CLOSED-LOOP SYSTEM								Г	_
OTHER:			OTHER:		1 -:	:	المادات المادات		
	or completed operations. (•	_					-	
• • • •	osed work.) SEE RULE 1	9.15./.14 NM	AC. For	Multiple Con	npietions:	Attach we	libore dia	agram c	r
proposed completion or i	recompletion.								
Apache Corporation p	proposes to P&A the abo	ve mentioned	l well by	the attached	procedur	e. A close	d loop s	vstem	will
	all fluids from this wellb		-		-		-	,	
4" diamete	er 4' tall Above Ground	Marker		SEE	ATTACH	ED COND	ITIONS		
i didiliote	71 - Tan 7150 VO Ground	War No.			APPROVA				
Spud Date:			Rig Rele	ace Date:					
Spud Date.			Kig Kele	asc Date.		,			
I hereby certify that the i	nformation above is true a	nd complete to	o the best	of my knowl	edge and l	belief.			
Thoroby cortify that the I		na complete t	o the sest	or my miowi	eage and				
SIGNATURE	Guinn Burks	TITLE	Sr Re	clamation F	oreman	DATE	1/	27/21	
5.01111 OILL	90000000000000			- Ciamation I			17.	/	
Type or print name	Guinn Burks	F-mail add	guinn hi	urks@apache	corn com	PHONE:	122.5	556-914	13
For State Use Only	Guiiii Duika	E-man add.	guiiii.bt	urno w apacille	corp.com		432-0	750-314	13
- 	N 14			a			011-15:		
APPROVED BY:	Kerry Fortner	TITLE	Compli	ance Officer	А	DATE	2/15/21		
Conditions of Approval (if	any):								


Apache NEL POPE NES


 LEASE NAME
 North Monument G/SA Unit

 WELL #
 #374

 API #
 30.025.39067

 COUNTY
 LEA, NM

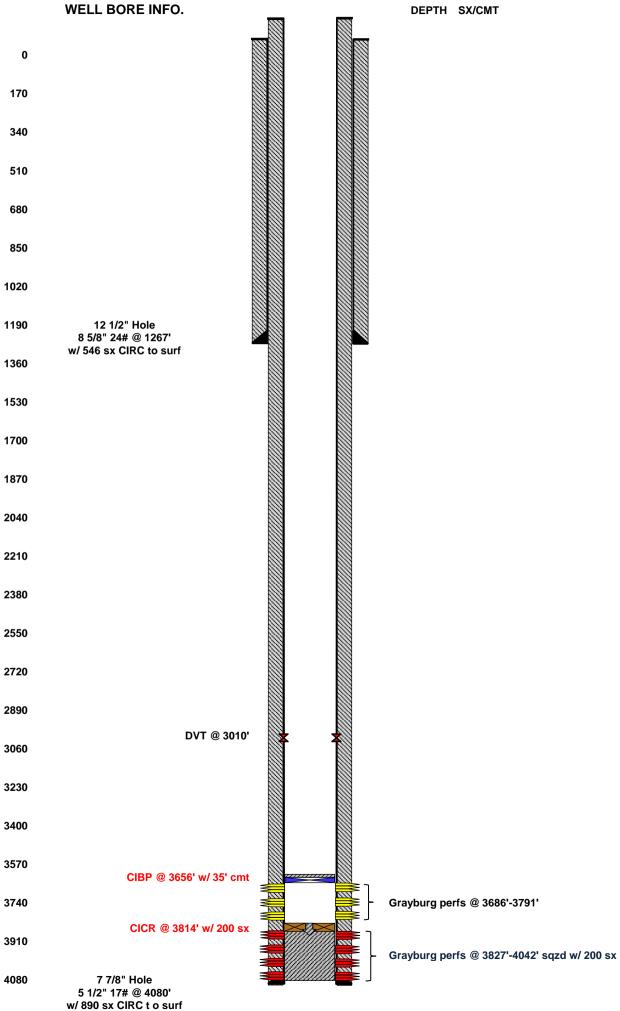

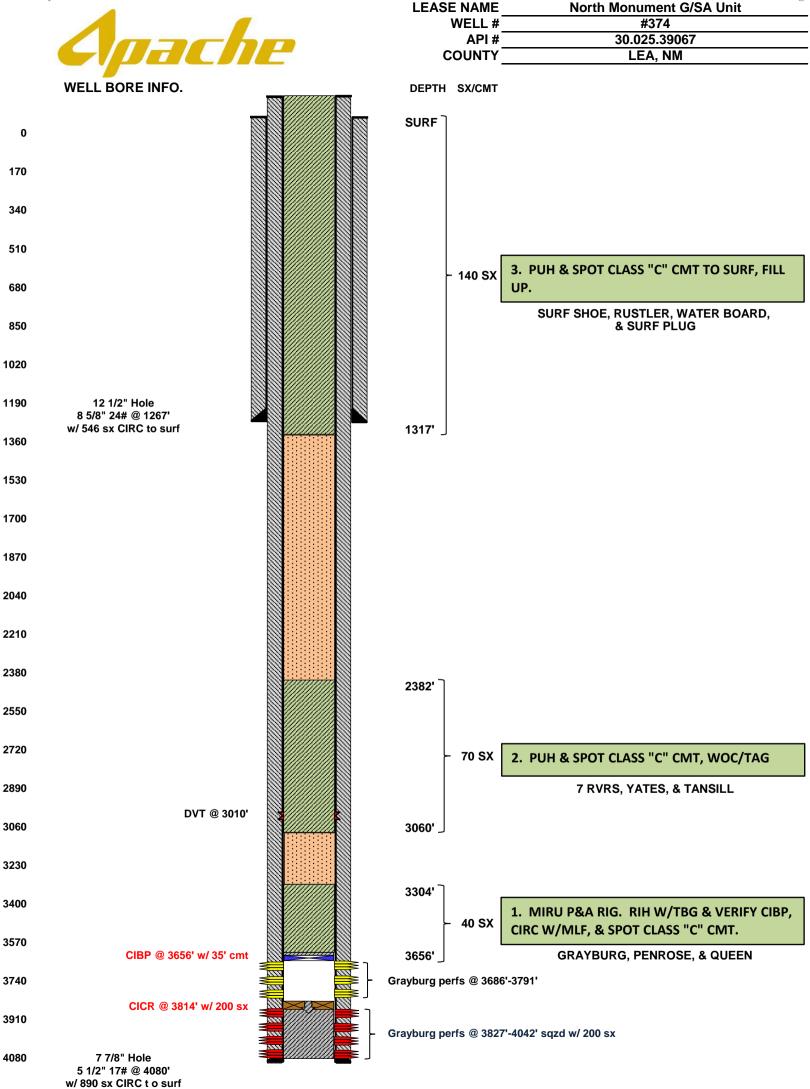

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III
1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 16829

CONDITIONS OF APPROVAL

Operator	:		OGRID:	Action Number:	Action Type:
	APACHE CORPORATION	303 Veterans Airpark Ln	873	16829	C-103F
#1000	Midland, TX79705				

OCD Reviewer	Condition
kfortner	See attached Conditions of Approval