	١
4	
	١
0	
-	١
0	
0	
-	
4	
-	
-	
	١
-	
	١
- 0	١
- 2	
5	
	۰
-5	
~ C/~	
\sim	١
-	
	١
_	
_	١
-	
-	
~	١
0	
- 2	
	۱
- 9	
~ ~	
0	١
~	
-	

Submit 1 Copy To Appropriate District Office State of New Mexico	Form C-103
District 1 – (575) 393-6161 Energy, Minerals and Natural Resource 1625 N. French Dr., Hobbs, NM 88240	ees Revised July 18, 2013 WELL API NO.
District II - (575) 748-1283	00.005.00700
811 S. First St., Artesia, NM 88210 OTL CONSERVATION DIVISION <u>District III</u> = (505) 334-6178 1220 South St. Francis Dr.	5. Indicate Type of Lease
1000 Rio Brazos Rd , Aztec, NM 87410	STATE FEE X 6. State Oil & Gas Lease No.
District IV = (505) 476-3460 Santa Fe, INIVI 8 / 505 1220 S. St. Francis Dr., Santa Fe, NM 87505	o. State Off & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	
DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	Grizzell (231017)
1. Type of Well: Oil Well X Gas Well Other	8. Well Number 10
2. Name of Operator Apache Corporation	9. OGRID Number 873
3. Address of Operator	10. Pool name or Wildcat
303 Veterans Airpark Lane, Ste. 3000, Midland, TX 79705 4. Well Location	Eunice, San Andres, SW (24180)
Unit Letter : 1940 feet from the S line ar	nd 380 feet from the E line
Section 8 Township 22S Range 37	
11. Elevation (Show whether DR, RKB, RT, G	
3406' GL	
12. Check Appropriate Box to Indicate Nature of No.	otica Panout on Other Data
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL	SUBSEQUENT REPORT OF:
	. WORK ☐ ALTERING CASING ☐ DRILLING OPNS. ☐ P AND A ☑
	EMENT JOB PNR
DOWNHOLE COMMINGLE	PNR
CLOSED-LOOP SYSTEM	100
13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip	uils, and give pertinent dates, including estimated dat ple Completions: Attach wellbore diagram of
OTHER: OTHER: OTHER: OTHER: OTHER:	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. class C cmt @ 300. Circ 110 sx
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 to 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Part of the proposed	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. class C cmt @ 300. Circ 110 sx
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 v. 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Part of the proposed of the proposed work).	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. class C cmt @ 300. Circ 110 sx
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 to 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Part Carter of the complete of the co	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. class C cmt @ 300. Circ 110 sx
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 to 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Part of the proposed	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. class C cmt @ 300. Circ 110 sx
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 v. 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Po Cut off wellhead & remove. Install dry hole marker. P&A complete.	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. D. Perf @ 300. Circ 110 sx &A equipment clean location.
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 v. 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Po Cut off wellhead & remove. Install dry hole marker. P&A complete.	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. D. Perf @ 300. Circ 110 sx &A equipment clean location.
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 v. 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Po Cut off wellhead & remove. Install dry hole marker. P&A complete.	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. D. Perf @ 300. Circ 110 sx &A equipment clean location.
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 v. 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Po Cut off wellhead & remove. Install dry hole marker. P&A complete.	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. D. Perf @ 300. Circ 110 sx &A equipment clean location.
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 v. 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Po Cut off wellhead & remove. Install dry hole marker. P&A complete.	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. D. Perf @ 300. Circ 110 sx &A equipment clean location.
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 v. 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Po Cut off wellhead & remove. Install dry hole marker. P&A complete.	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. D. Perf @ 300. Circ 110 sx &A equipment clean location.
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 v. 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Po Cut off wellhead & remove. Install dry hole marker. P&A complete.	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. D. Perf @ 300. Circ 110 sx &A equipment clean location.
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 v. 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Po Cut off wellhead & remove. Install dry hole marker. P&A complete.	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. D. Perf @ 300. Circ 110 sx &A equipment clean location.
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710. Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 v. 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 1350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Po Cut off wellhead & remove. Install dry hole marker. P&A complete.	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. D. Perf @ 300. Circ 110 sx &A equipment clean location.
DTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent deta of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multip proposed completion or recompletion. 1. 02/10/21 Move in P&A equipment. Tag CIBP @ 3710 Circ 64 bbls MLF pretest 5 1/2 c Spot 25 sx class C cmt @ 3710-3463. Spot 25 sx class C cmt @ 2511-2264 2. 02/11/21 Tag TOC @ 2270. Perf @ 1300. Pressured up. Notify OCD ok to spot 25 sx class C cmt @ 0350-1100 w/2% calcium WOC. Tag TOC @ 1109 class C cmt down 5 1/2 csg out @ perf ann up 5 1/2 x 8 5/8 to surface. RD Pocular off wellhead & remove. Install dry hole marker. P&A complete. Pagent TITLE Agent Title Agent Description of the best of my known 5 tate Use Only Dimmy Bagley E-mail address: sunsetwell or State Use Only	ple Completions: Attach wellbore diagram of csg 500 psi 15 min ok. w/2% calcium. class C cmt @ 1350-1100. D. Perf @ 300. Circ 110 sx &A equipment clean location.

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III
1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 19467

COMMENTS

Operator	:		OGRID:	Action Number:	Action Type:
	APACHE CORPORATION	303 Veterans Airpark Ln	873	19467	C-103P
#1000	Midland, TX79705				

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM	03/04/2021

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III
1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 19467

CONDITIONS OF APPROVAL

Operator	:		OGRID:	Action Number:	Action Type:
	APACHE CORPORATION	303 Veterans Airpark Ln	873	19467	C-103P
#1000	Midland, TX79705				

OCD Reviewer	Condition
kfortner	None