
	4 <i>M</i>
_	8:13:01
	5/5/2021
-	Imaging:
	ased to
	Release

Page 1 of 9	Submit 1 Copy To Appropriate District Office	State of New Mexic	o	Form C-103		
e 1	District I - (575) 393-6161	Energy, Minerals and Natural	Resources	Revised July 18, 2013		
ag	1625 N. French Dr., Hobbs, NM 88240			WELL API NO.		
	<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION DI	IVISION	30-025-11907		
	District III - (505) 334-6178	1220 South St. Francis	Dr.	5. Indicate Type of Lease		
	1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460	Santa Fe, NM 8750		STATE FEE 6. State Oil & Gas Lease No.		
	1220 S. St. Francis Dr., Santa Fe, NM			o. State on & das Lease No.		
Г	87505	TIOTO AND DEPONTS ON WELLS				
2		TICES AND REPORTS ON WELLS POSALS TO DRILL OR TO DEEPEN OR PLUG B	RACK TO A	7. Lease Name or Unit Agreement Name		
	DIFFERENT RESERVOIR. USE "APP	LICATION FOR PERMIT" (FORM C-101) FOR SI		South Justis Unit G		
	PROPOSALS.)	Car Wall D Other		8. Well Number #27		
ŀ	 Type of Well: Oil Well Name of Operator 	Gas Well Other		9. OGRID Number		
	Legacy Reserves Operating LF			240974		
	3. Address of Operator			10. Pool name or Wildcat		
	P.O. Box 10848, Midland, TX	9702		Justis; Blinebry-Tubb-Drinkard		
	4. Well Location			•		
	Unit Letter B:	330 feet from the N line ar	nd 1650	feet from the E line		
	Section 36	Township 25S Range		NMPM County Lea		
		11. Elevation (Show whether DR, RK.		Tim III		
		3044' GR	2 2 2 2 2			
	12. Check	Appropriate Box to Indicate Natur	re of Notice, I	Report or Other Data		
			,	<u>.</u>		
		NTENTION TO:		SEQUENT REPORT OF:		
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORF TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRII						
	PULL OR ALTER CASING		SING/CEMENT	LING OPNS.□ P AND A □ JOB □		
	DOWNHOLE COMMINGLE		(OIIVO/CEIVIEIVI	308		
	CLOSED-LOOP SYSTEM					
	OTHER:		HER:			
	13. Describe proposed or con	pleted operations. (Clearly state all pertin	nent details, and	give pertinent dates, including estimated date		
	of starting any proposed very proposed completion or re	vork). SEE RULE 19.15.7.14 NMAC. For	or Multiple Com	pletions: Attach wellbore diagram of		
	proposed completion of to	completion.				
	1. Tag 7" CIBP @ 493	5' w/ 50' cmt on top.				
	2. Spot 25 sx cmt @ 46	80-4530'. WOC & Tag (Glorieta) 2. (k	Spot 25 sx Clas	s C 3090 (Penrose)		
	3. Perf & Sqz 50 sx cm	t @ 2200-2050'. WOC & Tag (B/Salt)				
		t @ 1750-1600'. WOC & Tag (T/Salt)				
	5. Perf & Sqz 50 sx cm 6. Perf & Sqz 80 sx cm	t @ 928-780'. WOC & Tag (9 5/8" Shoot	e)			
		crify cmt to surface, weld on Dry Hole N	Aarker.			
		and to surface, were on 21, 11010 in				
	4" diameter 4' tall	Above Ground Marker				
			SEE ATTA	CHED		
			_	S OF APPROVAL		
	<u></u>					
$\geq S$	pud Date:	Rig Release Date:				
2 P						
2:02:52						
2 I	hereby certify that the information	above is true and complete to the best of	my knowledge	and belief.		
171		,				
2/2021 S	CNATURE ////	TITLE	1' 0 1'	DATE 2/12/2021		
27.5	IGNATURE ////	TITLE Comp	pliance Coordina	ator DATE <u>3/12/2021</u>		
T	ype or print name Mela	nie Reyes E-mail address: mr	eves@legacvres	erves.com PHONE: (432) 221-6358		
	or State Use Only					
, C	0/	1 1.				
~	PPROVED BY: 1	TITLE Complian	nce Officer A	DATE 5/4/21		
ei.	onditions of Approval (if any):					
Recei						

Released to Imaging: 5/5/2021 8:13:01 AM

WELLBORE SCHEMATIC

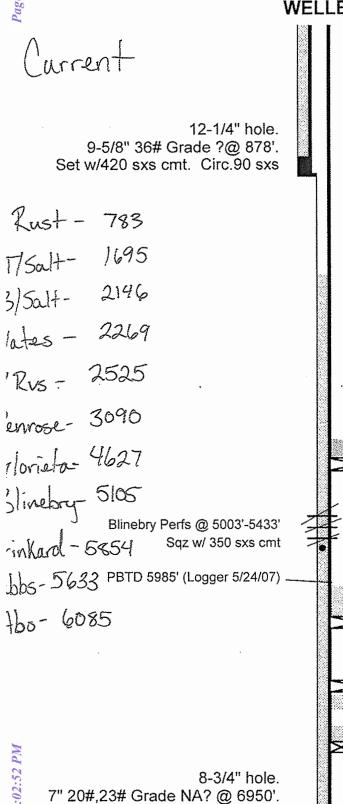

South Justis Unit G #27

(Gulf Oil Corp Arnott Ramsay F #9) 330' FNL & 1650' FEL (B) Sec. 36, T-25S, R-37E, Lea Co., NM KB 3055' (11'KB) Spudded 05/03/61 Completed 07/01/61 API 30-025-11907

TOC @ 3000' by TS

CIBP @ 4935' w/ 9 sxs cmt (50')

Tubb/Drinkard/Blinebry Perfs @ 4972' - 6035' 5536'- DV Tool

CIBP @ 6095'w/ 35' cmt to 6080'

Abo Perfs @ 6176' to 6180'

Howco Cmt Retainer @ 6237' - Sqz 150 sxs

Baker Model D Pkr @ 6827


Fusselman Perfs @ 6858' to 6887'

32.0931244 - 103.1134796

Set w/915 sxs cmt.

TD @ 6950'

Received by OCD: 3/12/2021 2:02:52 PM

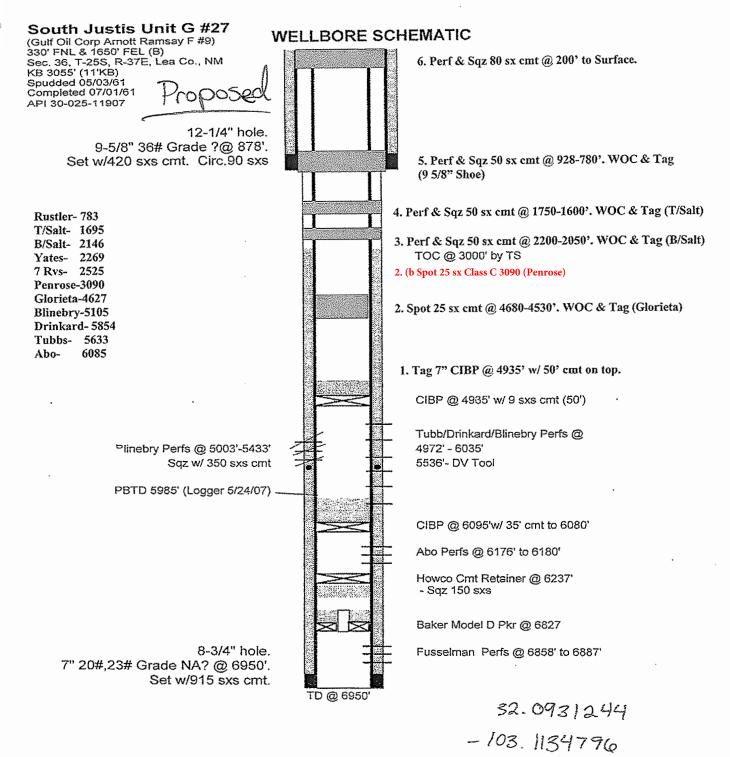

O/A Engineering, AAS SJUG27 (2)

3/9/2021 11:04 AM

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be SO' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, woe and tagged. These plugs will be set SO' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County


SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION


Released to Imaging: 5/5/2021 8:13:01 AM

WELLBORE SCHEMATIC

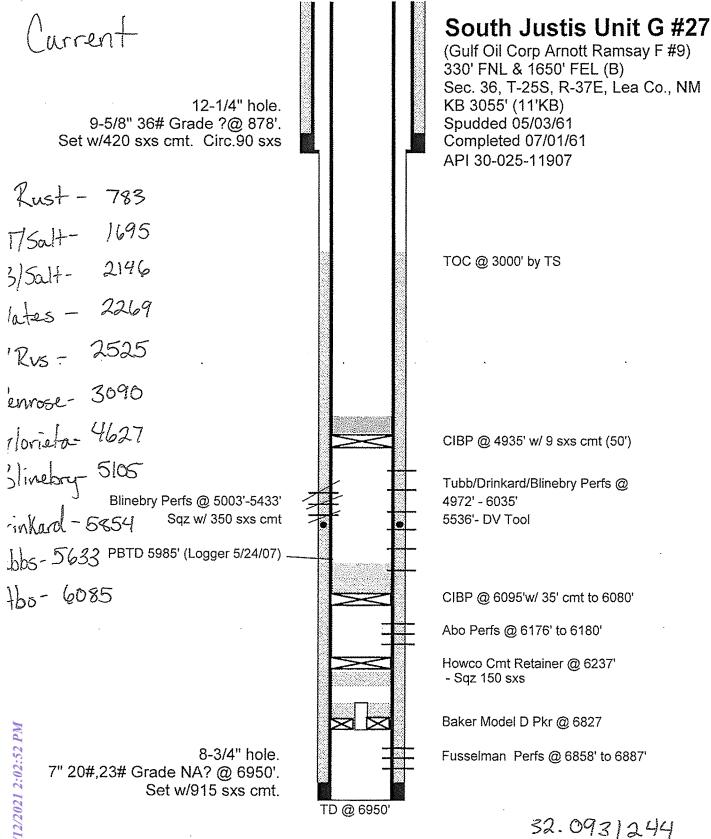

- 103. 1134796

Received by OCD: 3/12/2021 2:02:52 PM

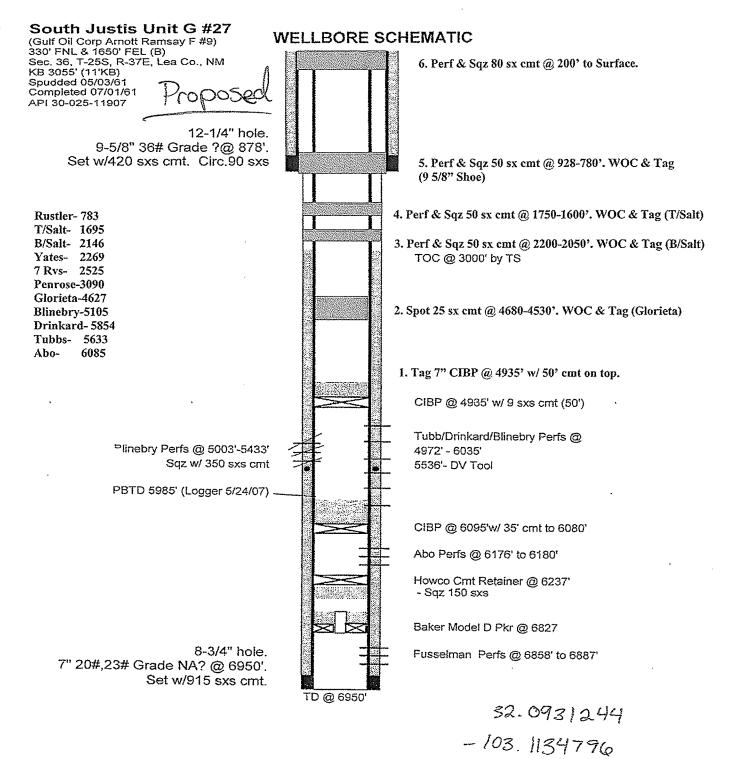

O/A Engineering, AAS SJUG27 (2)

3/9/2021 11:04 AM

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III
1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 20675

COMMENTS

Operator:		OGRID:	Action Number:	Action Type:
LEGACY RESERVES OPERATING, LP	15 Smith Road	240974	20675	C-103F
Suite 3000 Midland, TX79705				

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM	05/05/2021

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III
1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 20675

CONDITIONS OF APPROVAL

Operator:		OGRID:	Action Number:	Action Type:
LEGACY RESERVES OPERATING, LP	15 Smith Road	240974	20675	C-103F
Suite 3000 Midland, TX79705				

OCD Reviewer	Condition
kfortner	See attached conditions of approval Note changes to procedure