

Office
 District I – (575) 393-6161
 1625 N. French Dr., Hobbs, NM 88240
 District II – (575) 748-1283
 811 S. First St., Artesia, NM 88210
 District III – (505) 334-6178
 1000 Rio Brazos Rd., Aztec, NM 87410
 District IV – (505) 476-3460
 1220 S. St. Francis Dr., Santa Fe, NM
 87505

State of New Mexico
 Energy, Minerals and Natural Resources

Form C-103
 Revised July 18, 2013

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

WELL API NO. 30-015-10016
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. K-4042
7. Lease Name or Unit Agreement Name State DF
8. Well Number 1
9. OGRID Number 7377
10. Pool name or Wildcat Collins Ranch; Wolfcamp

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: Oil Well <input type="checkbox"/> Gas Well <input checked="" type="checkbox"/> Other	
2. Name of Operator EOG Resources, Inc.	
3. Address of Operator 104 South Fourth Street, Artesia, NM 88210	
4. Well Location Unit Letter <u>D</u> : <u>660</u> feet from the <u>North</u> line and <u>660</u> feet from the <u>West</u> line Section <u>35</u> Township <u>17S</u> Range <u>24E</u> NMPM Eddy County	
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3734'GR	

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
 TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
 PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
 DOWNHOLE COMMINGLE ☐
 CLOSED-LOOP SYSTEM ☐
 OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
 COMMENCE DRILLING OPNS. ☐ P AND A ☐
 CASING/CEMENT JOB ☐
 OTHER: ☐

Notify OCD 24 hrs. prior to any work done

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

EOG Resources, Inc. plans to plug and abandon this well as follows:

- MIRU all safety equipment as needed. NU BOP. POOH with production equipment.
- Perforate at 5700'. Attempt injection rate. Spot a 44 sx Class "C" cement plug from 6155'-5654'. WOC and tag. This will cover Cisco top and TOC.
- Perforate at 5265'. Attempt injection rate. Squeeze and spot a 25 sx Class "C" cement plug from 5265'-5025'. WOC and tag. This will cover DV tool.
- Set a CIBP at 4875'. Perforate at 4860'. Squeeze with 40 sx in/out cement plug from 4875'-4715'. WOC and tag. This will cover Wolfcamp perms and top.
- Perforate at 3860'. Squeeze with 35 sx Class "C" cement in/out plug from 3910'-3770'. WOC and tag. This will cover Abo top.
- Perforate at 1920'. Squeeze with 35 sx Class "C" cement in/out plug from 1920'-1800'. WOC and tag. This will cover Glorieta top and casing shoe.
- Perforate at 590'. Squeeze with 30 sx Class "C" cement in/out plug from 590'-480'. WOC and tag. This will cover San Andres plug.
- Perforate at 175'. Squeeze with 50 sx Class "C" cement in/out plug from 175' and circulated up to surface. Back fill as needed.
- Cut off wellhead and install dry hole marker. Clean location as per regulated.

Wellbore schematics attached

Spud Date:

Rig Release Date:

****SEE ATTACHED COA's****

Must be plugged by 10/28/2022

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Tina Huerta TITLE Regulatory Specialist DATE October 27, 2021

Type or print name Tina Huerta E-mail address: tina.huerta@eogresources.com PHONE: 575-748-4168

For State Use Only

APPROVED BY: [Signature] TITLE Staff Manager DATE 10/28/2021

State DF #1 Current		Sec-TWN-RNG: FOOTAGES:	Sec. 35-17S-24E 660'FNL & 660'FWL	API: 30-015-10016 GL: 3730 KB: 3734								
		CASING DETAIL										
		#	HOLE SIZE	SIZE	WGHT	GRADE	Top	Bottom	Sx Cmt	Circ/TOC	TOC Method	
		A	15	13 3/8	48	?	0	125	250		Circ	
		B	12	8 5/8	24	?	0	1,795	1100		Circ	
		C	7 7/8	4 1/2	11.6,10.5,9.5	J-55	0	8,191	820	4920, 5715, 7528	CBL	
		DV tools @ 5215 & 7002										
<p>WC perfs 4926-4971</p> <p>DV tool @ 5215</p> <p>TOC @ 5715 per CBL</p> <p>CIBP @ 6550 w/30' cement</p> <p>Canyon perfs 6595-6750</p> <p>DV tool @ 7002</p> <p>TOC @ 7548 per CBL</p> <p>CIBP @ 7850 w/30' cement</p> <p>Morrow perfs 7883-7892</p> <p>CIBP @ 8095</p> <p>Mississippian perfs 8121-8169</p>		FORMATION TOPS										
			Formation	Top		Formation	Top					
			San Andres	538		Strawn	7555					
			Glorieta	1870		Atoka	7762					
			Abo	3862		Morrow	7860					
			Wolfcamp	4922		Chester	7963					
			Cisco	6105		Mississippian	8101					
			Canyon	6580								
<p>PBTD: 6,520 MD</p> <p>TD: 8,180 MD</p>		TUBING DETAIL										
		#	Joints	Description	Length	OD	ID	Grade	Wt (lb/ft):	Top (ftKB):	Btm (ftKB):	
				2" tubing						4,888		
		Additional Details										
		3/3/1974	DV tools @ 7002 & 5215. Perf'd Canyon									
		1/7/1975	Abandon Mississippian. CIBP at 8095. Perforate Morrow									
		3/1-3/1975	Abandon Canyon & Morrow. CIBP at 7850 & 6550 with 30' cement. Perforate ABO formation									
		9/28/1977	Letter to the state showing perfs in "Abo" should be Wolfcamp									
<p>Prepared by: NF 10/22/21</p>		Perforation Detail										
			Formation	Top	Bottom		Treatment					
		A	Wolfcamp	4,926	4,971		Acidize w/5000g 7-1/2% DS-30 acid, 5000g gel pad, 2500g CO2,					
		B	Canyon	6,595	6,750		Acidize w/1000g 15% Regular acid					
		C	Morrow	7,883	7,892		Acidize w/7000g 7-1/2% MS acid, 4300 SCF N2, 3000g CO2					
		D	Mississippian	8,121	8,169		Acidize w/3000g 15% DS-30 flushed w/13,600g 2% KCL					
							no retard plus 2500g CO2, 5000g flush and overflush w/2500g CO2					
							1 drum scale inhibitor in 5000g pad and 8 BS, 5000g gelled acid					

State DF #1 Proposed		Sec-TWN-RNG: Sec. 35-17S-24E	API: 30-015-10016																																																														
		FOOTAGES: 660'FNL & 660'FWL	GL: 3730																																																														
			KB: 3734																																																														
Plug 7: Perf @ 175. 0-175. Surface plug		CASING DETAIL																																																															
Plug 6: Perf @ 590. 480-590. WOC & tag. San Andres top		<table border="1"> <thead> <tr> <th>#</th> <th>HOLE SIZE</th> <th>SIZE</th> <th>WGHT</th> <th>GRADE</th> <th>Top</th> <th>Bottom</th> <th>Sx Cmt</th> <th>Circ/TOC</th> <th>TOC Method</th> </tr> </thead> <tbody> <tr> <td>A</td> <td>15</td> <td>13 3/8</td> <td>48</td> <td>?</td> <td>0</td> <td>125</td> <td>250</td> <td>Circ</td> <td></td> </tr> <tr> <td>B</td> <td>12</td> <td>8 5/8</td> <td>24</td> <td>?</td> <td>0</td> <td>1,795</td> <td>1100</td> <td>Circ</td> <td></td> </tr> <tr> <td>C</td> <td>7 7/8</td> <td>4 1/2</td> <td>11.6,10.5,9.5</td> <td>J-55</td> <td>0</td> <td>8,191</td> <td>820</td> <td>4920, 5715, 7528</td> <td>CBL</td> </tr> <tr> <td colspan="10">DV tools @ 5215 & 7002</td> </tr> </tbody> </table>	#	HOLE SIZE	SIZE	WGHT	GRADE	Top	Bottom	Sx Cmt	Circ/TOC	TOC Method	A	15	13 3/8	48	?	0	125	250	Circ		B	12	8 5/8	24	?	0	1,795	1100	Circ		C	7 7/8	4 1/2	11.6,10.5,9.5	J-55	0	8,191	820	4920, 5715, 7528	CBL	DV tools @ 5215 & 7002																						
#		HOLE SIZE	SIZE	WGHT	GRADE	Top	Bottom	Sx Cmt	Circ/TOC	TOC Method																																																							
A		15	13 3/8	48	?	0	125	250	Circ																																																								
B		12	8 5/8	24	?	0	1,795	1100	Circ																																																								
C		7 7/8	4 1/2	11.6,10.5,9.5	J-55	0	8,191	820	4920, 5715, 7528	CBL																																																							
DV tools @ 5215 & 7002																																																																	
Plug 5 : Perf @ 1920. 1800-1920. WOC & tag. Glorieta top + Casing shoe	FORMATION TOPS																																																																
Plug 4: Perf @ 4860. 3770-3910. WOC & tag. Abo plug.	<table border="1"> <thead> <tr> <th>Formation</th> <th>Top</th> <th>Formation</th> <th>Top</th> </tr> </thead> <tbody> <tr> <td>San Andres</td> <td>538</td> <td>Strawn</td> <td>7555</td> </tr> <tr> <td>Glorieta</td> <td>1870</td> <td>Atoka</td> <td>7762</td> </tr> <tr> <td>Abo</td> <td>3862</td> <td>Morrow</td> <td>7860</td> </tr> <tr> <td>Wolfcamp</td> <td>4922</td> <td>Chester</td> <td>7963</td> </tr> <tr> <td>Cisco</td> <td>6105</td> <td>Mississippian</td> <td>8101</td> </tr> <tr> <td>Canyon</td> <td>6580</td> <td></td> <td></td> </tr> </tbody> </table>	Formation	Top	Formation	Top	San Andres	538	Strawn	7555	Glorieta	1870	Atoka	7762	Abo	3862	Morrow	7860	Wolfcamp	4922	Chester	7963	Cisco	6105	Mississippian	8101	Canyon	6580																																						
Formation	Top	Formation	Top																																																														
San Andres	538	Strawn	7555																																																														
Glorieta	1870	Atoka	7762																																																														
Abo	3862	Morrow	7860																																																														
Wolfcamp	4922	Chester	7963																																																														
Cisco	6105	Mississippian	8101																																																														
Canyon	6580																																																																
Plug 3: CIBP @ 4875. Perf @ 4860. 4715-4875. WOC & tag. WC perfs & WC top WC perfs 4926-4971	PLUGS																																																																
DV tool @ 5215	<table border="1"> <thead> <tr> <th>#</th> <th>SX</th> <th>Class</th> <th>Top</th> <th>Bottom</th> <th>Δ</th> <th>Notes</th> <th>Tag</th> </tr> </thead> <tbody> <tr> <td>1</td> <td>44</td> <td>C</td> <td>5654</td> <td>6155</td> <td>501</td> <td>Perf @ 5700. Attempt Inj. Spot 44sx. Cisco top + TOC plug</td> <td>Y</td> </tr> <tr> <td>2</td> <td>25</td> <td>C</td> <td>5025</td> <td>5265</td> <td>240</td> <td>Perf @ 5265. Attempt Inj. Sqz. & Spot 25sx. DV Tool.</td> <td>Y</td> </tr> <tr> <td>3</td> <td>40</td> <td>C</td> <td>4715</td> <td>4875</td> <td>160</td> <td>CIBP @ 4875. Perf @ 4860. Sqz. In/out plug. WOC & Tag. WC perfs & WC top</td> <td>Y</td> </tr> <tr> <td>4</td> <td>35</td> <td>C</td> <td>3770</td> <td>3910</td> <td>140</td> <td>Perf @ 3860. Sqz. In/out plug. WOC & Tag. Abo Top.</td> <td>Y</td> </tr> <tr> <td>5</td> <td>35</td> <td>C</td> <td>1800</td> <td>1920</td> <td>120</td> <td>Perf @ 1920. Sqz. In/out plug. WOC & Tag. Glorieta top & 8 5/8 csg. Shoe.</td> <td>Y</td> </tr> <tr> <td>6</td> <td>30</td> <td>C</td> <td>480</td> <td>590</td> <td>110</td> <td>Perf @ 590. Sqz/ In/out plug. WOC & Tag. San Andres top.</td> <td>Y</td> </tr> <tr> <td>7</td> <td>50</td> <td>C</td> <td>0</td> <td>175</td> <td>175</td> <td>Perf @ 175. Circ in/out plug to surface</td> <td>Y</td> </tr> </tbody> </table>	#	SX	Class	Top	Bottom	Δ	Notes	Tag	1	44	C	5654	6155	501	Perf @ 5700. Attempt Inj. Spot 44sx. Cisco top + TOC plug	Y	2	25	C	5025	5265	240	Perf @ 5265. Attempt Inj. Sqz. & Spot 25sx. DV Tool.	Y	3	40	C	4715	4875	160	CIBP @ 4875. Perf @ 4860. Sqz. In/out plug. WOC & Tag. WC perfs & WC top	Y	4	35	C	3770	3910	140	Perf @ 3860. Sqz. In/out plug. WOC & Tag. Abo Top.	Y	5	35	C	1800	1920	120	Perf @ 1920. Sqz. In/out plug. WOC & Tag. Glorieta top & 8 5/8 csg. Shoe.	Y	6	30	C	480	590	110	Perf @ 590. Sqz/ In/out plug. WOC & Tag. San Andres top.	Y	7	50	C	0	175	175	Perf @ 175. Circ in/out plug to surface	Y
#	SX	Class	Top	Bottom	Δ	Notes	Tag																																																										
1	44	C	5654	6155	501	Perf @ 5700. Attempt Inj. Spot 44sx. Cisco top + TOC plug	Y																																																										
2	25	C	5025	5265	240	Perf @ 5265. Attempt Inj. Sqz. & Spot 25sx. DV Tool.	Y																																																										
3	40	C	4715	4875	160	CIBP @ 4875. Perf @ 4860. Sqz. In/out plug. WOC & Tag. WC perfs & WC top	Y																																																										
4	35	C	3770	3910	140	Perf @ 3860. Sqz. In/out plug. WOC & Tag. Abo Top.	Y																																																										
5	35	C	1800	1920	120	Perf @ 1920. Sqz. In/out plug. WOC & Tag. Glorieta top & 8 5/8 csg. Shoe.	Y																																																										
6	30	C	480	590	110	Perf @ 590. Sqz/ In/out plug. WOC & Tag. San Andres top.	Y																																																										
7	50	C	0	175	175	Perf @ 175. Circ in/out plug to surface	Y																																																										
Plug 2: Perf @ 5265. 5025-5265. WOC & tag. DV tool	TUBING DETAIL																																																																
TOC @ 5715 per CBL	<table border="1"> <thead> <tr> <th>#</th> <th>Joints</th> <th>Description</th> <th>Length</th> <th>OD</th> <th>ID</th> <th>Grade</th> <th>Wt (lb/ft):</th> <th>Top (ftKB):</th> <th>Btm (ftKB):</th> </tr> </thead> <tbody> <tr> <td></td> <td></td> <td>2" tubing</td> <td></td> <td></td> <td></td> <td></td> <td></td> <td>4,888</td> <td></td> </tr> </tbody> </table>	#	Joints	Description	Length	OD	ID	Grade	Wt (lb/ft):	Top (ftKB):	Btm (ftKB):			2" tubing						4,888																																													
#	Joints	Description	Length	OD	ID	Grade	Wt (lb/ft):	Top (ftKB):	Btm (ftKB):																																																								
		2" tubing						4,888																																																									
Plug 1: 5654-6155. WOC @ tag. Cisco top + TOC plug	Additional Details																																																																
Existing CIBP @ 6550 w/30' Cement	3/3/1974 DV tools @ 7002 & 5215. Perf'd Canyon																																																																
Canyon perfs 6595-6750	1/7/1975 Abandon Mississippian. CIBP at 8095. Perforate Morrow																																																																
DV tool @ 7002	3/1-3/1975 Abandon Canyon & Morrow. CIBP at 7850 & 6550 with 30' cement. Perforate ABO formation																																																																
TOC @ 7528 per CBL	9/28/1977 Letter to the state showing perfs in "Abo" should be Wolfcamp																																																																
Morrow perfs 7883-7892	Perforation Detail																																																																
Existing CIBP @ 7580 w/cement	<table border="1"> <thead> <tr> <th>Formation</th> <th>Top</th> <th>Bottom</th> <th>Treatment</th> </tr> </thead> <tbody> <tr> <td>A</td> <td>Wolfcamp</td> <td>4,926</td> <td>4,971</td> <td>Acidize w/5000g 7-1/2% DS-30 acid, 5000g gel pad, 2500g CO2,</td> </tr> <tr> <td>B</td> <td>Canyon</td> <td>6,595</td> <td>6,750</td> <td>Acidize w/1000g 15% Regular acid</td> </tr> <tr> <td>C</td> <td>Morrow</td> <td>7,883</td> <td>7,892</td> <td>Acidize w/7000g 7-1/2% MS acid, 4300 SCF N2, 3000g CO2</td> </tr> <tr> <td>D</td> <td>Mississippian</td> <td>8,121</td> <td>8,169</td> <td>Acidize w/3000g 15% DS-30 flushed w/13,600g 2% KCL</td> </tr> <tr> <td></td> <td></td> <td></td> <td></td> <td>no retard plus 2500g CO2, 5000g flush and overflush w/2500g CO2</td> </tr> <tr> <td></td> <td></td> <td></td> <td></td> <td>1 drum scale inhibitor in 5000g pad and 8 BS, 5000g gelled acid</td> </tr> </tbody> </table>	Formation	Top	Bottom	Treatment	A	Wolfcamp	4,926	4,971	Acidize w/5000g 7-1/2% DS-30 acid, 5000g gel pad, 2500g CO2,	B	Canyon	6,595	6,750	Acidize w/1000g 15% Regular acid	C	Morrow	7,883	7,892	Acidize w/7000g 7-1/2% MS acid, 4300 SCF N2, 3000g CO2	D	Mississippian	8,121	8,169	Acidize w/3000g 15% DS-30 flushed w/13,600g 2% KCL					no retard plus 2500g CO2, 5000g flush and overflush w/2500g CO2					1 drum scale inhibitor in 5000g pad and 8 BS, 5000g gelled acid																														
Formation	Top	Bottom	Treatment																																																														
A	Wolfcamp	4,926	4,971	Acidize w/5000g 7-1/2% DS-30 acid, 5000g gel pad, 2500g CO2,																																																													
B	Canyon	6,595	6,750	Acidize w/1000g 15% Regular acid																																																													
C	Morrow	7,883	7,892	Acidize w/7000g 7-1/2% MS acid, 4300 SCF N2, 3000g CO2																																																													
D	Mississippian	8,121	8,169	Acidize w/3000g 15% DS-30 flushed w/13,600g 2% KCL																																																													
				no retard plus 2500g CO2, 5000g flush and overflush w/2500g CO2																																																													
				1 drum scale inhibitor in 5000g pad and 8 BS, 5000g gelled acid																																																													
Existing CIBP @ 8095	Prepared by: JE NF 10/25/21																																																																
Mississippian perfs 8121-8169																																																																	
PBTD: 6,520 MD																																																																	
TD: 8,180 MD																																																																	

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, **Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.**

1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
3. Trucking companies being used to haul oilfield waste fluids to a disposal – commercial or private – shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
8. Produced water **will not** be used during any part of the plugging operation.
9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
11. Class 'C' cement will be used above 7500 feet.
12. Class 'H' cement will be used below 7500 feet.
13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E) Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIREMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name 2. Lease and Well Number 3. API Number 4. Unit Letter 5. Quarter Section (feet from the North, South, East or West) 6. Section, Township and Range 7. Plugging Date 8. County (SPECIAL CASES)-----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

R-111-P Area

T 18S – R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

T 19S – R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A- F. Sec 27 Unit A,B,C,F,G,H.

T 19S – R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

T 19S – R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

T 20S – R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

T 20S – R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 20 – 29. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

T 20S – R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

T 21S – R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

T 21S – R 30E

Sec 1 – Sec 36

T 21S – R 31E

Sec 1 – Sec 36

T 22S – R 28E

Sec 36 Unit A,H,I,P.

T 22S – R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

T 22S – R 30E

Sec 1 – Sec 36

T 22S – R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

T 23S – R 28E

Sec 1 Unit A

T 23S – R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

T 23S – R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

T 23S – R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

T 24S – R 30E

Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.

T 24S – R 31E

Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.

T 25S – R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 58205

CONDITIONS

Operator: EOG RESOURCES INC P.O. Box 2267 Midland, TX 79702	OGRID: 7377
	Action Number: 58205
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	10/28/2021