

Office	State of New M				Form	C-103	
istrict I – (575) 393-6161 Energy, Minerals and Natural Resources			WEII	Revised July 18, 2013 WELL API NO.			
1625 N. French Dr., Hobbs, NM 88240 District II – (575) 748-1283	(575) 748 1283						
311 S. First St., Artesia, NM 88210 OIL CO	First St., Artesia, NM 88210OIL CONSERVATION DIVISIONct III - (505) 334-61781220 South St. Francis Dr.		30-025-37260         5. Indicate Type of Lease         STATE       □         FEE       □				
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460 Santa Fe, NM 87505			6. State Oil & Gas Lease No.				
220 S. St. Francis Dr., Santa Fe, NM 37505			VO-552	1			
SUNDRY NOTICES AND RE				Name or Unit	Agreement I	Name	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			Strait BLJ State Com 8. Well Number				
1. Type of Well: Oil Well Gas Well	Other		4				
2. Name of Operator							
EOG Resources, Inc.			7377				
3. Address of Operator				l name or Wild		1	
04 South Fourth Street, Artesia, NM 88210			X-4 Ran	ch; Morrow/X-	4 Ranch; Ato	oka	
Well Location Unit Letter J : <u>1650</u> feet fro	om the South	line and	1650	feet from the	East	line	
Section 21 Towns	hip 10S Ra	ange 34E	NMPM	Lea	County		
	n (Show whether DR	R, RKB, RT, GR, et	<i>c</i> .)				
	4203		_				
12. Check Appropriate I	Box to Indicate N	lature of Notice	e, Report o	r Other Data	l		
<b>NOTICE OF INTENTION</b>	<mark>ГО:</mark>	SU	BSEQUE	NT REPOR	T OF:		
PERFORM REMEDIAL WORK 🔲 🛛 PLUG AND A	ABANDON 🛛	REMEDIAL WO	RK		ERING CASI	NG 🗌	
EMPORARILY ABANDON	ANS 🗌	COMMENCE D	RILLING OP	NS. 🗌 🛛 P AN	ID A		
PULL OR ALTER CASING 🛛 MULTIPLE C	COMPL	CASING/CEME	NT JOB				
CLOSED-LOOP SYSTEM	_	OTUED					
JIHER.							
13. Describe proposed or completed operation							
13. Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.	E 19.15.7.14 NMA	pertinent details, a					
13. Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.	E 19.15.7.14 NMA	pertinent details, a					
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> </ol>	E 19.15.7.14 NMA ell as follows:	pertinent details, a C. For Multiple C					
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio	pertinent details, a C. For Multiple C n equipment.	ompletions:	Attach wellbo	re diagram o	f	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to	pertinent details, a C. For Multiple C n equipment. op of CIBP to 11,578	ompletions:	Attach wellbo	re diagram o	f	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 811'. This will cover	pertinent details, a C. For Multiple C n equipment. p of CIBP to 11,578 Wolfcamp top.	ompletions:	Attach wellbo	re diagram o	f	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 811'. This will cover '461'. This will cover	pertinent details, a C. For Multiple C n equipment. p of CIBP to 11,578 Wolfcamp top. Abo top.	ompletions:	Attach wellbo	re diagram o	f	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Spot a 25</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 811'. This will cover 461'. This will cover 175'. This will cover	pertinent details, a C. For Multiple C n equipment. p of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top.	ompletions: '. WOC and t	Attach wellbo ag. This will cov	re diagram o er Morrow top	f • and	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Spot a 25 San Andres top.</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 8111'. This will cover 461'. This will cover 175'. This will cover 25 sx Class "C" cemen	pertinent details, a C. For Multiple C n equipment. p of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3	ompletions: '. WOC and t '897'. WOC a	Attach wellbo ag. This will cov nd tag. This will	re diagram o er Morrow top cover casing s	f and shoe and	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Spot a San Andres top.</li> <li>Perforate at 2803'. Attempt injection rate. Squeez</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 8111'. This will cover 1461'. This will cover 175'. This will cover 25 sx Class "C" cemen e with 41 sx Class "C	pertinent details, a C. For Multiple C n equipment. p of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803'	ompletions: '. WOC and t '897'. WOC a -2672'. WOC	Attach wellbo ag. This will cov nd tag. This will 2 and tag. This w	re diagram o er Morrow top cover casing s ill cover Yates	f and shoe and top.	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Spot a San Andres top.</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 8111'. This will cover 1461'. This will cover 175'. This will cover 25 sx Class "C" cement e with 41 sx Class "C e with 41 sx Class "C	pertinent details, a C. For Multiple C n equipment. p of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803' " cement from 2046'	ompletions: '. WOC and t '897'. WOC a -2672'. WOC -1915'. WOC	Attach wellbo ag. This will cov nd tag. This will and tag. This will and tag. This w and tag. This w	re diagram o er Morrow top cover casing s ill cover Yates ill cover Rustl	f and shoe and top. er top.	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Squeez</li> <li>Perforate at 2803'. Attempt injection rate. Squeez</li> <li>Perforate at 473'. Attempt injection rate. Squeez</li> <li>Perforate at 100'. Attempt injection/circulation. S</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 8111'. This will cover 175'. This will cover 25 sx Class "C" cement e with 41 sx Class "C" e with 41 sx Class "C" with 32 sx Class "C" queeze with 32 sx Class	pertinent details, a C. For Multiple C n equipment. p of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803' cement from 2046' cement from 473'-3 uss "C" cement from	ompletions: '. WOC and t '897'. WOC a -2672'. WOC -1915'. WOC 71'. WOC and	Attach wellbo ag. This will cov nd tag. This will and tag. This will and tag. This w d tag. This will c	re diagram o er Morrow top cover casing s ill cover Yates ill cover Rustl over casing sh	f and whoe and top. er top. oe.	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Squeez</li> <li>Perforate at 2803'. Attempt injection rate. Squeez</li> <li>Perforate at 473'. Attempt injection rate. Squeez</li> <li>Perforate at 100'. Attempt injection/circulation. S</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 8111'. This will cover 175'. This will cover 25 sx Class "C" cement e with 41 sx Class "C" e with 41 sx Class "C" with 32 sx Class "C" queeze with 32 sx Class	pertinent details, a C. For Multiple C n equipment. p of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803' cement from 2046' cement from 473'-3 uss "C" cement from	ompletions: '. WOC and t '897'. WOC a -2672'. WOC -1915'. WOC 71'. WOC and	Attach wellbo ag. This will cov nd tag. This will and tag. This will and tag. This w d tag. This will c	re diagram o er Morrow top cover casing s ill cover Yates ill cover Rustl over casing sh	f and whoe and top. er top. oe.	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Spot a San Andres top.</li> <li>Perforate at 2046'. Attempt injection rate. Squeeze</li> <li>Perforate at 100'. Attempt injection rate. Squeeze</li> <li>Cut off wellhead and install dry hole marker. Clear</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 8111'. This will cover 175'. This will cover 25 sx Class "C" cement e with 41 sx Class "C" e with 41 sx Class "C" with 32 sx Class "C" queeze with 32 sx Class	pertinent details, a C. For Multiple C n equipment. op of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803' cement from 2046' cement from 473'-3 iss "C" cement from ilated.	ompletions: '. WOC and t '. WOC and t '. 2672'. WOC -1915'. WOC 71'. WOC and 100' and circ	Attach wellbo ag. This will cov nd tag. This will and tag. This will and tag. This w d tag. This will c	re diagram o er Morrow top cover casing s ill cover Yates ill cover Rustl over casing sh	f and whoe and top. er top. oe.	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP. 1</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Spot a 25 San Andres top.</li> <li>Perforate at 2046'. Attempt injection rate. Squeeze</li> <li>Perforate at 100'. Attempt injection rate. Squeeze</li> <li>Cut off wellhead and install dry hole marker. Cleat</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 811'. This will cover 175'. This will cover 25 sx Class "C" cemen e with 41 sx Class "C e with 41 sx Class "C" with 32 sx Class "C" queeze with 32 sx Cla an location as per regu round marker send	pertinent details, a C. For Multiple C n equipment. op of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803' cement from 2803' cement from 473'-3 iss "C" cement from lated.	ompletions: '. WOC and t '897'. WOC a -2672'. WOC -1915'. WOC 71'. WOC an 100' and circ <b>illing hole</b>	Attach wellbo ag. This will cov and tag. This will and tag. This w and tag. This w d tag. This will c ulate up to surfac	re diagram o er Morrow top cover casing s ill cover Yates ill cover Rustl over casing sh	f and shoe and top. er top. oe.	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP. 1</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Spot a 12 San Andres top.</li> <li>Perforate at 2046'. Attempt injection rate. Squeeze</li> <li>Perforate at 100'. Attempt injection rate. Squeeze</li> <li>Cut off wellhead and install dry hole marker. Cleat</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 811'. This will cover 175'. This will cover 25 sx Class "C" cement e with 41 sx Class "C e with 41 sx Class "C with 32 sx Class "C" queeze with 32 sx Class an location as per regu	pertinent details, a C. For Multiple C n equipment. op of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803' cement from 2803' cement from 473'-3 iss "C" cement from lated.	ompletions: '. WOC and t '897'. WOC a -2672'. WOC -1915'. WOC 71'. WOC and 100' and circ illing hole ACHED CON	Attach wellbo ag. This will cov and tag. This will and tag. This w and tag. This w d tag. This will c ulate up to surfac	re diagram o er Morrow top cover casing s ill cover Yates ill cover Rustl over casing sh	f and shoe and top. er top. oe.	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Spot a 25 san Andres top.</li> <li>Perforate at 2803'. Attempt injection rate. Squeeze</li> <li>Perforate at 473'. Attempt injection rate. Squeeze</li> <li>Perforate at 100'. Attempt injection/circulation. S</li> <li>Cut off wellhead and install dry hole marker. Cleatwellbore schematics attached LPC Area Below groud Date:</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 2811'. This will cover 2461'. This will cover 275'. This will cover 25 sx Class "C" cement e with 41 sx Class "C" e with 41 sx Class "C" queeze with 32 sx Class "C" queeze with 32 sx Class an location as per regular round marker send Rig Release D	pertinent details, a C. For Multiple C n equipment. p of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803' " cement from 2803' cement from 473'-3 iss "C" cement from lated. pics before backf of APPRO	ompletions: '. WOC and t '897'. WOC a -2672'. WOC -1915'. WOC 71'. WOC and 100' and circ illing hole ACHED CON DVAL	Attach wellbo ag. This will cov and tag. This will and tag. This will and tag. This w and tag. This will c and tag. This will c ulate up to surfac	re diagram o er Morrow top cover casing s ill cover Yates ill cover Rustl over casing sh	f and whoe and top. er top. oe.	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Spot a San Andres top.</li> <li>Perforate at 2046'. Attempt injection rate. Squeeze</li> <li>Perforate at 100'. Attempt injection rate. Squeeze</li> <li>Cut off wellhead and install dry hole marker. Clear</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 2811'. This will cover 2461'. This will cover 275'. This will cover 25 sx Class "C" cement e with 41 sx Class "C" e with 41 sx Class "C" queeze with 32 sx Class "C" queeze with 32 sx Class an location as per regular round marker send Rig Release D	pertinent details, a C. For Multiple C n equipment. p of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803' " cement from 2803' cement from 473'-3 iss "C" cement from lated. pics before backf of APPRO	ompletions: '. WOC and t '897'. WOC a -2672'. WOC -1915'. WOC 71'. WOC and 100' and circ illing hole ACHED CON DVAL	Attach wellbo ag. This will cov and tag. This will and tag. This will and tag. This w and tag. This will c and tag. This will c ulate up to surfac	re diagram o er Morrow top cover casing s ill cover Yates ill cover Rustl over casing sh	f and shoe and top. er top. oe.	
<ol> <li>Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP.</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>Perforate at 4275'. Attempt injection rate. Spot a 25 san Andres top.</li> <li>Perforate at 2803'. Attempt injection rate. Squeeze</li> <li>Perforate at 473'. Attempt injection rate. Squeeze</li> <li>Perforate at 100'. Attempt injection/circulation. S</li> <li>Cut off wellhead and install dry hole marker. Cleatwellbore schematics attached LPC Area Below groud Date:</li> </ol>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to 811'. This will cover 175'. This will cover 25 sx Class "C" cement e with 41 sx Class "C" e with 41 sx Class "C" with 32 sx Class "C" queeze with 32 sx Class in location as per regu round marker send Rig Release D	pertinent details, a C. For Multiple C n equipment. p of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803' " cement from 2803' cement from 473'-3 iss "C" cement from lated. pics before backf of APPRO	ompletions: '. WOC and t 897'. WOC a -2672'. WOC -1915'. WOC 100' and circ illing hole ACHED CON DVAL lge and belie	Attach wellbo ag. This will cov and tag. This will and tag. This will and tag. This w and tag. This will c and tag. This will c ulate up to surfac	re diagram o er Morrow top cover casing s ill cover Yates ill cover Rustl over casing sh ce. Back fill as	f and shoe and top. er top. oe.	
<ul> <li>13. Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP. 2</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>3. Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>4. Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>5. Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>6. Perforate at 4275'. Attempt injection rate. Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>7. Perforate at 2803'. Attempt injection rate. Squeeze</li> <li>8. Perforate at 2046'. Attempt injection rate. Squeeze</li> <li>9. Perforate at 473'. Attempt injection rate. Squeeze</li> <li>10. Perforate at 100'. Attempt injection/circulation. S</li> <li>11. Cut off wellhead and install dry hole marker. Cleat</li> <li>Wellbore schematics attached LPC Area Below group Date:</li> </ul>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to ass "C" cement ass "C" ceme	pertinent details, a C. For Multiple C n equipment. op of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803' " cement from 2803' cement from 473'-3 iss "C" cement from lated. pics before backf of APPRO	ompletions: '. WOC and t '897'. WOC a -2672'. WOC -1915'. WOC 100' and circ illing hole CHED CON OVAL lge and belie st DATH	Attach wellbo ag. This will cov ad. This will cov and tag. This will and tag. This will and tag. This will c and tag. This will c ulate up to surface DITIONS	re diagram o er Morrow top cover casing s ill cover Yates ill cover Rustl over casing sh ce. Back fill as	f and shoe and top. er top. oe. needed.	
<ul> <li>13. Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP. 2</li> <li>Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>3. Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>4. Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>5. Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>6. Perforate at 4275'. Attempt injection rate. Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>7. Perforate at 2803'. Attempt injection rate. Squeez</li> <li>8. Perforate at 2046'. Attempt injection rate. Squeez</li> <li>9. Perforate at 473'. Attempt injection rate. Squeeze</li> <li>10. Perforate at 100'. Attempt injection/circulation. S</li> <li>11. Cut off wellhead and install dry hole marker. Cleat</li> <li>Wellbore schematics attached LPC Area Below group Date:</li> </ul>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to ass "C" cement ass "C" ceme	pertinent details, a C. For Multiple C n equipment. op of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803" " cement from 2803" " cement from 2046" cement from 473'-3 uss "C" cement from lated. <b>pics before backf</b> of APPRO pest of my knowled egulatory Specialis	ompletions: '. WOC and t '897'. WOC a -2672'. WOC -1915'. WOC 100' and circ illing hole CHED CON OVAL lge and belie st DATH	Attach wellbo ag. This will cov ad. This will cov and tag. This will and tag. This will and tag. This will c and tag. This will c ulate up to surface DITIONS	re diagram o er Morrow top cover casing s ill cover Yates ill cover Rustl over casing sh ce. Back fill as	f and shoe and top. er top. oe. needed.	
<ul> <li>13. Describe proposed or completed operation of starting any proposed work). SEE RUL proposed completion or recompletion.</li> <li>EOG Resources, Inc. plans to plug and abandon this w</li> <li>MIRU all safety equipment as needed. NU BOP. 1</li> <li>2. Set a CIBP at 11,909'. Pressure test. Spot 25 sx C perfs and Atoka top.</li> <li>3. Spot a 25 sx Class "H" cement plug from 9142'-8</li> <li>4. Spot a 25 sx Class "H" cement plug from 7792'-7</li> <li>5. Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>6. Perforate at 4275'. Attempt injection rate. Spot a 25 sx Class "C" cement plug from 5553'-5</li> <li>7. Perforate at 2803'. Attempt injection rate. Squeez</li> <li>8. Perforate at 2046'. Attempt injection rate. Squeez</li> <li>9. Perforate at 473'. Attempt injection rate. Squeeze</li> <li>10. Perforate at 100'. Attempt injection/circulation. S</li> <li>11. Cut off wellhead and install dry hole marker. Cleat</li> <li>Wellbore schematics attached LPC Area Below groud Date:</li> <li>Dereby certify that the information above is true and to the information above is true and to the information above is true and the information above is</li></ul>	E 19.15.7.14 NMA ell as follows: POOH with productio lass "H" cement on to ass "H" cement on	pertinent details, a C. For Multiple C n equipment. op of CIBP to 11,578 Wolfcamp top. Abo top. Glorieta top. nt plug from 4275'-3 " cement from 2803" " cement from 2803" " cement from 2046" cement from 473'-3 uss "C" cement from lated. <b>pics before backf</b> of APPRO pest of my knowled egulatory Specialis	ompletions: '. WOC and t '897'. WOC a -2672'. WOC -1915'. WOC 100' and circ illing hole CHED CON OVAL lge and belie st DATH	Attach wellbo ag. This will cov ad. This will cov and tag. This will and tag. This will and tag. This will c and tag. This will c ulate up to surface DITIONS	re diagram o er Morrow top cover casing s ill cover Yates ill cover Yates ill cover Rustl over casing sh ce. Back fill as	f and shoe and top. er top. oe. needed.	

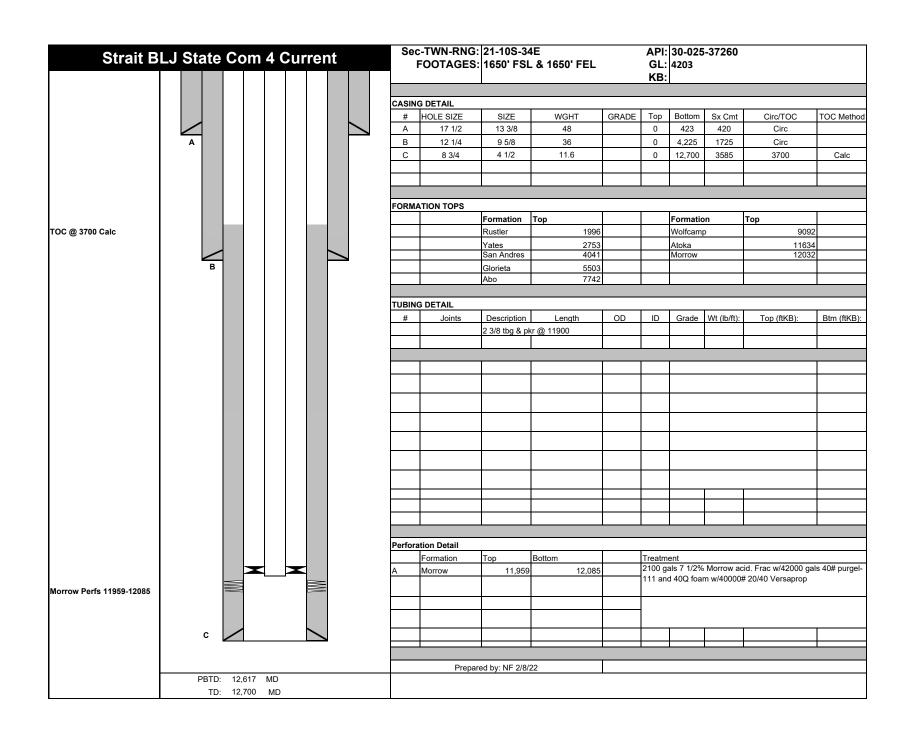

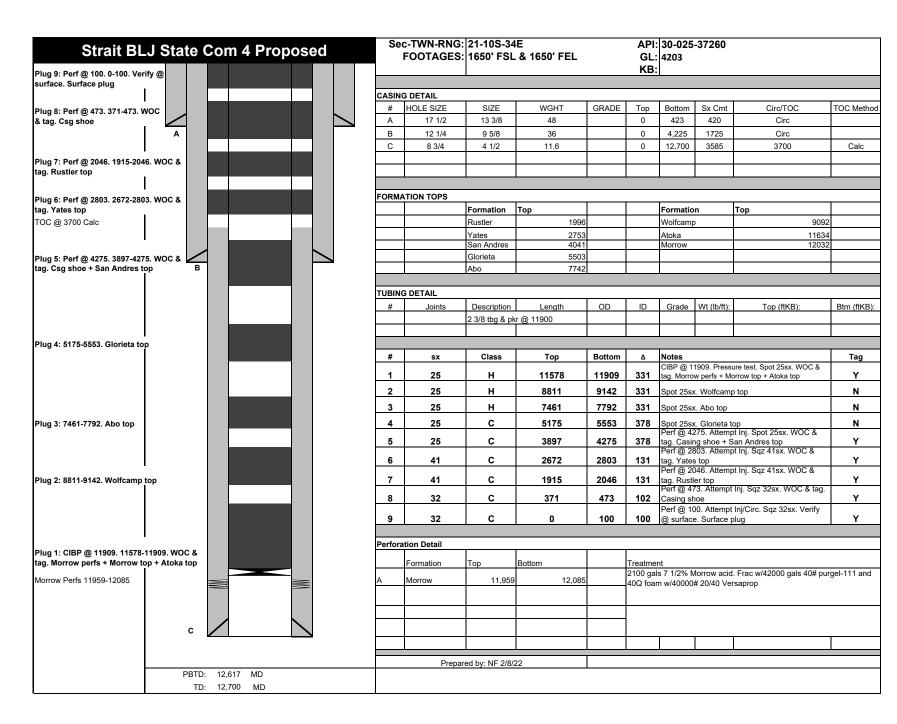

# CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

# Company representative will be on location during plugging procedures.

**1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.

**2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.

**3.** Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.

4. Filing a subsequent C-103 will serve as notification that the well has been plugged.

**5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.

**6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.

7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.

8. Produced water will not be used during any part of the plugging operation.

9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.

**10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.

11. Class 'C' cement will be used above 7500 feet.

12. Class 'H' cement will be used below 7500 feet.

**13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged

**14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

**16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set

17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.

**18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.

20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops

- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.

### K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

**21.** If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

# DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

## SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

# SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

COMMENTS

Operator: 0	OGRID:
EOG RESOURCES INC	7377
P.O. Box 2267	Action Number:
Midland, TX 79702	80982
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

### COMMENTS

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM	3/14/2022

Page 6 of 7

.

Action 80982

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170 District IV

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
EOG RESOURCES INC	7377
P.O. Box 2267	Action Number:
Midland, TX 79702	80982
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By		Condition Date
kfortner	See attached conditions of approval	3/11/2022

.

CONDITIONS

Action 80982