Diamact - (57) 393-6101       Energy, Minerals and Natural Resources       Revised July 18, 2013.         District II - (57) 748-1283       OLL CONSERVATION DIVISION       WELL API NO.       30-15-2584.2         District III - (57) 748-1283       OLL CONSERVATION DIVISION       1220 South St. Francis Dr.       30-16-2584.2         District III - (56) 748-6178       District III - (56) 748-6178       Santa Fe, NM 87505       5       Indicate Type of Lease         State State Distribution       Santa Fe, NM 87505       Santa Fe, NM 87505       5       State Oli & Gas Lease No.         State Oli & Gas Lease No.       Santa Fe, NM 87505       Santa Fe, NM 87505       5       State Oli & Gas Lease No.         State Oli Well State Distribution       Santa Fe, NM 87505       State Oli & Gas Lease No.       331898         State Oli Well State Distribution       Gas Well Coher       004       Note Address of Operator       Note Operator         19707 HI 10 West, Suite 201 San Antonio, TX 78257       Io. Pool name or Wildcat       No. SEVEN REVERS; GLONITEA-YESO         4. Well Location       Unit Letter1980 feet from theSouth1982       SUBSEQUENT REPORT OF:         PERFORM REMEDIAL WORK    PLUG AND ABANDON SI       REMEDIAL WORK    ALTERING CASING    Comment of the gas and address of operation 16       SUBSEQUENT REPORT OF:         PERFORM REMEDIAL WORK    CHANG BA DANDON SI       REM	eceived by OCD: 3/9/2022 1:35:13 PM Office	State of New Me		Form C-103 <sup>Page 1 of</sup> Revised July 18, 2013
Bit 5 Fird St. Artesia. NM 98210       DIL CONSERVATION DIVISION         Darter III (1969) 334-673       1220 South St. Francis Dr.         1000 Ro Brazos Rd. Azec. SM 87410       1220 South St. Francis Dr.         Jord RD 1220.S. St. Fancis Dr., South For PROPOSALS TO DELEVAN TO DEEPEN OR PLUG BACK TO A       6. State Oil & Gas Lease No.         331898       500 NOT USE THIS POR MOR PROPOSALS TO DELL OR TO DEEPEN OR PLUG BACK TO A       7. Lease Name or Unit Agreement Name         MOLE AMM STATE COM       Sunne of Operator Silverback Operating II, LLC       9. OGRID Number         2. Name of Operator       330968         3. Address of Operator       9. Section       9. SEVEN NUERS; CLORETA-YESO         19707 H1 10 West, Suite 201 San Antonio, TX 78257       10. Pool name or Wildcat       N. SEVEN NUERS; CLORETA-YESO         19707 H1 10 West, Suite 201 San Antonio, TX 78257       10. Pool name or Wildcat       N. SEVEN NUERS; CLORETA-YESO         19707 H1 10 West, Suite 201 San Antonio, TX 78257       N. SEVEN NUERS; CLORETA-YESO       N. SEVEN NUERS; CLORETA-YESO         19707 H1 10 West, Suite 201 San Antonio, TX 78257       N. SEVEN NUERS; CLORETA -YESO       N. SEVEN NUERS; CLORETA -YESO         11. Elevation (Show whether DR, RKB, RT, GR, etc.)       3476' GR       SUBSEQUENT REPORT OF:         PERFORM REMEDIAL WORK	1625 N. French Dr., Hobbs, NM 88240			WELL API NO.
Data Dial       Data Dial	811 S. First St., Artesia, NM 88210			
12:0: S.K.Punets D., Suna Fe, NM       331898         \$3505       SUNDRY NOTICES AND REPORTS ON WELLS       7. Lease Name or Unit Agreement Name         OPTOTERENT RESERVOR. USE 'APPLICATION FOR PERMIT' (FORM C-101) FOR SUCH       AMOLE AMM STATE COM         DEFFRENT RESERVOR. USE 'APPLICATION FOR PERMIT'' (FORM C-101) FOR SUCH       AMOLE AMM STATE COM         PROTOSALS.)       1. Type of Well: Oil Well ⊠ Gas Well □ Other       9. OGRID Number         33. Address of Operator       10. Pool name or Wildcat       7. Lease Name or Wildcat         19707 1H 10 West, Suite 201 San Antonio, TX 78257       10. Pool name or Wildcat       N. SEVEN RIVERS; GLORIETA-YESO         4. Well Location       11. Elevation (Show whether DR. RKB, RT, GR, etc.)       3476' GR         12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data       NOTICE OF INTENTION TO:       SUBSEQUENT REPORT OF:         PERFORM REMEDIAL WORK       PLUG AND ABANDON ⊠       REMEDIAL WORK       ALTERING CASING □         PULL OR ALTER CASING □       MULTIPLE COMPL       COMMENCE DRILLING OPNS.□       P AND A         PULL OR ALTER CASING □       MULTIPLE COMPL       OTHER:       Notify OCO 24 hrs. prior to any work         OTHER:       01       SE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed cork). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed cord). SEE RULE 19.15.7.14 NMAC. For Multip				STATE FEE
SUNDRY NOTICES AND REPORTS ON WELLS         7. Lease Name or Unit Agreement Name         DIPERTING TO PERPORTS ON WELLS         7. Lease Name or Unit Agreement Name         DIPERTING TO REPROPOSALS         Not the provide of the previde o	1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe, NM 87		
PRODALS.)       I. Type of Well: Oil Well ⊠ Gas Well □ Other       0.04         2. Name of Operator Silverback Operating II, LLC       9. OGRID Number         330968       3. Address of Operator       10. Pool name or Wildcat         19707 IFI 10 West, Suite 201 San Antonio, TX 78257       10. Pool name or Wildcat         19707 IFI 10 West, Suite 201 San Antonio, TX 78257       N. SEVEN RIVERS; GLORIETA-YESO         4. Well Location       11. Elevation (Show whether DR, RKB, RT, GR, etc.)         3476' GR       11. Elevation (Show whether DR, RKB, RT, GR, etc.)         3476' GR       12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data         NOTICE OF INTENTION TO:         PERFORM REMEDIAL WORK       PLUG AND ABANDON ⊠         COMMENCE DORILLING OPNS       P AND A         PULL OR ALTER CASING       MULTIPLE COMPL         COSED-LOOP SYSTEM       OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed or optetor on the out op 136 ft. This will cover 7 inch casing shoe         Mort be started as soon as a workover rig is available.       Run CBL to surface.         Silverback Operating II, LLC proposes to plug and abandon this well as follows:       Stot 25 sx cntt 812' 712' T. of SA	SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A			7. Lease Name or Unit Agreement Name
1. Type of Wein On Wein ⊠ Gas wein ☐ Outer       004         2. Name of Operator Silverback Operating II, LLC       9. OGRID Number         330968       3. Address of Operator       10. Pool name or Wildcat         19707 IH 10 West, Suite 201 San Antonio, TX 78257       10. Pool name or Wildcat         19707 IH 10 West, Suite 201 San Antonio, TX 78257       N. SEVEN RIVERS; GLORIETA-YESO         4. Well Location       Unit Letter_11980 feet from theSouthIine and660feet from theEastline         Section       16       Township         12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data         NOTICE OF INTENTION TO:         PERFORM REMEDIAL WORK       PLUG AND ABANDON         PULL OR ALTER CASING       MULTIPLE COMPL         DOWNHOLE COMMINGLE       MULTIPLE COMPL         COSED-LOOP SYSTEM       OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed ownk). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.         Work to be started as soon as a workover rig is available.       Run CBL to surface,         Silverback Operating II, LLC proposes to plug and abandon this well as follows:       Multiple Completion Core 7. inch casing shoe         MRU all safety equipment as needed. Kill well.				
2. Name of Operator Silverback Operating II, LLC       9. OGRID Number         3. Address of Operator       10. Pool name or Wildcat         19707 IH 10 West, Suite 201 San Antonio, TX 78257       10. Pool name or Wildcat         19707 IH 10 West, Suite 201 San Antonio, TX 78257       10. Pool name or Wildcat         19707 IH 10 West, Suite 201 San Antonio, TX 78257       10. Pool name or Wildcat         19707 IH 10 West, Suite 201 San Antonio, TX 78257       10. Pool name or Wildcat         19707 IH 10 West, Suite 201 San Antonio, TX 78257       10. Pool name or Wildcat         10. Unit Letter				
3. Address of Operator       10. Pool name or Wildcat         19707 IH 10 West, Suite 201 San Antonio, TX 78257       10. Pool name or Wildcat         4. Well Location       N. SEVEN RIVERS; GLORIETA-YESO         4. Well Location       10. Township         19007 IH 10 West, Suite 201 San Antonio, TX 78257       11. Elevation         10. Pool name or Wildcat       N. SEVEN RIVERS; GLORIETA-YESO         4. Well Location       10. Township         10. Pool name or Wildcat       N. SEVEN RIVERS; GLORIETA-YESO         4. Well Location       16         11. Elevation (Show whether DR, RKB, RT, GR, etc.)       3476' GR         12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data         NOTICE OF INTENTION TO:         PERFORM REMEDIAL WORK       PLUG AND ABANDON ⊠         CHANGE PLANS       COMMENCE DRILLING OPNS.       P AND A         PULL OR ALTER CASING       MULTIPLE COMPL       CASING/CEMENT JOB       CASING/CEMENT JOB         DOWNHOLE COMMINGLE       MULTIPLE COMPL       Notify OCD 24 hrs. prior to any work       CATHER:         13. Describe proposed or completed operations.       Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.         Work to be start	2. Name of Operator Silverback Operating II, LLC			9. OGRID Number
Unit Letter:				10. Pool name or Wildcat
Section       16       Township       19S       Range       25E       NMPM       Eddy       County         11. Elevation (Show whether DR, RKB, RT, GR, etc.)       3476' GR       3476' GR       12.       Check Appropriate Box to Indicate Nature of Notice, Report or Other Data         NOTICE OF INTENTION TO:       SUBSEQUENT REPORT OF:         PERFORM REMEDIAL WORK       PLUG AND ABANDON       SUBSEQUENT REPORT OF:         PERFORM REMEDIAL WORK       PLUG AND ABANDON       CHANGE PLANS       ALTERING CASING         PULL OR ALTER CASING       MULTIPLE COMPL       COMMENCE DRILLING OPNS.       P AND A       CASING/CEMENT JOB         DOWNHOLE COMMINGEE       MULTIPLE COMPL       DOWNHOLE COMMINGE       Notify OCD 24 hrs. prior to any work done       CASING/CEMENT JOB         13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed completion.       Nultiple Completions: Attach wellbore diagram of proposed completion or recompletion.         Work to be started as soon as a workover rig is available.       Run CBL to surface.         Silverback Operating II, LLC proposes to plug and abandon this well as follows:       Net all safety equipment as needed. Kill well. NU BOP. POOH with production equipment.         2. Set a CIBP at 2246 ft with 25 ft Class C cement on top to 2136 ft. This will cover Top of Glorita.       Perf @ 1235	4. Well Location			
11. Elevation (Show whether DR, RKB, RT, GR, etc.)         3476' GR         12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data         NOTICE OF INTENTION TO:         PERFORM REMEDIAL WORK         PLUG AND ABANDON         CHANGE PLANS         PULL OR ALTER CASING         MULTIPLE COMPL         CLOSED-LOOP SYSTEM         OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.         Work to be started as soon as a workover rig is available.         Silverback Operating II, LLC proposes to plug and abandon this well as follows:         1. MIRU all safety equipment as needed. Kill well. NU BOP. POOH with production equipment.         2. Set a CIBP at 2246 ft with 25 ft Class C cement on top to 2136 ft. This will cover Top of Glorieta.         Perf @ 1235         3. Perforate at 1 № 5 ft. Attempt to sqz cmt. Spot at 45 sx Class C cement plug from 1 № 5 ft - 712' - T. of SA         4. Set a Class C cement plug from 1 № 6 ft - surface. Back fill as needed.         Perf @ 150'	Unit LetterI:	_1980 _feet from theSouth	line and	660feet from theEastline
3476' GR         12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data         NOTICE OF INTENTION TO:         PERFORM REMEDIAL WORK □       PLUG AND ABANDON □         PERFORM REMEDIAL WORK □       PLUG AND ABANDON □         CHANGE PLANS □       COMMENCE DRILLING OPNS.□         PULL OR ALTER CASING □       MULTIPLE COMPL         DOWNHOLE COMMINGLE □       NULTIPLE COMPL         CLOSED-LOOP SYSTEM □       OTHER:         13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.         Work to be started as soon as a workover rig is available.       Run CBL to surface,         Silverback Operating II, LLC proposes to plug and abandon this well as follows:       Perf @ 1235         1. MIRU all safety equipment as needed. Kill well. NU BOP. POOH with production equipment.       Perf @ 1235         2. Set a CIBP at 2246 ft with 25 ft Class C cement on top to 2136 ft. This will cover Top of Glorieta.       Perf @ 1235         3. Perforate at 1 \% 5 ft. Attempt to sqc cmt. Spot a 45 sx Class C cement plug from 1\% 5 ft 7\% ft. This will cover 7 inch casing shoe       Spot 25 sx cmt 812' - 712' - T. of SA         4. Spot a 25 sx Class C cement plug from 1\% 0 ft – surface. Back fill as needed.       Perf @ 150'		Ĭ	U	, <u>,</u>
NOTICE OF INTENTION TO:       SUBSEQUENT REPORT OF:         PERFORM REMEDIAL WORK       PLUG AND ABANDON       REMEDIAL WORK       ALTERING CASING         TEMPORARILY ABANDON       CHANGE PLANS       COMMENCE DRILLING OPNS.       P AND A         PULL OR ALTER CASING       MULTIPLE COMPL       CASING/CEMENT JOB       Image: Commence of the second s			RKB, RT, GR, etc.)	
NOTICE OF INTENTION TO:       SUBSEQUENT REPORT OF:         PERFORM REMEDIAL WORK       PLUG AND ABANDON       REMEDIAL WORK       ALTERING CASING         TEMPORARILY ABANDON       CHANGE PLANS       COMMENCE DRILLING OPNS.       P AND A         PULL OR ALTER CASING       MULTIPLE COMPL       CASING/CEMENT JOB       Image: Commence of the second s	12. Check Ap	propriate Box to Indicate N	ature of Notice.	Report or Other Data
TEMPORARILY ABANDON       CHANGE PLANS       COMMENCE DRILLING OPNS.       P AND A         PULL OR ALTER CASING       MULTIPLE COMPL       CASING/CEMENT JOB       Notify OCD 24 hrs. prior to any work done         DOWNHOLE COMMINGLE       Notify OCD 24 hrs. prior to any work done       Notify OCD 24 hrs. prior to any work done         I3. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.         Work to be started as soon as a workover rig is available.       Run CBL to surface.         Silverback Operating II, LLC proposes to plug and abandon this well as follows:       Run CBL to surface.         1. MIRU all safety equipment as needed. Kill well. NU BOP. POOH with production equipment.       Perf @ 1235'         3. Perforate at 1 \% 5 ft. Attempt to sqz cmt. Spot a 45 sx Class C cement plug from 1\% 5 ft 7\% ft. This will cover 7-inch casing shoe and Top of Sun Andres. WOC and tag.       Spot 25 sx cmt 812' - 712' - T. of SA         4. \$\% ot a 25 sx Class C cement plug from 1\% 0 ft – surface. Back fill as needed.       Perf @ 150'         5. Cut off wellhead and install dry hole marker. Clean location per regulations.       Perf @ 150'		•		-
PULL OR ALTER CASING       MULTIPLE COMPL       CASING/CEMENT JOB         DOWNHOLE COMMINGLE       Notify OCD 24 hrs. prior to any work         OTHER:       OTHER:       Notify OCD 24 hrs. prior to any work         I3. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.         Work to be started as soon as a workover rig is available.       Run CBL to surface.         Silverback Operating II, LLC proposes to plug and abandon this well as follows:       1. MIRU all safety equipment as needed. Kill well. NU BOP. POOH with production equipment.         2. Set a CIBP at 2246 ft with 25 ft Class C cement on top to 2136 ft. This will cover Top of Glorieta.       Perf @ 1235'         3. Perforate at 1 X5 ft. Attempt to sqz cmt. Spot a 45 sx Class C cement plug from 1X5 ft – 7X ft. This will cover 7-inch casing shoe and Top of San Andres. WOC and tag.       Spot 25 sx cmt 812' - 712' - T. of SA         4. Spot a 25 sx Class C cement plug from 1X0 ft – surface. Back fill as needed.       Perf @ 150'         5. Cut off wellhead and install dry hole marker. Clean location per regulations.			-	
DOWNHOLE COMMINGLE				
CLOSED-LOOP SYSTEM       Image: Close of the second s			CASING/CEMEN	
<ul> <li>OTHER: OTHER: OTH</li></ul>	<u> </u>			
of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. Work to be started as soon as a workover rig is available. Silverback Operating II, LLC proposes to plug and abandon this well as follows: 1. MIRU all safety equipment as needed. Kill well. NU BOP. POOH with production equipment. 2. Set a CIBP at 2246 ft with 25 ft Class C cement on top to 2136 ft. This will cover Top of Glorieta. 3. Perforate at 1 \text{S} ft. Attempt to sqz cmt. Spot a 45 sx Class C cement plug from 1 \text{S} ft - 7 \text{K} ft. This will cover 7-inch casing shoe and Top of San Andres. 4. Set a 25 sx Class C cement plug from 1 \text{MOC} ft - surface. Back fill as needed. 5. Cut off wellhead and install dry hole marker. Clean location per regulations. <b>Perf @ 150'</b>			-	
<ul> <li>Silverback Operating II, LLC proposes to plug and abandon this well as follows:</li> <li>1. MIRU all safety equipment as needed. Kill well. NU BOP. POOH with production equipment.</li> <li>2. Set a CIBP at 2246 ft with 25 ft Class C cement on top to 2136 ft. This will cover Top of Glorieta. Perf @ 1235'</li> <li>3. Perforate at 1 5 ft. Attempt to sqz cmt. Spot a 45 sx Class C cement plug from 1 5 ft – 7 ft. This will cover 7-inch casing shoe and Top of San Andres. WOC and tag.</li> <li>4. Spot a 25 sx Class C cement plug from 100 ft – surface. Back fill as needed. Perf @ 150'</li> <li>5. Cut off wellhead and install dry hole marker. Clean location per regulations.</li> </ul>	of starting any proposed work)	. SEE RULE 19.15.7.14 NMAC		
<ol> <li>MIRU all safety equipment as needed. Kill well. NU BOP. POOH with production equipment.</li> <li>Set a CIBP at 2246 ft with 25 ft Class C cement on top to 2136 ft. This will cover Top of Glorieta.</li> <li>Perf @ 1235'</li> <li>Perforate at 1 \$\$ ft. Attempt to sqz cmt. Spot a 45 sx Class C cement plug from 1 \$\$ ft - 7\$ ft. This will cover 7-inch casing shoe and Top of San Andres. WOC and tag.</li> <li>Spot a 25 sx Class C cement plug from 1 \$\$ ft - surface. Back fill as needed.</li> <li>Surf @ 150'</li> <li>Cut off wellhead and install dry hole marker. Clean location per regulations.</li> </ol>				CBL to surface.
<ul> <li>2. Set a CIBP at 2246 ft with 25 ft Class C cement on top to 2136 ft. This will cover Top of Glorieta.</li> <li>3. Perf @ 1235'</li> <li>3. Perforate at 1 \$\screwtcolor 5\$ ft. Attempt to sqz cmt. Spot a 45 sx Class C cement plug from 1\$\screwtcolor 5\$ ft - 7\$\screwtcolor ft. This will cover 7-inch casing shoe and Top of San Andres. WOC and tag.</li> <li>4. \$\screwtcolor 6\$ ta 25 sx Class C cement plug from 1\$\screwtcolor 6\$ ft - surface. Back fill as needed.</li> <li>5. Cut off wellhead and install dry hole marker. Clean location per regulations.</li> </ul>				
<ul> <li>and Top of San Andres. WOC and tag.</li> <li>4. Shot a 25 sx Class C cement plug from 100 ft – surface. Back fill as needed.</li> <li>5. Cut off wellhead and install dry hole marker. Clean location per regulations.</li> </ul>	2. Set a CIBP at 2246 ft with 25 ft Class	C cement on top to 2136 ft. The	is will cover Top of	Glorieta. Perf @ 1235'
<ul> <li>4. Spot a 25 sx Class C cement plug from 180 ft – surface. Back fill as needed. (Perf @ 150')</li> <li>5. Cut off wellhead and install dry hole marker. Clean location per regulations.</li> </ul>	and Top of San Andres. WOC and tag.	-		Spot 25 sx cmt 812' - 712' - T. of SA
Wellbore Schematics attached.			needed. Perf @ 1	50 <sup>°</sup>
	Wellbore Schematics attached.			
Spud Date: Rig Release Date:	Snud Date:	Rig Release Da	ate.	
****SEE ATTACHED COA's****       Must be plugged by 3/14/2023	-			d by 2/14/2022
I hereby certify that the information above is true and complete to the best of my knowledge and belief.				
SIGNATURE	SIGNATURE	TITLEReservoir	Engineer	DATE03/02/2022
Type or print nameRudy Wildenstein E-mail address:rwildenstein@silverbackexp.com PHONE: _713-829-0362 For State Use Only		ein E-mail address:rwilder	nstein@silverbacke>	xp.com PHONE: _713-829-0362
			St. 117M	
APPROVED BY:		IIILE	staff man	agerDATE

.

Released to Imaging: 3/16/2022 11:42:53 AM

## CONDITIONS FOR PLUGGING AND ABANDONMENT

## OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
  - A) Fusselman
  - B) Devonian
  - C) Morrow
  - D) Wolfcamp
  - E)Bone Springs
  - F) Delaware
  - G) Any salt sections
  - H) Abo
  - I) Glorieta
  - J) Yates.
  - K)Potash---(In the R-111-P Area (Page 3 & 4), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. **If cement does not exist behind casing strings at recommended formation depths,** the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

## DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name2. Lease and Well Number3. API Number4. Unit Letter5. QuarterSection (feet from the North, South, East or West)6. Section, Township and Range7. Plugging Date8. County(SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

## SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

## R-111-P Area

#### T 18S – R 30E

Sec 10 Unit P. Sec 11 Unit M,N. Sec 13 Unit L,M,N. Sec 14 Unit C -P. Sec 15 Unit A G,H,I,J,K,N,O,P. Sec 22 Unit All except for M. Sec 23, Sec 24 Unit C,D,E,L, Sec 26 Unit A-G, Sec 27 Unit A,B,C

#### T 19S – R 29E

Sec 11 Unit P. Sec 12 Unit H-P. Sec 13. Sec 14 Unit A,B,F-P. Sec 15 Unit P. Sec 22 Unit A,B,C,F,G,H,I,J K,N,O,P. Sec 23. Sec 24. Sec 25 Unit D. Sec 26 Unit A- F. Sec 27 Unit A,B,C,F,G,H.

#### T 19S – R 30E

Sec 2 Unit K,L,M,N. Sec 3 Unit I,L,M,N,O,P. Sec 4 Unit C,D,E,F,G,I-P. Sec 5 Unit A,B,C,E-P. Sec 6 Unit I,O,P. Sec 7 – Sec 10. Sec 11 Unit D, G—P. Sec 12 Unit A,B,E-P. Sec 13 Unit A-O. Sec 14-Sec 18. Sec 19 Unit A-L, P. Sec 20 – Sec 23. Sec 24 Unit C,D,E,F,L,M,N. Sec 25 Unit D. Sec 26 Unit A-G, I-P. Sec 27, Sec 28, Sec 29 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 32 Unit A,B,G,H,I,J,N,O,P. Sec 33. Sec 34. Sec 35. Sec 36 Unit D,E,F,I-P.

#### T 19S – R 31E

Sec 7 Unit C,D,E,F,L. Sec 18 Unit C,D,E,F,G,K,L. Sec 31 Unit M. Sec 34 Unit P. Sec 35 Unit M,N,O. Sec 36 Unit O,P.

#### T 20S – R 29E

Sec 1 Unit H,I,P. Sec 13 Unit E,L,M,N. Sec 14 Unit B-P. Sec 15 Unit A,H,I,J,N,O,P. Sec 22 Unit A,B,C,F,G,H,I,J,O,P. Sec 23. Sec 24 Unit C,D,E,F,G,J-P. Sec 25 Unit A-O. Sec 26. Sec 27 Unit A,B,G,H,I,J,O,P. Sec 34 Unit A,B,G,H. Sec 35 Unit A-H. Sec 36 Unit B-G.

#### T 20S – R 30E

Sec 1 – Sec 4. Sec 5 Unit A,B,C,E-P. Sec 6 Unit E,G-P. Sec 7 Unit A-H,I,J,O,P. Sec 8 – 17. Sec 18 Unit A,B,G,H,I,J,O,P. Sec 19 Unit A,B,G,H,I,J,O,P. Sec 20 – 29. Sec 30 Unit A-L,N,O,P. Sec 31 Unit A,B,G,H,I,P. Sec 32 – Sec 36.

#### T 20S – R 31E

Sec 1 Unit A,B,C,E-P. Sec 2. Sec 3 Unit A,B,G,H,I,J,O,P. Sec 6 Unit D,E,F,J-P. Sec 7. Sec 8 Unit E-P. Sec 9 Unit E,F,J-P. Sec 10 Unit A,B,G-P. Sec 11 – Sec 36.

#### T 21S – R 29E

Sec 1 – Sec 3. Sec 4 Unit L1 – L16,I,J,K,O,P. Sec 5 Unit L1. Sec 10 Unit A,B,H,P. Sec 11 – Sec 14. Sec 15 Unit A,H,I. Sec 23 Unit A,B. Sec 24 Unit A,B,C,D,F,G,H,I,J,O,P. Sec 25 Unit A,O,P. Sec 35 Unit G,H,I,J,K,N,O,P. Sec 36 A,B,C,F – P.

#### T 21S – R 30E

Sec 1 – Sec 36

#### T 21S – R 31E

Sec 1 – Sec 36

#### T 22S – R 28E

Sec 36 Unit A,H,I,P.

## T 22S – R 29E

Sec 1. Sec2. Sec 3 Unit I,J,N,O,P. Sec 9 Unit G – P. Sec 10 – Sec 16. Sec 19 Unit H,I,J. Sec 20 – Sec 28. Sec 29 Unit A,B,C,D,G,H,I,J,O,P. Sec 30 Unit A. Section 31 Unit C – P. Sec 32 – Sec 36

## T 22S – R 30E

Sec 1 – Sec 36

## T 22S – R 31E

Sec 1 – Sec 11. Sec 12 Unit B,C,D,E,F,L. Sec 13 Unit E,F,K,L,M,N. Sec 14 – Sec 23. Sec 24 Unit C,D,E,F,K,L,M,N. Sec 25 Unit A,B,C,D. Sec 26 Unit A,BC,D,G,H. Sec 27 – Sec 34.

## T 23S – R 28E

Sec 1 Unit A

## T 23S – R 29E

Sec 1 – Sec 5. Sec 6 Unit A – I, N,O,P. Sec 7 Unit A,B,C,G,H,I,P. Sec 8 Unit A – L, N,O,P. Sec 9 – Sec 16. Sec 17 Unit A,B,G,H,I,P. Sec 21 – Sec 23. Sec 24 Unit A – N. Sec 25 Unit D,E,L. Sec 26. Sec 27. Sec 28 Unit A – J, N,O,P. Sec 33 Unit A,B,C. Sec 34 Unit A,B,C,D,F,G,H. Sec 35. Sec 36 Unit B,C,D,E,F,G,K,L.

## T 23S – R 30E

Sec 1 – Sec 18. Sec 19 Unit A – I,N,O,P. Sec 20, Sec 21. Sec 22 Unit A – N, P. Sec 23, Sec 24, Sec 25. Sec 26 Unit A,B,F-P. Sec 27 Unit C,D,E,I,N,O,P. Sec 28 Unit A – H, K,L,M,N. Sec 29 Unit A – J, O,P. Sec 30 Unit A,B. Sec 32 A,B. Sec 33 Unit C,D,H,I,O,P. Sec 34, Sec 35, Sec 36.

## T 23S – R 31E

Sec 2 Unit D,E,J,O. Sec 3 – Sec 7. Sec 8 Unit A – G, K – N. Sec 9 Unit A,B,C,D. Sec 10 Unit D,P. Sec 11 Unit G,H,I,J,M,N,O,P. Sec 12 Unit E,L,K,M,N. Sec 13 Unit C,D,E,F,G,J,K,L,M,N,O. Sec 14. Sec 15 Unit A,B,E – P. Sec 16 Unit I, K – P. Sec 17 Unit B,C,D,E, I – P. Sec 18 – Sec 23. Sec 24 Unit B – G, K,L,M,N. Sec 25 Unit B – G, J,K,L. Sec 26 – Sec 34. Sec 35 Unit C,D,E.

## T 24S – R 29E

Sec 2 Unit A, B, C, D. Sec 3 Unit A

## T 24S – R 30E

Sec 1 Unit A – H, J – N. Sec 2, Sec 3. Sec 4 Unit A,B,F – K, M,N,O,P. Sec 9 Unit A – L. Sec 10 Unit A – L, O,P. Sec 11. Sec 12 Unit D,E,L. Sec 14 Unit B – G. Sec 15 Unit A,B,G,H.


## T 24S – R 31E

Sec 3 Unit B – G, J – O. Sec 4. Sec 5 Unit A – L, P. Sec 6 Unit A – L. Sec 9 Unit A – J, O,P. Sec 10 Unit B – G, K – N. Sec 35 Unit E – P. Sec 36 Unit E,K,L,M,N.


## T 25S – R 31E

Sec 1 Unit C,D,E,F. Sec 2 Unit A – H.

# Amole AMM State Com #4

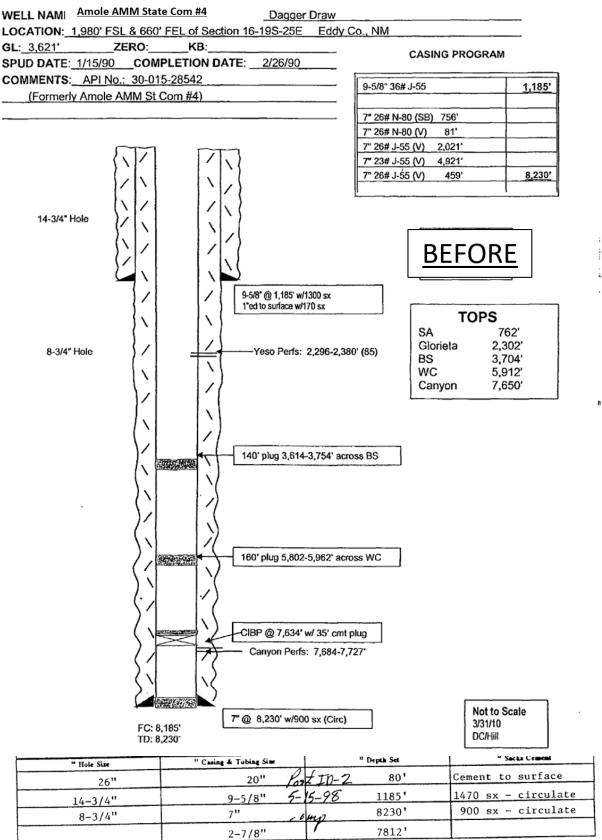

# Amole AMM State Com #4

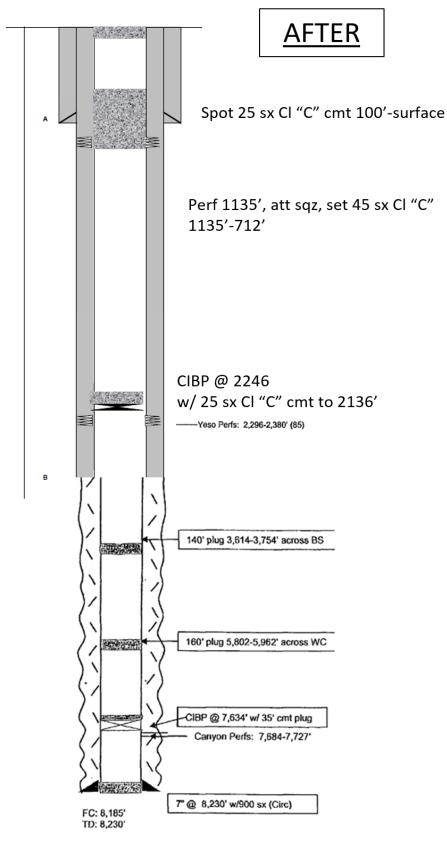

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
Silverback Operating II, LLC	330968
IH10 West, Suite 201	Action Number:
San Antonio, TX 78257	88738
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By		Condition Date
gcordero	None	3/14/2022

Page 8 of 8

.

Action 88738