

Office		New Mex				Form C-	
<u>District 1</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natural Resources		WELL A	PI NO. 30	Revised July 18, 2 -025-01455	2015	
District II – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSER	VATION I	DIVISION	5 India	te Type of I		
District III - (505) 334-6178	1220 Sout	h St. Franc	sis Dr.		5. Indicate Type of Lease STATE SFEE		
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe, NM 87505		6. State	6. State Oil & Gas Lease No.			
(DO NOT USE THIS FORM FOR PROPO	ICES AND REPORTS C SALS TO DRILL OR TO DEI	EPEN OR PLUC	G BACK TO A	CAPRO	CK MALJAN		ne
DIFFERENT RESERVOIR. USE "APPLIC PROPOSALS.)	122-24			8. Well	Number #19		
	Bas Well Injection BXP Operating, LLC	SWD		9 OGRI	D Number	329487	
•	• •						
3. Address of Operator 15	15 West Calle Sur. St, S	15 West Calle Sur. St, Suite 174, NM 88240		MALJAN	10. Pool name or Wildcat [43329] MALJAMAR;GRAYBURG-SAN ANDRES		
4. Well Location			~ .1			Cont Control the	
Unit Letter L	:1980feet fr	om the	South	line and	660	feet from the	
Westline Section 17	Township	17S	Range	33E	NMPM	LEA Count	y
	11. Elevation (Show w	hether DR, I	RKB, RT, GR,			1.3号同意扩展	
	Tullingto Nature of	4207' (		ar Data		In A Discourse of the	19
2. Check Appropriate Box to	o Indicate Nature of	Nouce, Re	port of Oth	er Dala			
PULL OR ALTER CASING     I       DOWNHOLE COMMINGLE     I	MULTIPLE COMPL		CASING/CEN	IENT JOB			
CLOSED-LOOP SYSTEM			OTUED				
OTHER:	leted operations (Clearl	v state all pe	OTHER: rtinent details	, and give perti	nent dates, ir	cluding estimated	□ I date
	ork). SEE RULE 19.15.7	y state all pe	rtinent details	, and give perti Completions:	nent dates, ir Attach wellb	ncluding estimated	D l date
OTHER: 13. Describe proposed or comp of starting any proposed we	ork). SEE RULE 19.15.7 ompletion. nd TOH w/2-3/8" tbg. . Run and set CIBP @40 up and circulate hole w/ . WOC 4hrs & tag. . WOC 4hrs & tag. 0sxs Class C cmt, 50 in a tead, RD, cut anchors, che	y state all pe 7.14 NMAC. 70' w/WL du 10# gelled bu & 50 out. Cir ean location,	rtinent details For Multiple Imp 35' class ine.	Completions: C cement on to surface.	Attach wellb	WOC 4 hrs.	l date
<ul> <li>OTHER:</li> <li>13. Describe proposed or comp of starting any proposed wo proposed completion or rec</li> <li>Test anchors</li> <li>RU WSU. NU BOP. Unseat pkr a</li> <li>RU WL. Run gauge ring to 4070'.</li> <li>TIH w/pkr &amp; tbg, tag plug, come to Spot 35sxs Class C cmt, @ 2070',</li> <li>Spot 35sxs Class C cmt, @ 1500',</li> <li>Perf 2 holes @ 279', Squeeze w/5</li> <li>Put 5sxs @ surface. Cut off well home to the second sec</li></ul>	ork). SEE RULE 19.15.7 ompletion. nd TOH w/2-3/8" tbg. . Run and set CIBP @40 up and circulate hole w/ , WOC 4hrs & tag. , WOC 4hrs & tag. 0sxs Class C cmt, 50 in a lead, RD, cut anchors, cle D & surface owner's req	y state all pe 7.14 NMAC. 70' w/WL du 10# gelled bu & 50 out. Cir ean location, uirements.	rtinent details For Multiple ump 35' class ine. culate cmt to cut/cap well,	Completions: C cement on to surface. plate w/4' post	Attach wellb	WOC 4 hrs.	1 date
<ul> <li>OTHER:</li> <li>13. Describe proposed or comp of starting any proposed wc proposed completion or rec</li> <li>Test anchors</li> <li>RU WSU. NU BOP. Unseat pkr a</li> <li>RU WL. Run gauge ring to 4070'.</li> <li>TIH w/pkr &amp; tbg, tag plug, come to Spot 35sxs Class C cmt, @ 2070',</li> <li>Spot 35sxs Class C cmt, @ 1500',</li> <li>Perf 2 holes @ 279', Squeeze w/5</li> <li>Put 5sxs @ surface. Cut off well how the second second</li></ul>	ork). SEE RULE 19.15.7 ompletion. nd TOH w/2-3/8" tbg. . Run and set CIBP @40 up and circulate hole w/ , WOC 4hrs & tag. , WOC 4hrs & tag. 0sxs Class C cmt, 50 in a nead, RD, cut anchors, cle D & surface owner's requered to the steel pit &	y state all pe 7.14 NMAC. 70' w/WL du 10# gelled bu & 50 out. Cir ean location, uirements.	rtinent details For Multiple Imp 35' class rine. rculate cmt to cut/cap well, o approved dia SEE AT	Completions: C cement on to surface. plate w/4' post sposal facility. TACHED CO	Attach wellb op of CIBP. V w/well info.	WOC 4 hrs.	l date
<ul> <li>OTHER:</li> <li>13. Describe proposed or comp of starting any proposed wc proposed completion or rec</li> <li>Test anchors</li> <li>RU WSU. NU BOP. Unseat pkr a</li> <li>RU WL. Run gauge ring to 4070'.</li> <li>TIH w/pkr &amp; tbg, tag plug, come to Spot 35sxs Class C cmt, @ 2070',</li> <li>Spot 35sxs Class C cmt, @ 1500',</li> <li>Perf 2 holes @ 279', Squeeze w/5</li> <li>Put 5sxs @ surface. Cut off well h</li> <li>Rehab within 90 days per NMOCI</li> <li>S. No earthern pit, all fluids will be</li> </ul>	ork). SEE RULE 19.15.7 ompletion. nd TOH w/2-3/8" tbg. . Run and set CIBP @40 up and circulate hole w/ , WOC 4hrs & tag. , WOC 4hrs & tag. 0sxs Class C cmt, 50 in a lead, RD, cut anchors, cle D & surface owner's req e contained in steel pit & <b>iround Marker</b>	y state all pe 7.14 NMAC. 70' w/WL du 10# gelled bu & 50 out. Cir ean location, uirements.	rtinent details For Multiple Imp 35' class rine. rculate cmt to cut/cap well, o approved dis SEE AT	Completions: C cement on to surface. plate w/4' post sposal facility. TACHED CO	Attach wellb op of CIBP. V w/well info.	WOC 4 hrs.	l date
<ul> <li>OTHER:</li> <li>13. Describe proposed or comp of starting any proposed wo proposed completion or rec</li> <li>Test anchors</li> <li>RU WSU. NU BOP. Unseat pkr a</li> <li>RU WL. Run gauge ring to 4070'.</li> <li>TIH w/pkr &amp; tbg, tag plug, come to Spot 35sxs Class C cmt, @ 2070',</li> <li>Spot 35sxs Class C cmt, @ 1500',</li> <li>Perf 2 holes @ 279', Squeeze w/5</li> <li>Put 5sxs @ surface. Cut off well how the set of the set of</li></ul>	ork). SEE RULE 19.15.7 ompletion. nd TOH w/2-3/8" tbg. . Run and set CIBP @40 up and circulate hole w/ , WOC 4hrs & tag. , WOC 4hrs & tag. 0sxs Class C cmt, 50 in a lead, RD, cut anchors, cla D & surface owner's req e contained in steel pit & <b>fround Marker</b> Rig	y state all pe 7.14 NMAC. 70' w/WL du 10# gelled bu & 50 out. Cir ean location, uirements. hauled off to Release Date	rtinent details For Multiple ump 35' class rine. rculate cmt to cut/cap well, o approved dia SEE AT OF APP	Completions: C cement on to surface. plate w/4' post sposal facility. TACHED CO ROVAL	Attach wellb op of CIBP. V w/well info.	WOC 4 hrs.	L date

For State Use Only			
APPROVED BY: Released to the second	Fortner	TITLE	Compliance Officer A
Released to the series of a function of the series of the	59:56 PM		575-263-6633

DATE 5/24/22

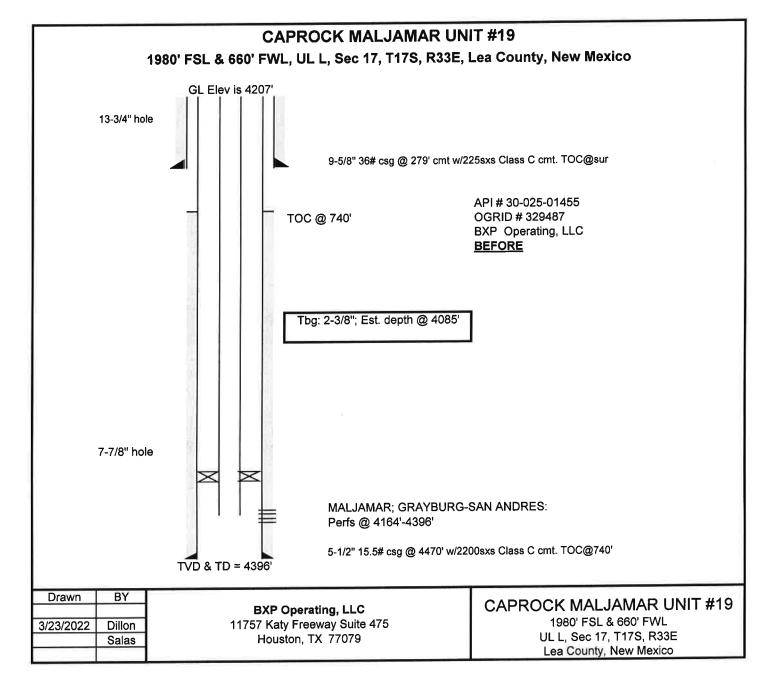

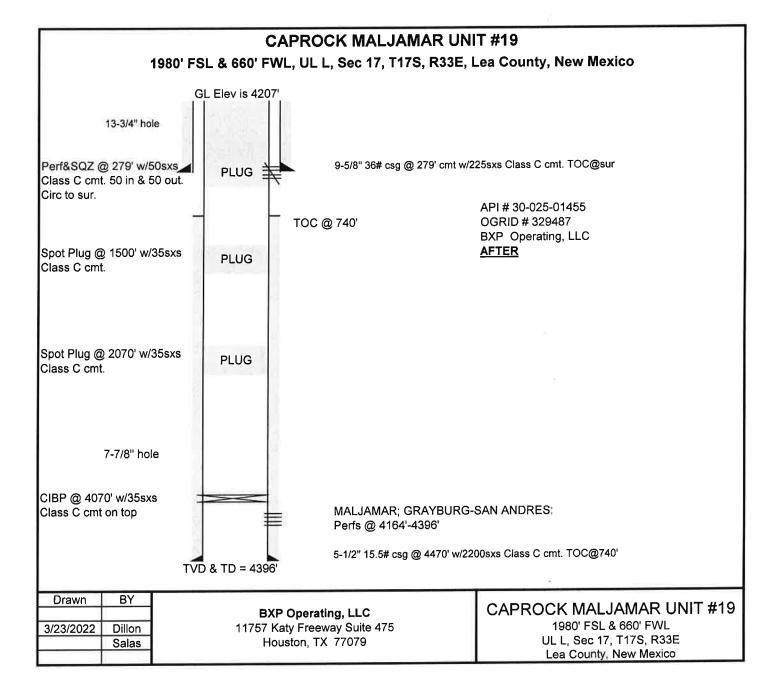

# CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

# Company representative will be on location during plugging procedures.

**1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.

**2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.

**3.** Trucking companies being used to haul oilfield waste fluids to a disposal - commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.

4. Filing a subsequent C-103 will serve as notification that the well has been plugged.

**5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.

**6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.

7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.

8. Produced water will not be used during any part of the plugging operation.

9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.

**10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.

11. Class 'C' cement will be used above 7500 feet.

12. Class 'H' cement will be used below 7500 feet.

**13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged

**14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

**16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set

17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.

**18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.

20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops

- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.

### K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

**21.** If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

# DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

## SPECIAL CASES -----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

# SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

COMMENTS

Operator:	OGRID:
BXP Operating, LLC	329487
11757 KATY FREEWAY	Action Number:
HOUSTON, TX 77079	93478
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)
COMMENTS	

Created By		Comment Date
plmartinez	DATA ENTRY PM	5/24/2022

Page 6 of 7

.

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
BXP Operating, LLC	329487
11757 KATY FREEWAY	Action Number:
HOUSTON, TX 77079	93478
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By		Condition Date
kfortner	See attached COA	5/24/2022

Page 7 of 7

Action 93478