
eiged by OCD + 6/16/2022 11:47:15 PM	State of fiew Mickies		For	<b>Page 1 of</b> m C-103	
<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natural R	esources WELL A		uly 18, 2013	
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIV	ISION	30-025-01468		
District III – (505) 334-6178	1220 South St. Francis I	5. Indic	ate Type of Lease TATE		
1000 Rio Brazos Rd., Aztec, NM 87410 District IV – (505) 476-3460	Santa Fe, NM 87505	3	Oil & Gas Lease No.		
1220 S. St. Francis Dr., Santa Fe, NM 87505	,	o. state	B2229		
	S AND REPORTS ON WELLS	7. Lease	e Name or Unit Agreeme	nt Name	
(DO NOT USE THIS FORM FOR PROPOSAL DIFFERENT RESERVOIR. USE "APPLICAT PROPOSALS.)		CK TO A	Malmar Unit		
1. Type of Well: Oil Well Ga	s Well Other		8. Well Number #103		
2. Name of Operator	er Operating, LLC	9. OGR	9. OGRID Number 371484		
3. Address of Operator	1 Operating, LLC	10. Poo	l name or Wildcat		
	d., Ste. 300 Dallas, TX 75252	(43329)	Maljamar; Grayburg-Sar	n Andres	
4. Well Location					
Unit Letter <u>C</u> : <u>6</u>			et from the <u>West</u>	_line	
Section 18	Township 17S Range	33E NMPN	M County Lea		
1	1. Elevation (Show whether DR, RKB) 4226' GL	, RT, GR, etc.)			
	4220 GL				
12. Check Appr	ropriate Box to Indicate Nature	of Notice. Report or	Other Data		
		•			
NOTICE OF INTE			INT REPORT OF:		
<del>-</del>		MEDIAL WORK MMENCE DRILLING OF	☐ ALTERING CA PNS.□ P AND A	ASING	
<del></del>		SING/CEMENT JOB			
DOWNHOLE COMMINGLE					
CLOSED-LOOP SYSTEM					
OTHER:		HER:			
	l operations. (Clearly state all pertiner SEE RULE 19.15.7.14 NMAC. For lands				
proposed completion or recomp		with the Completions.	Attach wehoofe diagram	01	
Prep loc. MIRU, NU BOP, POO	<u> </u>				
RU Wireline, RIH w/ gauge ring	=				
Set 5-1/2" CIBP @ 4128' spot	25sx cmt, circ w/ P&A mud, test	t to 500 psi. WOC &	TAG.		
50 sx 2370′ – 2470′, P.S. & TAG	ŝ.				
50 sx 1057′ – 1157′, P.S. & TAG	<b>3</b> .				
110 sx 360' – Surf, P.S. Attemp	ot to circ cmt to surface. Verify I	ND BOP.			
Cut off WH 3' below GL. Instal	•				
4" diameter 4' tall above grou	ınd marker	See attached con	ditions of approval		
oud Date: 10/4/1959	Rig Release Date:				
ereby certify that the information above	e is true and complete to the best of m	ny knowledge and belief	•		
R C					
GNATURE Sanda	rann TITLE Petro	leum Engineer	DATE <u>6/16/202</u>	22	
			DHOME 2112	24.011.5	
ype or print nameRyan Sandma	nn E-mail address: <u>rs</u>	sandmann@roverpetro.c	<u>com</u> PHONE:214-23	<u>34-9115</u> _	
or State Use Only					
PPROVED BY: Yeary Forth	TITLE_ Complete	iance Ollin 1	DATE <u>6/27/22</u>		
onditions of Approva	a. p	- force	•		

## Malmar Unit #103 NOI P&A Work Plan

- 1. Prep loc. MIRU, NU BOP, POOH tubing, laying down.
- 2. RU Wireline, RIH w/ gauge ring.
- 3. Set 5-1/2" CIBP @ 4128' spot 25sx cmt, circ w/ P&A mud, test to 500 psi. WOC & TAG.
- 4. 50 sx 2370′ 2470′, P.S. & TAG.
- 5. 50 sx 1057' 1157', P.S. & TAG.
- 6. 110 sx 360' Surf, P.S. Attempt to circ cmt to surface. Verify ND BOP.
- 7. Cut off WH 3' below GL. Install DHM. Cut off mast anchors 3' below GL. RD MO.

		WELL NAME: Malmar #103 LOCATION: S18 T17S R33E		FIELD: <b>Maljamar</b> API #: <b>30-025-01468</b>			
	COUNTY		ST:	NM	SPUD DATE:	10/04/5	59
111	KB:		226' TD: 4!	<b>588'</b> PBTD:	4560'		
111		DATED:	06/15/22	BY:	R.	Sandmann	
		0' cmt'd w/ 250 s	sx				
	TOC Surface	CASING DETA	TI C				
		PURPOSE	SIZE	WEIGHT	GRADE	SET DEPTH	TOP OF CEMENT
		SURFACE	8 5/8"	24#	GIVIDE	310'	0' (circ.)
		INTERMEDIATE					5 (55.)
		PRODUCTION	5 1/2"	14#	H-40	4581'	2989' (calc.)
		LINER					
		TUBING DETA	JI S				
		DESCRIPTION	SIZE	WEIGHT	GRADE	SET DEPTH	
		96 Jts	2 3/8			2,976	
			1		1	-	4
			+	+	+	+	-
			+		+		_
			1	<u> </u>	1		_
		ROD DETAILS					_
		DESCRIPTION	SIZE	WEIGHT	GRADE	SET DEPTH	
			+		+		_
	Last Tag @ 3021'		+		+		_
	Last rag @ 3021						
			•			•	_
				TORS			
				TOPS	T		
				FORMATION	TOP 1107'	BOTTOM	4
				Anhy Salt	2420'	+	+
				Yates	3458'	+	+
				Queen	3553'	1	7
				Grayburg	3991'		
				San Andres	4186'		
	4171' 5 jts 2 3/8 tbg	J. Stuck in hole					
	_						
	Doufs 4406 4505			10/59	11/73	03/74	7
	Perfs 4186-4535'			<b>Perfs</b> 4189-90	<b>Re Perf</b> 4248-4310	<b>Re Perf</b> 4178-90	-
<u> </u>	_			4252-76	7270-4310	4178-90	-
				4283-87	1	7270-4310	-
				4529-35	+	+	-
				4186-90	+	+	$\dashv$
				4100-90			
	F 4 (2)( 0 4=04)						
	5 1/2" @ 4581' ci	mt'd w/ 300 sx					
	PBTD 4560'						

TD 4588'

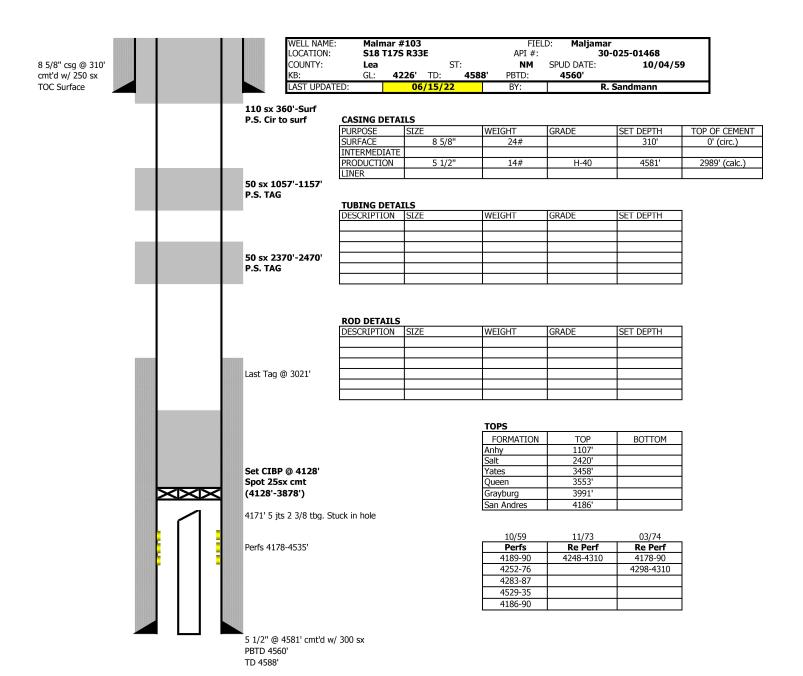

# CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

# Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

**21.** If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

# DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County

## SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)


#### SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

## Malmar Unit #103 NOI P&A Work Plan

- 1. Prep loc. MIRU, NU BOP, POOH tubing, laying down.
- 2. RU Wireline, RIH w/ gauge ring.
- 3. Set 5-1/2" CIBP @ 4128' spot 25sx cmt, circ w/ P&A mud, test to 500 psi. WOC & TAG.
- 4. 50 sx 2370′ 2470′, P.S. & TAG.
- 5. 50 sx 1057' 1157', P.S. & TAG.
- 6. 110 sx 360' Surf, P.S. Attempt to circ cmt to surface. Verify ND BOP.
- 7. Cut off WH 3' below GL. Install DHM. Cut off mast anchors 3' below GL. RD MO.

	WELL NA LOCATIO	N: <b>S18 T17</b> 5	S R33E	FIEL API #:	30-	-025-01468	
	COUNTY: KB:		ST: <b>226</b> ' TD: <b>4</b> !	NM 588' PBTD:	SPUD DATE: <b>4560</b> '	10/04/59	<sup>9</sup>
	LAST UPI		06/15/22	BY:		Sandmann	
1 1 1 1		)' cmt'd w/ 250 s		Ы.	I Ni	Sanamann	
1 1 1 1	TOC Surface	,					
		CASING DETA					
		PURPOSE	SIZE	WEIGHT	GRADE	SET DEPTH	TOP OF CEMEN
		SURFACE	8 5/8"	24#		310'	0' (circ.)
1 1 1 1		INTERMEDIATE		14#	11.40	45011	2000! (apla )
1 1 1 1		PRODUCTION LINER	5 1/2"	14#	H-40	4581'	2989' (calc.)
		LINEX	ı		1		
		TUBING DETA	ILS				
1 1 1 1		DESCRIPTION	SIZE	WEIGHT	GRADE	SET DEPTH	
1 1 1 1		96 Jts	2 3/8			2,976	
1 1 1 1				_			
		DESCRIPTION	SIZE	WEIGHT	GRADE	SET DEPTH	I
1 1 1 1		DESCRIPTION	SIZE	WEIGHT	GIVADE	JET DEI III	
	Last Tag @ 3021'						
				TOPS			
					TOD	роттом	
				FORMATION Anhy	TOP 1107'	BOTTOM	
				Salt	2420'		
				Yates	3458'		
				Queen	3553'		
				Grayburg	3991'		
				San Andres	4186'		
	4171' 5 jts 2 3/8 tbg.	. Stuck in hole					
				10/50	11/70	02/74	
	Perfs 4186-4535'			10/59 Perfs	11/73 Re Perf	03/74 <b>Re Perf</b>	I
	Fei15 4100-4005			4189-90	4248-4310	4178-90	
				4252-76	12 10-7310	4298-4310	
				4283-87	+	1230 7310	
				4529-35	+	+	
				4186-90			

TD 4588'

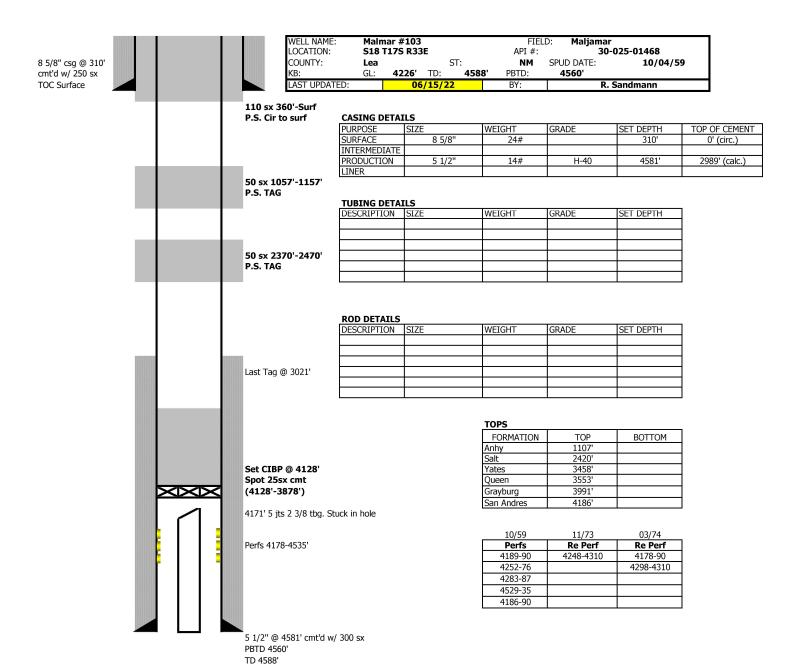

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

COMMENTS

Action 118211

#### **COMMENTS**

Operator:	OGRID:
ROVER OPERATING, LLC	371484
17304 Preston Road	Action Number:
Dallas, TX 75252	118211
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### COMMENTS

Created B	Comment	Comment Date
plmartir	DATA ENTRY PM	6/28/2022

District III

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 118211

## **CONDITIONS**

Operator:	OGRID:
ROVER OPERATING, LLC	371484
17304 Preston Road	Action Number:
Dallas, TX 75252	118211
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

#### CONDITIONS

Created By		Condition Date
kfortner	See attached COA	6/27/2022