

<b>Well Name:</b> GANTRYPerson FEDERAL	<b>Well Location:</b> T19S / R33E / SEC 15 / NWNW /	<b>County or Parish/State:</b> LEA / NM
<b>Well Number:</b> 3	<b>Type of Well:</b> OIL WELL	<b>Allottee or Tribe Name:</b>
<b>Lease Number:</b> NMNM36915	<b>Unit or CA Name:</b>	<b>Unit or CA Number:</b>
<b>US Well Number:</b> 300253626100S1	<b>Well Status:</b> Oil Well Shut In	<b>Operator:</b> COG OPERATING LLC

Accepted for Record Only

SUBJECT TO LIKE  
APPROVAL BY BLM

NMOCD 10/7/22

X7

### Notice of Intent

**Sundry ID:** 2646397

**Type of Submission:** Notice of Intent

**Type of Action:** Plug and Abandonment

**Date Sundry Submitted:** 12/01/2021

**Time Sundry Submitted:** 10:01

**Date proposed operation will begin:** 12/01/2021

**Procedure Description:** 1. Prior to rig up, provide CBL evidence of cement tops behind 5 1/2" or submit a CBL taken at 0 PSI after the Yates formation top plug described below sets. Plugging operations may be modified ensuring plugs cover the drilled wellbore I.D. 2. Drill out CIBP @ 3630' w/ 10' cmt on top & tag PBTB. 3. Spot 110 sx cmt @ 3770-3240'. WOC & Tag @ 3240' or above. (7 Rvs & Yates) 4. Pressure test csg to 500 PSI after Yates formation top plug sets. 5. Spot 30 sx cmt (5) 3140-2880'. WOC & Tag @ 2880' or above. (Tansill & B/Salt) 6. Perf & Sqz 50 sx cmt @ 1570-1370'. WOC & Tag (T/Salt & 8 5/8" Shoe). Sqz cmt through a packer leaving the plug top in the 5 1/2" csg and 5 1/2" X 8 5/8" annulus 1370' or above. Close tbg valve & hole 9 lb/gal displacement fluid in place until the plug sets. 7. Perf & Sqz 25 sx cmt (3> 60' to surface through 5 1/2" & 8 5/8" annulus. 8. Cut off well head, verify cmt @ surface, weld on Below Ground DHM.

### Surface Disturbance

**Is any additional surface disturbance proposed?:** No

### NOI Attachments

**Procedure Description**

COG\_Gantryperson\_3\_Proposed\_WBD\_20211201100107.pdf

COG\_Gantryperson\_3\_Current\_WBD\_20211201100050.pdf

**Well Name:** GANTRYPERSON  
FEDERAL

**Well Location:** T19S / R33E / SEC 15 /  
NWNW /

**County or Parish/State:** LEA /  
NM

**Well Number:** 3

**Type of Well:** OIL WELL

**Allottee or Tribe Name:**

**Lease Number:** NMNM36915

**Unit or CA Name:**

**Unit or CA Number:**

**US Well Number:** 300253626100S1

**Well Status:** Oil Well Shut In

**Operator:** COG OPERATING  
LLC

### Conditions of Approval

#### Specialist Review

Gantryperson\_Federal\_3\_Sundry\_ID\_2646397\_P\_A\_20211208075452.pdf

### Operator Certification

*I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.*

**Operator Electronic Signature:** RUTH SHOCKENCY

**Signed on:** DEC 01, 2021 10:01 AM

**Name:** COG OPERATING LLC

**Title:** Regulatory Analyst

**Street Address:** 600 W. ILLINOIS AVE.

**City:** MIDLAND

**State:** TX

**Phone:** (575) 703-8321

**Email address:** RUTH.SHOCKENCY@CONOCOPHILLIPS.COM

### Field Representative

**Representative Name:**

**Street Address:**

**City:**

**State:**

**Zip:**

**Phone:**

**Email address:**

### BLM Point of Contact

**BLM POC Name:** LONG VO

**BLM POC Title:** Petroleum Engineer

**BLM POC Phone:** 5752345972

**BLM POC Email Address:** LVO@BLM.GOV

**Disposition:** Approved


**Disposition Date:** 12/08/2021

**Signature:** Long Vo

<b>COG Operating LLC</b>		<b>CURRENT</b>	
Author:	<a href="#">MRM (7/2017)</a>	Well No.:	<b>#3</b>
Well Name:	<a href="#">Gantryperson</a>	API #:	<a href="#">30-025-36261</a>
Field:	<a href="#">Tonto</a>	Prop #:	<a href="#">29887</a>
County:	<a href="#">Lea</a>	Zone:	<a href="#">Seven Rivers</a>
State:	<a href="#">New Mexico</a>	Spud Date:	<a href="#">8/6/2003</a>
GL:	<a href="#">3670'</a>		<a href="#">330 FNL &amp; 990 FWL</a>
KB:	<a href="#">16'</a>		<a href="#">Sec 15 T19S R33E</a>


Description	O.D.	Grade	Weight	Depth	Cmt Sx	TOC
Surface Csg	8.625"	J-55	32	1,510	800	0'
Prod Csg	5.5"	J-55	15.5	3,900	595	0'

Formation	Tops
Rust	1437
T/Salt	
B/Salt	3045
Tansill	3060
Yates	3294
7 Rivers	3673

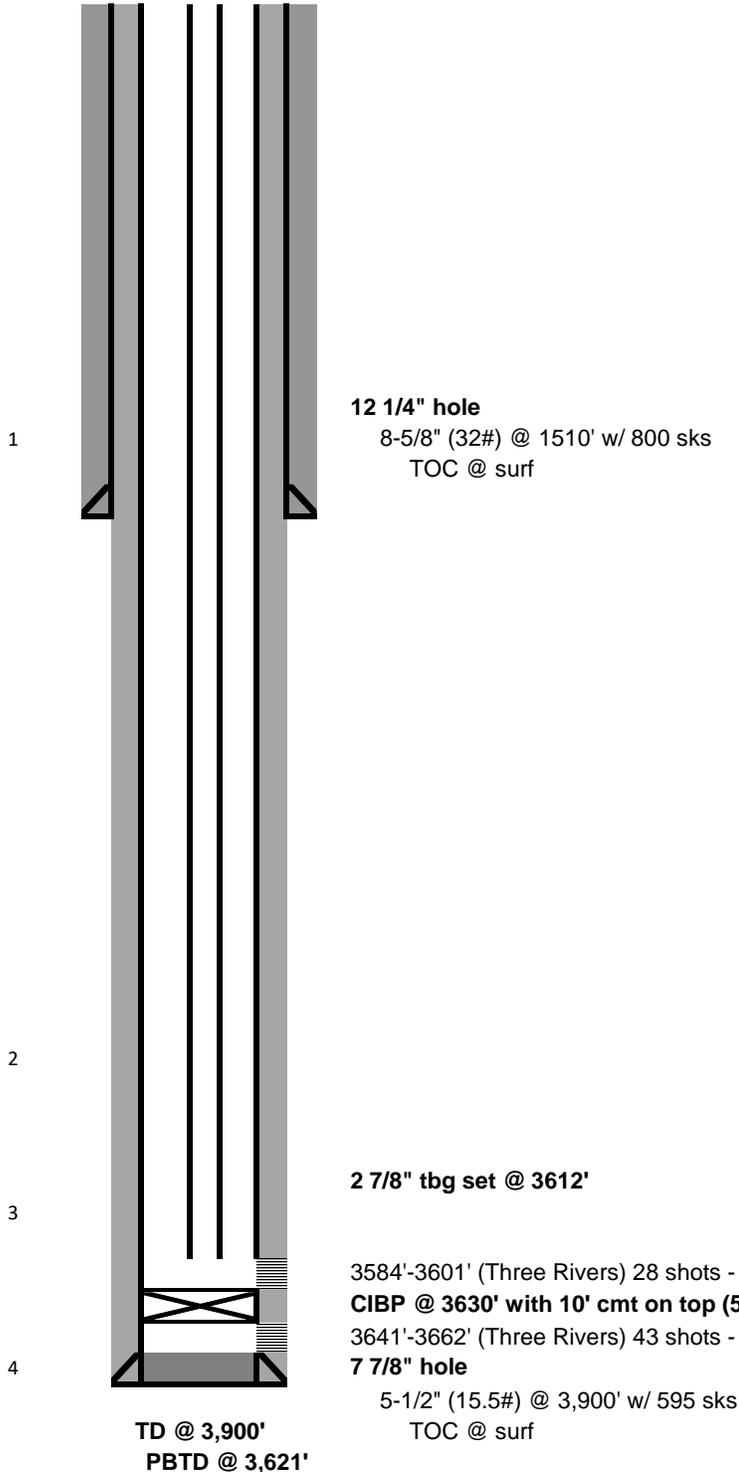

<b>COG Operating LLC</b>		<b>PROPOSED</b>	
Author:	<a href="#">Abby @ BCM</a>	Well No.:	<b>#3</b>
Well Name:	<a href="#">Gantryperson</a>	API #:	<a href="#">30-025-36261</a>
Field:	<a href="#">Tonto</a>	Prop #:	<a href="#">29887</a>
County:	<a href="#">Lea</a>	Zone:	<a href="#">Seven Rivers</a>
State:	<a href="#">New Mexico</a>	Spud Date:	<a href="#">8/6/2003</a>
GL:	<a href="#">3670'</a>		<a href="#">330 FNL &amp; 990 FWL</a>
KB:	<a href="#">16'</a>		<a href="#">Sec 15 T19S R33E</a>

Description	O.D.	Grade	Weight	Depth	Cmt Sx	TOC
Surface Csg	8.625"	J-55	32	1,510	800	0'
Prod Csg	5.5"	J-55	15.5	3,900	595	0'

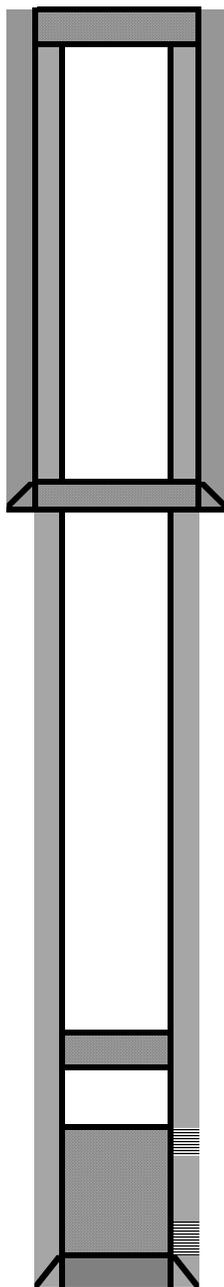

7. Perf & Sqz 25 sx cmt @ 60' to surface through 5 1/2" & 8 5/8" annulus.

Formation	Tops
Rust	1437
T/Salt	
B/Salt	3045
Tansill	3060
Yates	3294
7 Rivers	3673

**12 1/4" hole**

8-5/8" (32#) @ 1510' w/ 800 sks  
TOC @ surf

6. Perf & Sqz 50 sx cmt @ 1570-1370'. WOC & Tag (T/Salt & 8 5/8" Shoe). Sqz cmt through a packer leaving the plug top in the 5 1/2" csg and 5 1/2" X 8 5/8" annulus 1370' or above. Close tbg valve & hole 9 lb/gal displacement fluid in place until the plug sets.

5. Spot 30 sx cmt @ 3140-2880'. WOC & Tag @ 2880' or above. (Tansill & B/Salt)

4. Pressure test csg to 500 PSI after Yates formation top plug sets.

3584'-3601' (Three Rivers) 28 shots - 5/2011 acidized with 1500 gal & frac'd with 40,000 lbs

3. Spot 110 sx cmt @ 3770-3240'. WOC & Tag @ 3240' or above. (7 Rvs & Yates)

2. Drill out CIBP @ 3630' w/ 10' cmt on top & tag PBTB.

3641'-3662' (Three Rivers) 43 shots - 8/2003 frac'd with 73,000 lbs

**7 7/8" hole**

5-1/2" (15.5#) @ 3,900' w/ 595 sks  
TOC @ surf

TD @ 3,900'  
PBTB @ 3,621'

1. Prior to rig up, provide CBL evidence of cement tops behind 5 1/2" or submit a CBL taken at 0 PSI after the Yates formation top plug described below sets. Plugging operations may be modified ensuring plugs cover the drilled wellbore I.D.

## PLUG AND ABANDONMENT CONDITIONS OF APPROVAL

<b>OPERATOR'S NAME:</b>	<b>COG Operating LLC</b>
<b>LEASE NO.:</b>	<b>NMNM36915</b>
<b>WELL NAME &amp; NO.:</b>	<b>Gantryperson Federal 3</b>
<b>US Well Number:</b>	<b>3002536261</b>
<b>LOCATION:</b>	<b>Section 15, T.19 S., R.33 E., NMPM</b>
<b>COUNTY:</b>	<b>Lea County, New Mexico</b>


1. Prior to rig up, provide CBL evidence of cement tops behind 5 1/2" or submit a CBL taken at 0 PSI after the Yates formation top plug described below sets. Plugging operations may be modified ensuring plugs cover the drilled wellbore I.D.
2. Drill out CIBP @ 3630' w/ 10' cmt on top & tag PBTB.
3. Spot 110 sx cmt @ 3770-~~3240~~<sup>3210</sup>'. WOC & Tag @ ~~3240~~<sup>3210</sup>' or above. (7 Rvs & Yates)
4. Pressure test csg to 500 PSI after Yates formation top plug sets.
5. Spot 30 sx cmt (5) 3140-2880'. WOC & Tag @ 2880' or above. (Tansill & B/Salt)
6. Perf & Sqz 50 sx cmt @ 1570-1370'. WOC & Tag (T/Salt & 8 5/8" Shoe). Sqz cmt through a packer leaving the plug top in the 5 1/2" csg and 5 1/2" X 8 5/8" annulus 1370' or above. Close tbg valve & hole 9 lb/gal displacement fluid in place until the plug sets. *WOC & TAG*
7. Perf & Sqz 25 sx cmt (~~3~~<sup>100</sup>) to surface through 5 1/2" & 8 5/8" annulus. *Verify @ surface*
8. Cut off well head, verify cmt @ surface, weld on Below Ground DHM.

**Approval Subject to General Requirements and Special  
Stipulations Attached**

<b>COG Operating LLC</b>		<b>PROPOSED</b>	
Author:	Abby @ BCM	Well No. #3	
Well Name	Gantryperson	API #: 30-025-36261	
Field	Tonto	Prop #: 29887	
County	Lea	Zone: Seven Rivers	
State	New Mexico	330 FNL & 990 FWL	
Spud Date	8/6/2003	Sec 15 T19S R33E	
GL	3670'		
KB	16'		

Description	O.D.	Grade	Weight	Depth	Cmt Sx	TOC
Surface Csg	8.625"	J-55	32	1,510	800	0'
Prod Csg	5.5"	J-55	15.5	3,900	595	0'

Formation	Tops
Rust	1437
T/Salt	
B/Salt	3045
Tansill	3060
Yates	3294
7 Rivers	3673

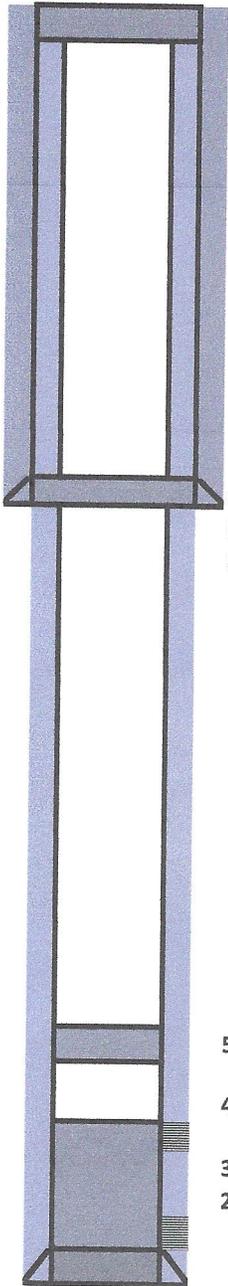

7. Perf & Sqz 25 sx cmt @ ~~60'~~ to surface through 5 1/2" & 8 5/8" annulus.

160'

Verify @ surface

12 1/4" hole

8-5/8" (32#) @ 1510' w/ 800 sks  
TOC @ surf

6. Perf & Sqz 50 sx cmt @ 1570-1370'. WOC & Tag (T/Salt & 8 5/8" Shoe). Sqz cmt through a packer leaving the plug top in the 5 1/2" csg and 5 1/2" X 8 5/8" annulus 1370' or above. Close tbg valve & hole 9 lb/gal displacement fluid in place until the plug sets.

WOC & TAG

5. Spot 30 sx cmt @ 3140-2880'. WOC & Tag @ 2880' or above. (Tansill & B/Salt)

4. Pressure test csg to 500 PSI after Yates formation top plug sets.

3584'-3601' (Three Rivers) 28 shots - 5/2011 acidized with 1500 gal & frac'd with 40,000 lbs

3. Spot 110 sx cmt @ ~~3770-3240'~~ WOC & Tag @ ~~3240'~~ or above. (7 Rvs & Yates)

(3770' to 3210')

2. Drill out CIBP @ 3630' w/ 10' cmt on top & tag PBTD.

3641'-3662' (Three Rivers) 43 shots - 8/2003 frac'd with 73,000 lbs

7 7/8" hole

5-1/2" (15.5#) @ 3,900' w/ 595 sks

TOC @ surf

TD @ 3,900'

PBTD @ 3,621'


1. Prior to rig up, provide CBL evidence of cement tops behind 5 1/2" or submit a CBL taken at 0 PSI after the Yates formation top plug described below sets. Plugging operations may be modified ensuring plugs cover the drilled wellbore I.D.

Prairie Chicken

<b>COG Operating LLC</b>		<b>CURRENT</b>	
Author:	MRM (7/2017)	Well No.:	#3
Well Name:	Gantryperson	API #:	30-025-36261
Field:	Tonto	Prop #:	29887
County:	Lea	Zone:	Seven Rivers
State:	New Mexico		
Spud Date:	8/6/2003		330 FNL & 990 FWL
GL:	3670'		Sec 15 T19S R33E
KB:	16'		

Description	O.D.	Grade	Weight	Depth	Cmt Sx	TOC
Surface Csg	8.625"	J-55	32	1,510	800	0'
Prod Csg	5.5"	J-55	15.5	3,900	595	0'

Formation	Tops
Rust	1437
T/Salt	
B/Salt	3045
Tansill	3060
Yates	3294
7 Rivers	3673

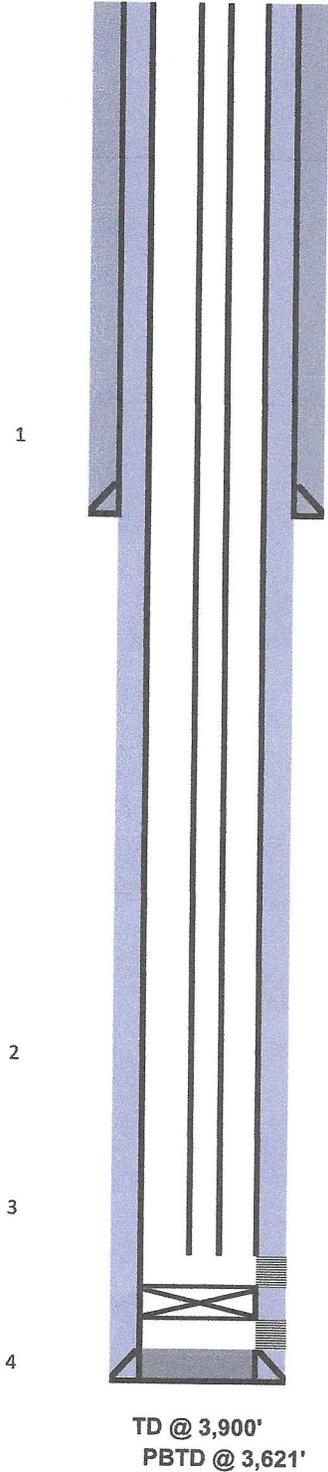

12 1/4" hole  
 8-5/8" (32#) @ 1510' w/ 800 sks  
 TOC @ surf

2 7/8" tbg set @ 3612'

3584'-3601' (Three Rivers) 28 shots - 5/2011 acidized with 1500 gal & frac'd with 40,000 lbs  
**CIBP @ 3630' with 10' cmt on top (5/25/2011)**

3641'-3662' (Three Rivers) 43 shots - 8/2003 frac'd with 73,000 lbs  
**7 7/8" hole**

5-1/2" (15.5#) @ 3,900' w/ 595 sks  
 TOC @ surf

TD @ 3,900'  
 PBD @ 3,621'

**BUREAU OF LAND MANAGEMENT  
Carlsbad Field Office  
620 East Greene Street  
Carlsbad, New Mexico 88220  
575-234-5972**

**Permanent Abandonment of Federal Wells  
Conditions of Approval (LPC Habitat)**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety (90)** days from the approval date of this Notice of Intent to Abandon.

**If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.**

**The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.**

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

**Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:**

From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



# United States Department of the Interior

## BUREAU OF LAND MANAGEMENT

Carlsbad Field Office  
620 E. Greene St.  
Carlsbad, New Mexico 88220-6292  
www.blm.gov/nm



In Reply Refer To: 1310

### Reclamation Objectives and Procedures

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos  
Supervisory Petroleum Engineering Tech  
575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias  
Environmental Protection Specialist  
575-234-6230

Crisha Morgan  
Environmental Protection Specialist  
575-234-5987

Melissa Horn  
Environmental Protection Specialist  
575-234-5951

Kelsey Wade  
Environmental Protection Specialist  
575-234-2220

Trishia Bad Bear, Hobbs Field Station  
Natural Resource Specialist  
575-393-3612

**District I**  
 1625 N. French Dr., Hobbs, NM 88240  
 Phone:(575) 393-6161 Fax:(575) 393-0720  
**District II**  
 811 S. First St., Artesia, NM 88210  
 Phone:(575) 748-1283 Fax:(575) 748-9720  
**District III**  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 Phone:(505) 334-6178 Fax:(505) 334-6170  
**District IV**  
 1220 S. St Francis Dr., Santa Fe, NM 87505  
 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

COMMENTS  
 Action 149473

**COMMENTS**

Operator: COG OPERATING LLC 600 W Illinois Ave Midland, TX 79701	OGRID: 229137
	Action Number: 149473
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

**COMMENTS**

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM	10/9/2022

**District I**  
 1625 N. French Dr., Hobbs, NM 88240  
 Phone:(575) 393-6161 Fax:(575) 393-0720

**District II**  
 811 S. First St., Artesia, NM 88210  
 Phone:(575) 748-1283 Fax:(575) 748-9720

**District III**  
 1000 Rio Brazos Rd., Aztec, NM 87410  
 Phone:(505) 334-6178 Fax:(505) 334-6170

**District IV**  
 1220 S. St Francis Dr., Santa Fe, NM 87505  
 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS

Action 149473

**CONDITIONS**

Operator: COG OPERATING LLC 600 W Illinois Ave Midland, TX 79701	OGRID: 229137
	Action Number: 149473
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

**CONDITIONS**

Created By	Condition	Condition Date
kfortner	Like approval from BLM	10/7/2022